

DISTRICT I
P.O. Box 1980, Hobbs NM 88240

DISTRICT II
811 South First, Artesia, NM 88210

DISTRICT III
1000 Rio Brazos Rd, Aztec, NM 87410

OIL CONSERVATION DIVISION
2040 South Pacheco
Santa Fe, New Mexico 87505

WELL API NO. 30-015-00952
5. Indicate Type of Lease STATE <input checked="" type="checkbox"/> FEE <input type="checkbox"/>
6. State Oil & Gas Lease No. 648
7. Lease Name or Unit Agreement Name Artesia Metex Unit
8. Well No. 36
9. Pool name or Wildcat Artesia Guen Grayburg SA
10. Elevation (Show whether DF, RKB, RT, GR, etc.) 3551 DF

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS).	
1. Type Of Well: OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER	2. Name of Operator Mack Energy Corporation
3. Address of Operator P.O. Box 960, Artesia, NM 88211-0960	4. Well Location Unit Letter <u>E</u> : <u>2310</u> Feet From The <u>N</u> Line and <u>30</u> Feet From The <u>W</u> Line Section <u>25</u> Township <u>18S</u> Range <u>27E</u> NMPM <u>Eddy</u> County
10. Elevation (Show whether DF, RKB, RT, GR, etc.) 3551 DF	

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data	
NOTICE OF INTENTION TO:	SUBSEQUENT REPORT OF:
PERFORM REMEDIAL WORK <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>
OTHER: <input type="checkbox"/>	PLUG AND ABANDONMENT <input type="checkbox"/>
	CASING TEST AND CEMENT JOB <input type="checkbox"/>
	OTHER: <input checked="" type="checkbox"/>

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

09/25/96 RU pump stuck. Back off rods & strip out of hole. Laid down 31 jts 2 3/8" tbg & 38 5/8" rods. PU notched collar & good used 2 3/8" tbg & RIH. Tag @ 1879' w/60 1/2 jts. RU air rig & clean out to 1959' w/63 jts & started drilling hard. Blow well dry.

09/26/96 RIH w/Mill & DC & tag @ 1950' start milling. Drilled down 12' iron sulfide, no metal. POH w/mill & had hole in jt #32. Mill burned up from no water. RIH w/new mill. Clean out to 1961'.

09/27/96 RIH to 1961', no fill & clean out to TD @ 2004'. POH & lay down DC. RIH & land SN @ 1961' w/63 jts. RIH w/2x1 1/2x16' HVR PAP pump. 76-3/4" rods & 2'-6"-8' ponies.

10/07/96 RU BJ & pump 250 gals 15% NEFE acid down csg. Acid came back hot.

10/11/96 Shut well in. Laid down rods, pump & tbg. Broke off wellhead.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Cristina D. Carter TITLE Production Clerk DATE 12/4/97

TYPE OR PRINT NAME TELEPHONE NO. (505)748-1288

(This space for State Use)

SUPERVISOR, DISTRICT II

APPROVED BY _____ TITLE _____ DATE _____

CONDITIONS OF APPROVAL, IF ANY:

DEC - 9 1997