

SERVICE RECEIVED
 INSTRUCTION
 PAYMENT
 FILE
 S.G.S.
 LAND OFFICE
 OPERATOR

ILLEGIBLE

COMMISSION RECEIVED

Form C-103
 Supersedes Old
 C-102 and C-103
 Effective 1-1-85

DEC 6 1982

O.C.D.

ARTESIA OFFICE

5a. Indicate Type of Lease
 State Fee
 5. State Oil & Gas Lease No.
 E-1287-3

SUNDRY NOTICES AND REPORTS ON WELLS
DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE APPLICATION FOR PERMIT - FORM C-101 FOR SUCH PROPOSALS.

OIL WELL GAS WELL OTHER- **Water Injection Well**
 Name of Operator: **BOYD OPERATING COMPANY**
 Address of Operator: **P. O. Box 1756, Roswell, New Mexico 88201**
 Location of Well:
 NIT LETTER **B** **330** FEET FROM THE **N** LINE AND **2310** FEET FROM THE **E** LINE, SECTION **14** TOWNSHIP **18S** RANGE **28E** NMPM.
 7. Unit Agreement Name
 8. Name of Lease Name: **State C**
 9. Well No.: **#5**
 10. Field and Pool, or Wildcat: **Art. Qn, Gbg. SA**
 11. Elevation (Show whether DF, RT, GR, etc.): **3600'**
 12. County: **Eddy**

Check Appropriate Box To Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

SUBSEQUENT REPORT OF:

PERFORM REMEDIAL WORK PLUG AND ABANDON REMEDIAL WORK ALTERING CASING
 TEMPORARILY ABANDON CHANGE PLANS COMMENCE DRILLING OPNS. PLUG AND ABANDONMENT
 PULL OR ALTER CASING OTHER CASING TEST AND CEMENT JOB

13. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

- 10/19/82 Rig up on well tried to unseat packer tubing, pulled into at 2081'. Rig up reverse rig, ran 6 1/4 bit to clean casing, ran one joint wash pipe to wash over fish.
- 10/20/82 Pickup RTTS, go in hole to 2030'. Set packer press to 2000 PSI could not pump into formation, release packer come up hole to 500'. Set packer pressure to 1000 PSI no leaks. Release packer, set packer at 310' found hole between 310 and 327 feet.
- 10/21/82 Ran tubing up to 2070' spotted 100 ft. plug, pull tubing to 665 spot 100ft plug pulled tubing to 456'. Pump 100' plug. Pull tubing out of hole, tie onto bradon head, circulate cement out through 7 inch pipe, 10 sacks cement. Job complete.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

OPERATOR: *J. M. Boyd* DATE: 12/3/82
 APPROVED BY: *Randy Brooks* DATE: 3/9/84
 TITLE: *Geologist*
 CONDITIONS OF APPROVAL, IF ANY: