

| | |
|------------------------|--|
| NO. OF COPIES RECEIVED | |
| DISTRIBUTION | |
| SANTA FE | |
| FILE | |
| U.S.G.S. | |
| LAND OFFICE | |
| OPERATOR | |

OIL CONSERVATION DIVISION

RECEIVED BY O. BOX 2088
SANTA FE, NEW MEXICO 87501

JUN 29 1987

O. C. S.
ARTESIA, CALIF.

Form C-103
Revised 10-1-79

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO OPERATE OR PLUG BACK TO A DIFFERENT RESERVOIR.
USE "APPLICATION FOR PERMIT TO DRILL" (FORM C-101) FOR SUCH PROPOSALS.)

1. ☒ OIL WELL ☐ GAS WELL ☐ OTHER

2. Name of Operator
W. E. Jeffers

3. Address of Operator
P. O. Box 65, Artesia, New Mexico 88211-0065

4. Location of Well
UNIT LETTER M 330 FEET FROM THE South LINE AND 330 FEET FROM
THE West LINE, SECTION 15 TOWNSHIP 18S RANGE 28E NMPM.

5a. Indicate Type of Lease
State ☒ Fee ☐

5. State Oil & Gas Lease No.
B-11540

7. Unit Agreement Name

8. From or Lease Date
Vandeventer

9. Well No.
Two (2)

10. Field and Pool, or Subunit
Artesia

12. County
Eddy

15. Elevation (Show whether DF, RT, GR, etc.)

16. Check Appropriate Box To Indicate Nature of Notice, Report or Other Data

| NOTICE OF INTENTION TO: | | SUBSEQUENT REPORT OF: | |
|--|---|--|--|
| PERFORM REMEDIAL WORK <input type="checkbox"/> | PLUG AND ABANDON <input type="checkbox"/> | REMEDIAL WORK <input type="checkbox"/> | ALTERING CASINGS <input type="checkbox"/> |
| TEMPORARILY ABANDON <input type="checkbox"/> | CHANGE PLANS <input type="checkbox"/> | COMMENCE DRILLING OPNS. <input type="checkbox"/> | PLUG AND ABANDONMENT <input checked="" type="checkbox"/> |
| PULL OR ALTER CASING <input type="checkbox"/> | OTHER <input type="checkbox"/> | CASING TEST AND CEMENT JOBS <input type="checkbox"/> | |

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1503.

May 27, 1987

- (1) Spot 40 sax with 4% CaCl at 631' thru tubing. Shut down. Cement did not tag.
- (2) Same as above. would not tag.
- (3) Same as Above. Tagged cement with tubing @ 621'.
- (4) Displaced 40 sax again at 620'. Tagged cement at 480'- Load casing with fw gel.
Perforate 8 5/8" casing at 420' with 4 holes. Displace 35 sax thru 2" tubing. Tagged at 360'.
Tie onto 8 5/8" and pump 50 barrels fw gel. (hole in 8 5/8" casing at 270').
Pump 242 sax cement down casing. Shut down 4 hours. 100' to cement. Fill casing to top with cement and set marker.
Cleaned up location.

Post ID 2
7-10-87
P47

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED W.E. Jeffers TITLE Owner DATE 6/27/87

APPROVED BY Michael S. Whitefield TITLE _____ DATE JAN 12 1988

CONDITIONS OF APPROVAL, IF ANY: