


OIL CONSERVATION DIVISION

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

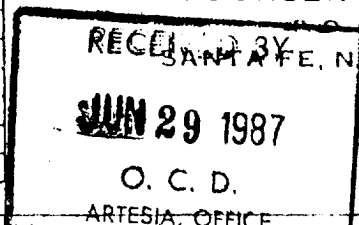

BOX 2088

SANTA FE, NEW MEXICO 87501

Form C-103
Revised 10-1-78

3a. Indicate Type of Lease

State ☒ Fee ☐

5. State Oil & Gas Lease No.

B-11540

7. Unit Agreement No.

8. Farm or Lease Name

Vandeventer

9. Well No.

Three (3)

10. Field and Pool, or Locality

Artesia - C-5

12. County

Eddy

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT - II" (FORM C-101) FOR SUCH PROPOSALS.)

1. OIL WELL ☒ GAS WELL ☐ OTHER ☐

2. Name of Operator

W. E. Jeffers

3. Address of Operator

P. O. Box 65, Artesia, New Mexico 88211-0065

4. Location of Well

UNIT LETTER K 1650' FEET FROM THE South LINE AND 1650' FEET FROM

THE West LINE, SECTION 15 TOWNSHIP 18S RANGE 28E NMPM.

15. Elevation (Show whether DF, RT, GR, etc.)

3606

16. Check Appropriate Box To Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

SUBSEQUENT REPORT OF:

PERFORM REMEDIAL WORK ☐

PLUG AND ABANDON ☐

REMEDIAL WORK ☐

ALTERING CASING ☐

TEMPORARILY ABANDON ☐

COMMENCE DRILLING OPNS. ☐

PLUG AND ABANDONMENT ☒

PULL OR ALTER CASING ☐

CHANGE PLANS ☐

CASING TEST AND CEMENT JOBS ☐

OTHER ☐

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

June 10, 1987

Ran 2" tubing to 2498', displace 30 bbls heavy fw gel. Pick up and set 40 sax plug at 2400'. Tagged cement at 2250'.

Displace 35 sax cement 1790' to 1690'.

Displace 35 sax at 1325' to 1225'.

Displace 35 sax at 835' to 735'.

Cement tagged at 1220'.

Perforate 4 holes at 420' in 8 5/8" casing. Run tubing to 1218' and displace 20 bbls heavy mud and 3 sax paper. Pick tubing up to 835' and displace 35 sax cement. Shut down. Cement tagged at 1220' again. Ran Halliburton Flo-Chek. Top at 835'. Displace 35 sax cement. Tagged cement at 675'.

Ran tubing to 425' and displace 35 sax cement. Tagged at 350'.

Pulled tubing out. Tied on to 8 5/8" casing, pumped 50 bbls. heavy fw gel and paper. Hole in casing at 135'.

Circulated at 45 bbls. Pump 75 sax cement, circulated 10 sax. Set Marker. Cleaned up location.

Post ID-2
7-10-87
P & A

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED

W. E. Jeffers

TITLE

Owner

DATE

6/27/87

APPROVED BY

Mike Stillefield

TITLE

OIL AND GAS INSPECTOR

DATE

JAN 12 1988

CONDITIONS OF APPROVAL, IF ANY: