

Operator Redmay B. Wobbe
 Well Watch State #2
 Unit C Section 10 Township 18 Range 28
 API # 30-015-01285

TOPS

Saled	435
Base Salt	525
Gates	~ 680
Timbers	~ 1000
Bowers	~ 1400
Queen	~ 1650
Grayburg	~ 2000
San Andres	~ 2350

← Surface Plug

236' Est TOC

10" @ 235'
50 SXS

← Shoe Plug 345' Tag

← 435' Tag

526' Est TOC

8" @ 655'
50 SXS

← Shoe Plug 655' Tag

← Open hole Plug 2350' Tag

OH
2444'

- * Contact OCD 24 hrs. prior to any work done.
- * Salt gel mud consisting of 10# brine with 25# of gel per barrel must be placed between each plug.
- * Install dry hole marker as per Rule 202.B.2
- * Plugs are to be set from point indicated up.
- * Plugs must not be less than 100' or 25 Sacks of cement, whichever is greater, unless specifically indicated.
- * Shoe and stub plugs will be 50' above and below shoe or stub and tagged.
- * Surface plug will be from 0' - 60'
- * Where plugs are required, cement must be placed inside and outside of all casing string(s) in the correct footage or sacks required, if no cement exists.
- * Plugs to be tagged will be indicated.

[Handwritten signature]