

NO. OF COPIES RECEIVED	5
DISTRIBUTION	
SANTA FE	
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

NEW MEXICO OIL CONSERVATION COMMISSION

Form C-103
Supersedes Old
C-102 and C-103
Effective 1-1-65

5a. Indicate Type of Lease
State <input checked="" type="checkbox"/> Fee <input type="checkbox"/>
5. State Oil & Gas Lease No.
--

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR.
USE "APPLICATION FOR PERMIT --" (FORM C-101) FOR SUCH PROPOSALS.)

1. OIL WELL <input type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER- Water Injection	7. Unit Agreement Name
2. Name of Operator American Petrofina Company of Texas	8. Farm or Lease Name Lackawanna State
3. Address of Operator Box 1311, Big Spring, Texas 79720	9. Well No. 4
4. Location of Well UNIT LETTER G , 1607 FEET FROM THE North LINE AND 2295 FEET FROM THE East LINE, SECTION 21 TOWNSHIP 18S RANGE 28E NMPM.	10. Field and Pool, or Wildcat Artesia
15. Elevation (Show whether DF, RT, GR, etc.) 3570 Gr.	12. County Eddy

Check Appropriate Box To Indicate Nature of Notice, Report or Other Data
NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	OTHER <input type="checkbox"/>

SUBSEQUENT REPORT OF:

REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
COMMENCE DRILLING OPNS. <input type="checkbox"/>	PLUG AND ABANDONMENT <input checked="" type="checkbox"/>
CASING TEST AND CEMENT JOB <input type="checkbox"/>	OTHER <input type="checkbox"/>

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

Ran 2" EUE tubing to 2140' and circulated hole with 10# mud. Pulled tubing to 2090' and spotted 25 sack cement plug.

8-22-68 Shot off 4 1/2" casing at 873', pulled one joint and spotted 25 sack cement plug at 4 1/2" casing stub.

Pulled 4 1/2" casing to 500' and set 25 sack cement plug (bottom of 7" O D casing) Pulled 4 1/2" casing out.

Shot off 7" O D casing at 322'. Picked up one joint and spotted 25 sack cement plug at 290'. Pulled 7" casing.

Set 5 sack cement plug at surface and set pipe marker.

RECEIVED

OCT 11 1968

O. C. C.
ARTESIA, OFFICE

JCC/js

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED J. M. Denson

TITLE Asst. Dist. Mgr. of Production DATE October 9, 1968

APPROVED BY P. L. Llamas

TITLE OIL AND GAS INSPECTOR

DATE 10-11-68

CONDITIONS OF APPROVAL, IF ANY: