

page 2

12. Describe Proposed or Completed Operations (cont.)

9. WOC 2 hrs, 15 mins. TOH w/perf gun & tagged up on plug @ 670'. Pulled to 268' & shot 4 squeeze holes. TOH w/gun.
10. TIH w/tbg & pkr to 62' & pumped 40 sx plug through perfs and out braidenhead. Circ 5 sx to pit. WOC 2 hrs.
11. TIH w/perf gun & tagged up on plug @ 157' down. TOH w/gun.
12. TIH w/2 jts (62') & spotted surface plug. Had cement to surface.
13. Cleaned location. RDPU.
14. Installed dry hole marker. Plugged & Abandoned.

*NOTE: Plugging was witnessed by Mike Stubblefield