

NO. OF COPIES RECEIVED	3
DISTRIBUTION	
SANTA FE	1
FILE	1-
U.S.G.S.	
LAND OFFICE	
OPERATOR	1

**RECEIVED**  
NEW MEXICO OIL CONSERVATION COMMISSION

MAR 22 1968

ARTESIA, NEW MEX.

Form C-103  
Supersedes Old  
C-102 and C-103  
Effective 1-1-65

5a. Indicate Type of Lease State <input checked="" type="checkbox"/> Fee <input type="checkbox"/>
5. State Oil & Gas Lease No. <b>647</b>
7. Unit Agreement Name
8. Farm or Lease Name <b>Regler Yates State</b>
9. Well No. <b>4</b>
10. Field and Pool, or Wildcat <b>Artesia</b>
12. County <b>Eddy</b>

**SUNDRY NOTICES AND REPORTS ON WELLS**  
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR.  
USE "APPLICATION FOR PERMIT -" (FORM C-101) FOR SUCH PROPOSALS.)

1. OIL WELL <input type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER- <b>Shut in Injection Well</b>
2. Name of Operator <b>American Petrofina Company of Texas</b>
3. Address of Operator <b>Box 1311, Big Spring, Texas 79720</b>
4. Location of Well UNIT LETTER <b>C</b> , <b>550</b> FEET FROM THE <b>North</b> LINE AND <b>1600</b> FEET FROM THE <b>West</b> LINE, SECTION <b>32</b> TOWNSHIP <b>18S</b> RANGE <b>28E</b> N.M.P.M.
15. Elevation (Show whether DF, RT, GR, etc.)

16. Check Appropriate Box To Indicate Nature of Notice, Report or Other Data	
NOTICE OF INTENTION TO:	SUBSEQUENT REPORT OF:
PERFORM REMEDIAL WORK <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	CASING TEST AND CEMENT JOB <input type="checkbox"/>
OTHER <input type="checkbox"/>	OTHER <input type="checkbox"/>
PLUG AND ABANDON <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
CHANGE PLANS <input type="checkbox"/>	PLUG AND ABANDONMENT <input checked="" type="checkbox"/>

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

1. Set cast iron bridge plug at 1820'. Dumped 2 sacks cement on top plug.
2. Ran tubing, mixed 10# mud and filled hole with mud.
3. Shot 4 1/2" casing off at 1297'.
4. Spotted 25 sack cement plug at 1237'.
5. Spotted 25 sack cement plug at 800' (Bottom of 8 5/8" casing).
6. Pulled 1297' 4 1/2" casing.
7. Pulled 144' of 8 5/8" casing.
8. Filled hole with 10# mud.
9. Put 10 sack cement plug in top of hole and set 4 1/2" pipe marker.

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED Cliff Chapman TITLE Petroleum Engineer DATE March 20, 1968

APPROVED BY [Signature] TITLE [Signature] DATE APR 5 1968

CONDITIONS OF APPROVAL, IF ANY: