

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

NEW MEXICO OIL CONSERVATION COMMISSION

Form C-103
Supersedes Old
C-102 and C-103
Effective 1-1-65

5a. Indicate Type of Lease State <input checked="" type="checkbox"/> Fee <input type="checkbox"/>
5. State Oil & Gas Lease No. ---
7. Unit Agreement Name --
8. Farm or Lease Name Humble State
9. Well No. 2
10. Field and Pool, or Wildcat Artesia
12. County Eddy

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR.
USE "APPLICATION FOR PERMIT --" (FORM C-101) FOR SUCH PROPOSALS.)

1. OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER <input type="checkbox"/>
2. Name of Operator AMERICAN PETROFINA COMPANY OF TEXAS
3. Address of Operator Box 1311, Big Spring, Texas 79720
4. Location of Well UNIT LETTER <u>C</u> , <u>330</u> FEET FROM THE <u>North</u> LINE AND <u>1625</u> FEET FROM THE <u>West</u> LINE, SECTION <u>4</u> TOWNSHIP <u>18S</u> RANGE <u>28E</u> NMPM.
15. Elevation (Show whether DF, RT, GR, etc.) 3661 Gr.

16. Check Appropriate Box To Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:	SUBSEQUENT REPORT OF:
PERFORM REMEDIAL WORK <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	CASING TEST AND CEMENT JOB <input type="checkbox"/>
OTHER <input type="checkbox"/>	OTHER <input type="checkbox"/>
PLUG AND ABANDON <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
CHANGE PLANS <input type="checkbox"/>	PLUG AND ABANDONMENT <input checked="" type="checkbox"/>

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

6-6-69 Ran 2" EUE tubing to 2140'.
Mixed mud and spotted 50 sx cement on bottom.
Tagged cement at 1840'.
Shot off 5-1/2" casing at 1317' and then spotted 25 sx cement plug at 1317'.
Pulled 5-1/2" casing up to 516' (Base of 8-5/8" casing) and spotted 25 sx plug.
Finished pulling 5-1/2" casing.
Took hold of 8-5/8" casing and pulled off 50' from surface.
Set 10 sx cement plug at surface and placed 4-1/2" pipe marker.

RECEIVED

AUG 19 1969

O. C. C.
ARTESIA, OFFICE

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED <u>J. M. Denson</u>	TITLE <u>Asst. Dist. Mgr. of Production</u>	DATE <u>August 18, 1969</u>
APPROVED BY <u>[Signature]</u>	TITLE <u>[Signature]</u>	DATE <u>August 18, 1969</u>
CONDITIONS OF APPROVAL, IF ANY:		