

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEYSUBMIT IN THE DATE
(Other instructions on reverse side)Form approved.
Budget Bureau No. 42-R1424.
5. LEASE DESIGNATION AND SERIAL NO.

LC 060905a

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals.)

1. OIL WELL <input type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER <input type="checkbox"/>	WIW - TA	NM OIL CONS. COMMISSION	7. UNIT AGREEMENT NAME	W.L.H. Grb #4 SD UT
2. NAME OF OPERATOR	NEW MONT OIL COMPANY	Artesia, NM 88210	8. FARM OR LEASE NAME	Tract 14
3. ADDRESS OF OPERATOR	P. O. BOX 1305	ARTESIA, NEW MEXICO 88210	9. WELL NO.	1
4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements. See also space 17 below.) At surface	990 FSL & 2310 FEL Sec. 1-18-29		10. FIELD AND POOL, OR WILDCAT	LOCO HILLS (Q.G. SA)
14. PERMIT NO.	15. ELEVATIONS (Show whether DF, T, GR, etc.)	O. C. D.	11. SEC. T. R. M., OR BLK. AND SURVEY OR AREA	Sec. 1-18-29
	3515'	ARTESIA, OFFICE	12. COUNTY OR PARISH	Eddy
			13. STATE	

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF
FRACTURE TREAT
SHOOT OR ACIDIZE
REPAIR WELL
(Other)☐
☐
☐
☐
☐PULL OR ALTER CASING
MULTIPLE COMPLETE
ABANDON*
CHANGE PLANS☐
☐
☐
☐
☐

SUBSEQUENT REPORT OF:

WATER SHUT-OFF
FRACTURE TREATMENT
SHOOTING OR ACIDIZING
(Other) P&A☐
☐
☐
☐
☐REPAIRING WELL
ALTERING CASING
ABANDONMENT*☐
☐
☐
☐
☐

(NOTE: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.) *


7/28/83.....Pulled up 1 jt. and spotted 100 sks cmt w/2% Calcium. WOC. Tagged plug at 2551'. Hole in csg between 1323' and 1449'. Reset pkr at 819'. Using hole in csg. as per Squeezed 100 sks cmt w/2% Calcium. SI 800 psi. WOC.

7/29/83.....Pressured up to 500 psi. Okay. Tagged plug at 1085'. Perforated @ 370' w/4 shots. Squeezed 50 sks cmt w/2% Calcium. SI - no pressure. WOC. Pressured to 500 psi. Held. Tagged plug at 233'. Set 15 sxs cmt - top hole plug. Installed P&A Marker.

Location cleaned, seeded and ready for inspection.

18. I hereby certify that the foregoing is true and correct.

SIGNED

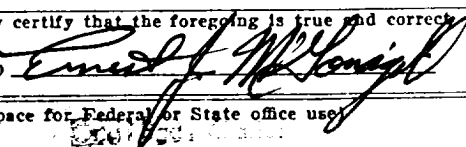

TITLE Area Manager

DATE 9/14/83

(This space for Federal or State office use)

APPROVED BY

CONDITIONS OF APPROVAL, IF ANY:

TITLE

DATE

5-5-86