REPAIR WELL

(Other)

(May 196)	DEP	ARTMENT		ATES HE INTERIOF SURVEY	SUBMIT IN (Other instr verse side)	LICAT uctions on	re-	Form ap Budget 15. LEASE DESIGNATE O63621-A	Gureau N	No. 42-R1424 SERIAL NO.
(Do not	use this form for	proposals to d	frill or to	REPORTS ON deepen or plug back		eservoir.		6. IF INDIAN, ALIA		TRIBE NAME
OIL WELL		HER DRY	HOLE	R	ECE	VEC)	7. UNIT AGREEMEN	T NAME	
FRANKL 3. ADDRESS OF	IN, ASTON 8	FAIR, 4	ro.		APR - 6	1976	_	8. FARM OR LEASE MASTELLER	B	
o. ADDRESS UE	OFERAIOR							9. WELL NO.		V

	P. U. BOX 1090, ROSW	ELL, NEW MEXICO 882	01 n C. C.	2-12	프로젝트	3 9 4 3	3
4.	LOCATION OF WELL (Report location See also space 17 below.) At surface		10. FIELD AND POOL, OR WILDCAT				
	1650' FNL - 1650' FE	L			T., B., M., OR B		
11-	PERMIT NO.	1.15		SEC.	17 - 18	S - 301	E [:]
11.	PERMIT NO.	15. ELEVATIONS (Show whether p	F, RT, GR, etc.)	12. COUN:	TY OR PARISH	13. STATE	,
		3467' DF		EDDY	COUNTY	NEW MI	EX ICO
16.							
	NOTICE OF INTE	NTION TO:	SUBSEC	QUENT REPORT	or:		74
	TEST WATER SHUT-OFF	PULL OR ALTER CASING	WATER SHUT-OFF		REPAIRING W	DLL	Ţ.
	FRACTURE TREAT	MULTIPLE COMPLETE	FRACTURE TREATMENT		ALTERING CA	SING	-
	SHOOT OR ACIDIZE	ABANDON*	SHOOTING OF ACIDIZING	_		- 77	;

(Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.) 17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

(Other)

On March 20, 1976, this well was plugged and abandoned as follows:

Two-inch (2") tubing was run to bottom 2907 feet and the hole circulated with heavy mud:

- 25 sack cement plug 2907 to 2807 feet across Loco Hills;
- 25 sack cement plug 1250 to 1150 feet at base of Salt;
- 35 sack cement plug 550 to 450 feet in and out base of 8 5/8 inch casing;
- 10 sack cement plug and marker at surface.

CHANGE PLANS

The cementing was done by Halliburton, and heavy mud is between all plugs.

RECEIVED

Capy to SF

10 Thursten could at a transfer of the		
18. I hereby certify that the foregoing is five and correspond to the sum of	TITLE Geologist	DATE April 2, 1976
(This space for Federal or State office use)		
APPROVED BY	TITLE	DATE DATE
	*See Instructions on Reverse Side	TP 9.7L