

NO. OF COPIES RECEIVED	3
DISTRIBUTION	
SANTA FE	1
FILE	1
U.S.G.S.	
LAND OFFICE	
OPERATOR	1

NEW MEXICO OIL CONSERVATION COMMISSION

RECEIVED

MAY 22 1973

Form C-103  
Supersedes Old  
C-102 and C-103  
Effective 1-1-65

5a. Indicate Type of Lease	
State <input checked="" type="checkbox"/>	Fee <input type="checkbox"/>
5. State Oil & Gas Lease No. <b>E-7873</b>	
7. Unit Agreement Name <b>South Hope Unit</b>	
8. Farm or Lease Name	
9. Well No. <b>1</b>	
10. Field and Pool, or Wildcat <b>South Hope Penn Gas</b>	
12. County <b>Eddy</b>	

SUNDRY NOTICES AND REPORTS ON WELLS  
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR.  
USE "APPLICATION FOR PERMIT -" (FORM C-101) FOR SUCH PROPOSALS.)

ARTESIA, OFFICE

1. OIL WELL ☐ GAS WELL ☒ OTHER-

2. Name of Operator  
**Sun Oil Company**

3. Address of Operator  
**P. O. Box 1861, Midland, Texas 79701**

4. Location of Well  
UNIT LETTER **K** **1980** FEET FROM THE **South** LINE AND **1845.69** FEET FROM  
THE **West** LINE, SECTION **30** TOWNSHIP **18-S** RANGE **23-E** NMPM.

15. Elevation (Show whether DF, RT, GR, etc.)  
**GR 4059**

16. Check Appropriate Box To Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:		SUBSEQUENT REPORT OF:	
PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>	PLUG AND ABANDONMENT <input checked="" type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	OTHER <input type="checkbox"/>	CASING TEST AND CEMENT JOBS <input type="checkbox"/>	OTHER <input type="checkbox"/>

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

- 4-24-73 MIRU - Kill well, install B.O.P. Pump lost circulation material W/mud to perforation.
- 4-25-73 Pick up out of Model "D" Packer - Sting back and mix 50 sacks class H W/15# slurry using celo flake and displace W/Mud - unsting and dump 10 sacks on top of packer. Pull tubing clear and wait on cement 4 hours, displace hole W/mud. Pull out of hole W/tubing, weld on 7" pull nipple.
- 4-26-73 Run Bond Log - Pipe stuck @ 2550 - Shot @ 2533 Pull 7" out of hole start back w/tubing.
- 4-27-73 Run tubing to 2587 and spotted 50 sack class H cement 14.8# Slurry, pull tubing to 1860 and spot 50 sack Class H Cement 14.8#. Pull tubing to 647 and spot 50 sack Class H Cement 15.00#. Pull all tubing, spot and plug W/1 joint 14.7# Slurry. All plug displaced W/mud.
- Spot 10 sx. cmt. 30' to surface & weld on Step1 Marker Plate & clean location - P&A.

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED <u>Charles Gray</u>	TITLE <u>Proration Clerk</u>	DATE <u>5-21-73</u>
APPROVED BY <u>Dennis M. Lewis</u>	TITLE <u>OIL AND GAS INSPECTOR</u>	DATE <u>JUN 4 1973</u>
CONDITIONS OF APPROVAL, IF ANY:		