

State "FX" No. 1  
Artesia Queen, Grayburg, San Andres  
Eddy County, New Mexico  
Plug and Abandonment Procedure

1. Rig up service unit.
2. Cut and pull 1000 feet of 5-1/2-inch casing (cement top at 1060').
3. Spot a 150-foot, 50 sack Class "H" cement plug in and out of the 5-1/2-inch casing stub.
4. Cut and pull 500 feet of 8-5/8-inch casing.
5. Spot a 150-foot, 60 sack Class "H" cement plug in and out of the 8-5/8-inch casing stub.
6. Spot a 10 sack plug to surface and weld on cap.
7. Erect plug and abandonment marker with location description as follows:

State "FX" No. 1  
Unit F, Section 6, T-18-S, R-28-E

8. Clean up location and restore ground to contour.

Note: 1. Leave mud laden fluid between plugs.

2. Check and make sure the 8-5/8-inch annulus is not open at the surface. If open, it will be necessary to spot a 20 sack cement plug to surface in the annulus also.