

30.015-10186-

H. 28.18.30

United

N. Benson Queen UT #2

9/16/99 Recommended Plugging
Procedure.

M.S.

5. Set 10 sk cement surface Plug.

4. Set 25 sk cement Plug 567'-467'. TAG

3. Perforate 4 1/2" casing 100' below Base Salt.

Squeeze cement 100' cement Plug outside & inside 4 1/2" csq. TAG

2. Circulate brine gel.

1. Run & set CIBP @ 2654' w/ 35' cement on Top.



= Perfs 2754'-3282'.

4 1/2" csq
@ 3350' w/ 350 sk