## DEPARTMENT OF THE INTERIOR (Other instruction on re-

Form approved. Budget Bureau No. 42-R1424. 5. LEASE DESIGNATION AND SERIAL NO.

GEOLOGICAL SU	IK.	V	ŁΥ
---------------	-----	---	----

SUNDR	A MOLICE?	ANU	KEPORIS	ON W	ELLS
Do not use this form	for proposals to			back to a	different reservoir.

Use "APPL	ICATION FOR PERMIT—" for such proposals.)	
OIL GAS WELL OTHER		7. UNIT AGREEMENT NAME
. NAME OF OPERATOR		8. FARM OR LEASE NAME
Martin Yates, III	V	LDY
ADDRESS OF OPERATOR		9. WELL NO.
323 Carper Buildi	ng - Artesia, New Mexico	1
. LOCATION OF WELL (Report location See also space 17 below.) At surface	n clearly and in accordance with any State requirements.*	10. FIELD AND POOL, OR WILDCAT Wildcat Fluase
990' FNL and 2310	" FWL Section 26-18S-25E	11. SEC., E., R., M., OR BEX. AND SUBVEY OR AREA  26-18S-25E NMPM
4. PERMIT NO.	15. ELEVATIONS (Show whether DF, NT, GR, etc.)  3485 GL	12. COUNTY OR PARISH 13. STATE Eddy N. Mex.

NOT	NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF:		REPORT OF:			
			r			
TEST WATER SHUT-OFF		PULL OR ALTER CASING		WATER SHUT-OFF	REPAIRING WELL	
FRACTURE TREAT		MULTIPLE COMPLETE		FRACTURE TREATMENT	ALTERING CASING	
SHOOT OR ACIDIZE		ABANDON*		shooting or acidizing Recementing	412 CSq.	
REPAIR WELL		CHANGE PLANS		(Other)		1
(Other)				(Note: Report results of me Completion or Recompletion	altiple completion on Well Report and Log form.)	.1

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)\*

4-24-67 - The 42" casing was cemented as follows:

Set bridge plug at 900'. Tested plug with 1500# pressure and tested OK.

Perforated 800' with 4-3/8" bullets. Pumped in 2000 gallons of guar gum followed with 50 sacks of cement. Spotted cement plug at 748' and ran temperature survey and found too of cement at 670'. Ran spaghetti string in the 8-5/8" to 418'. Used 100 sacks of cement and circulated to the surface. Drilled cement plug. Tested perforations by bailing hole dry. Perforations held OK. Drilled bridge plug and put well back on production - Job completed 4-28-67.

RECEIVED ONE OF THE PROPERTY O

•
DATE 5-1-67
MAY 3 1987