Subm. 3 Copies To Appropriate District	State of New N	Mexico poeu		Form C-10 DFFNCEd March 25, 19
Office En	ergy, Minerals and Na	itural Resources	LLL FIELD (JE Howited March 25, 19
1625 N French Dr. Hobbe NM 88240			WELDAY NO.	
District II	IL CONSERVATIO			15–10348
District II BI I South First, Artesia, NM 882103 - 12 3 4 5 1220 South St. Francis Dr. 1000 Rio Brazos Rd., Aztec. Mpl 87410 District IV Santa Fe, NM 87505			5. Indicate Type	of Lease
1000 Rio Brazos Rd. Aztec MM 87410	1220 South St. Fr	ancis Dr.	STATE	🗶 FEE 🗆
	Santa Fe, NM	87505	6. State Oil & (
1220 S. St. Francis Dr., Sada Fe, NM	0			7072-5
87505GOCTECS AN	D DEPORTS ON WELL	2		r Unit Agreement Name
(DO NOT USE THIS FOR PROPOSALS TO D DIFFERENT RESERVOIR SUSE "APPLICATION FO PROPOSALS.)	ORIAL OR TO DEEPEN OR F OR PERMIT" (FORM C-101)	LS PLUG BACK TO A FOR SUCH	7. Lease Name 0	The Agreement Name
1. Type of Well:	Alter Diver CAlter	سملا		Unit Tract 40
Oil Well Gas Well Ger (Other Plug & Aban			
2. Name of Operator			8. Well No.	2
Yates Petroleum Corporation	<u> </u>		9. Pool name or 1	
3. Address of Operator				
105 South Fourth Street - Art	cesia, NM 00210			ls-Q-GB-SA
4. Well Location				
Unit Letter M : 660	feet from the Sout	h line and	330 feet from	m the <u>West</u> line
Section 1	Township 185 F	Range 29E	NMPM Eddy	County
	evation (Show whether I			
	3513			
11. Check Appropriz	te Box to Indicate N	Jature of Notice	Report or Other	Data
			SEQUENT REI	
NOTICE OF INTENTIC				
PERFORM REMEDIAL WORK 🔲 PLUG A		. REMEDIAL WOR		ALTERING CASING [
TEMPORARILY ABANDON 🔲 CHANG		COMMENCE DRI	LLING OPNS. 🔲	
PULL OR ALTER CASING DIMULTIP		CASING TEST AN CEMENT JOB	10	
COMPL OTHER:		CEMENT JOB	_	C
COMPL OTHER: 12. Describe proposed or completed operation	ETION	CEMENT JOB OTHER: ertinent details, and g	ive pertinent dates,	including estimated date
COMPL OTHER: 12. Describe proposed or completed operation	ETION	CEMENT JOB OTHER: ertinent details, and g	ive pertinent dates,	including estimated date
COMPL OTHER: 12. Describe proposed or completed operation of starting any proposed work). SEE RU	ETION	CEMENT JOB OTHER: ertinent details, and g	ive pertinent dates,	including estimated date
COMPL OTHER: 12. Describe proposed or completed operation of starting any proposed work). SEE RU or recompilation.	ETION ons. (Clearly state all per LE 1103. For Multiple	CEMENT JOB OTHER: ertinent details, and g Completions: Attack	ive pertinent dates, n wellbore diagram	including estimated date of proposed completion
COMPL OTHER: 12. Describe proposed or completed operation of starting any proposed work). SEE RU or recompilation. 8-16-2002 - Moved in and rigg	ETION ons. (Clearly state all per LE 1103. For Multiple ged up pulling un	CEMENT JOB OTHER: ertinent details, and g Completions: Attack	ive pertinent dates, n wellbore diagram	including estimated date of proposed completion
COMPL OTHER: 12. Describe proposed or completed operation of starting any proposed work). SEE RU or recompilation. 8-16-2002 - Moved in and rigg Dug out cellar. Shut down for	ETION ons. (Clearly state all per ILE 1103. For Multiple ged up pulling un or night.	CEMENT JOB OTHER: ertinent details, and g Completions: Attack	ive pertinent dates, i wellbore diagram g equipment.	including estimated date of proposed completion Bled well down.
COMPL OTHER: 12. Describe proposed or completed operation of starting any proposed work). SEE RU or recompilation. 8-16-2002 - Moved in and rigg Dug out cellar. Shut down for 8-17-19-02 -Nippled down well	ETION ons. (Clearly state all per ILE 1103. For Multiple ged up pulling un or night. Lhead and nippled	CEMENT JOB OTHER: ertinent details, and g Completions: Attack tit and pluggin up BOP. Rigg	ive pertinent dates, n wellbore diagram g equipment. ed up floor ar	including estimated date of proposed completion Bled well down. nd 2-3/8" tubing
COMPL OTHER: 12. Describe proposed or completed operation of starting any proposed work). SEE RU or recompilation. 8-16-2002 - Moved in and rigg Dug out cellar. Shut down for 8-17-19-02 -Nippled down well equipment. Rigged up wireling	ETION ons. (Clearly state all per ILE 1103. For Multiple ged up pulling un or night. Thead and nippled ne. RIH with gau	CEMENT JOB OTHER: entiment details, and g Completions: Attack wit and pluggin up BOP. Rigg age ring to 265	ive pertinent dates, n wellbore diagram g equipment. ed up floor ar 0'. POOH with	including estimated date of proposed completion Bled well down. nd 2-3/8" tubing n gauge ring.
COMPL OTHER: 12. Describe proposed or completed operation of starting any proposed work). SEE RU or recompilation. 8-16-2002 - Moved in and rigg Dug out cellar. Shut down for 8-17-19-02 -Nippled down well equipment. Rigged up wireling RIH with CIBP and set CIBP at	ETION ons. (Clearly state all per LE 1103. For Multiple ged up pulling un or night. Thead and nippled ne. RIH with gau t 2628'. POOH wi	CEMENT JOB OTHER: entirent details, and g Completions: Attack att and pluggin up BOP. Rigg age ring to 265 th setting too	ive pertinent dates, n wellbore diagram g equipment. ed up floor an 0'. POOH with 1. RIH and du	including estimated date of proposed completion Bled well down. nd 2-3/8" tubing n gauge ring. imped 35' of cemen
COMPL OTHER: 12. Describe proposed or completed operation of starting any proposed work). SEE RU or recompilation. 8-16-2002 - Moved in and rigg Dug out cellar. Shut down for 8-17-19-02 -Nippled down well equipment. Rigged up wireling RIH with CIBP and set CIBP at on top of CIBP. POOH with ba	ETION ons. (Clearly state all per LE 1103. For Multiple ged up pulling un or night. Lhead and nippled ne. RIH with gau t 2628'. POOH wi ailer and rigged	CEMENT JOB OTHER: entiment details, and g Completions: Attack att and pluggin up BOP. Rigg age ring to 265 th setting too down wireline.	ive pertinent dates, n wellbore diagram g equipment. ed up floor ar 0'. POOH with 1. RIH and du Shut well in	including estimated date of proposed completion Bled well down. and 2-3/8" tubing a gauge ring. amped 35' of cemen a for night.
COMPL OTHER: 12. Describe proposed or completed operation of starting any proposed work). SEE RU or recompilation. 8-16-2002 - Moved in and rigg Dug out cellar. Shut down for 8-17-19-02 -Nippled down well equipment. Rigged up wireling RIH with CIBP and set CIBP at on top of CIBP. POOH with ba 8-20-2002 - Moved in 2-3/8"	ETION ons. (Clearly state all per LE 1103. For Multiple ged up pulling un or night. Thead and nippled ne. RIH with gau t 2628'. POOH wi ailer and rigged tubing work strin	CEMENT JOB OTHER: entiment details, and g Completions: Attack att and pluggin up BOP. Rigg age ring to 265 th setting too down wireline. ag. Picked up	ive pertinent dates, n wellbore diagram g equipment. ed up floor an 0'. POOH with 1. RIH and du Shut well in and RIH with t	including estimated date of proposed completion Bled well down. and 2-3/8" tubing a gauge ring. amped 35' of cemer a for night. cubing to 2575'.
COMPL OTHER: 12. Describe proposed or completed operation of starting any proposed work). SEE RU or recompilation. 8-16-2002 - Moved in and rigg Dug out cellar. Shut down for 8-17-19-02 -Nippled down well equipment. Rigged up wireling RIH with CIBP and set CIBP at on top of CIBP. POOH with ba 8-20-2002 - Moved in 2-3/8" for Circulated hole with plugging	ETION ons. (Clearly state all per ILE 1103. For Multiple ged up pulling un or night. Lhead and nippled ne. RIH with gau t 2628'. POOH wi ailer and rigged tubing work strin g mud. POOH with	CEMENT JOB OTHER: ertinent details, and g Completions: Attack att and pluggin up BOP. Rigg age ring to 265 th setting too down wireline. ag. Picked up tubing. Shut	ive pertinent dates, n wellbore diagram g equipment. ed up floor an 0'. POOH with 1. RIH and du Shut well in and RIH with t well in for r	including estimated date of proposed completion Bled well down. and 2-3/8" tubing a gauge ring. imped 35' of cemer a for night. cubing to 2575'. hight.
COMPL OTHER: 12. Describe proposed or completed operation of starting any proposed work). SEE RU or recompilation. 8-16-2002 - Moved in and rigg Dug out cellar. Shut down for 8-17-19-02 -Nippled down well equipment. Rigged up wireling RIH with CIBP and set CIBP and on top of CIBP. POOH with base 8-20-2002 - Moved in 2-3/8" to Circulated hole with plugging 8-21-2002 - Rigged up wireling	ETION ons. (Clearly state all performance of the state all performance of the state all performance of the state and nippled the state of the state	CEMENT JOB OTHER: entiment details, and g Completions: Attack att and pluggin up BOP. Rigg age ring to 265 th setting too down wireline. ag. Picked up tubing. Shut orated 7" casi	ive pertinent dates, n wellbore diagram g equipment. ed up floor an 0'. POOH with 1. RIH and du Shut well in and RIH with t well in for r ng at 1020'.	including estimated date of proposed completion Bled well down. and 2-3/8" tubing a gauge ring. amped 35' of cemen a for night. cubing to 2575'. anight. POOH and rigged
COMPL OTHER: 12. Describe proposed or completed operation of starting any proposed work). SEE RU or recompilation. 8-16-2002 - Moved in and rigg Dug out cellar. Shut down for 8-17-19-02 -Nippled down well equipment. Rigged up wireling RIH with CIBP and set CIBP at on top of CIBP. POOH with ba 8-20-2002 - Moved in 2-3/8" to Circulated hole with plugging 8-21-2002 - Rigged up wireling down wireline. RIH with pack	ETION ons. (Clearly state all performed by pulling under the state and nippled by the state and nippled by the state and nigged the sta	CEMENT JOB OTHER: entiment details, and g Completions: Attack att and pluggin up BOP. Rigg uge ring to 265 th setting too down wireline. ug. Picked up tubing. Shut orated 7" casi ablished rate	ive pertinent dates, n wellbore diagram g equipment. ed up floor an 0'. POOH with 1. RIH and du Shut well in and RIH with t well in for r ng at 1020'. of 1 BPM at 10	including estimated date of proposed completion Bled well down. and 2-3/8" tubing a gauge ring. amped 35' of cemen a for night. cubing to 2575'. anight. POOH and rigged
COMPL OTHER: 12. Describe proposed or completed operation of starting any proposed work). SEE RU or recompilation. 8-16-2002 - Moved in and rigg Dug out cellar. Shut down for 8-17-19-02 -Nippled down well equipment. Rigged up wireling RIH with CIBP and set CIBP at on top of CIBP. POOH with ba 8-20-2002 - Moved in 2-3/8" for Circulated hole with plugging 8-21-2002 - Rigged up wireling down wireline. RIH with pack with 75 sacks Class C Neat completed operation of the same set of the same set	ETION ons. (Clearly state all performance of the state all performance of the state all performance of the state and nippled the state of the state	CEMENT JOB OTHER: ertinent details, and g Completions: Attack att and pluggin up BOP. Rigg age ring to 265 th setting too down wireline. ag. Picked up tubing. Shut corated 7" casi ablished rate in with 600 p	ive pertinent dates, n wellbore diagram g equipment. ed up floor an 0'. POOH with 1. RIH and du Shut well in and RIH with t well in for r ng at 1020'. of 1 BPM at 10 si. WOC.	including estimated date of proposed completion Bled well down. and 2-3/8" tubing a gauge ring. Imped 35' of cemen a for night. Tubing to 2575'. anight. POOH and rigged DOO psi. Squeezed
COMPL OTHER: 12. Describe proposed or completed operation of starting any proposed work). SEE RU or recompilation. 8-16-2002 - Moved in and rigg Dug out cellar. Shut down for 8-17-19-02 -Nippled down well equipment. Rigged up wireling RIH with CIBP and set CIBP at on top of CIBP. POOH with ba 8-20-2002 - Moved in 2-3/8" Circulated hole with plugging 8-21-2002 - Rigged up wireling down wireline. RIH with pack with 75 sacks Class C Neat completed wireling 8-22-2002 - Rigged up wireling 10. 10. 10. 10. 10. 10. 10. 10. 10. 10.	ETION ons. (Clearly state all po- LE 1103. For Multiple ged up pulling un or night. Lhead and nippled ne. RIH with gau t 2628'. POOH wi ailer and rigged tubing work strin g mud. POOH with ne. RIH and perf ker to 735'. Est ement. Shut well ne. RIH with bar	CEMENT JOB OTHER: ertinent details, and g Completions: Attack it and pluggin up BOP. Rigg uge ring to 265 th setting too down wireline. g. Picked up tubing. Shut orated 7" casi ablished rate in with 600 p s and tagged p	ive pertinent dates, n wellbore diagram g equipment. ed up floor an 0'. POOH with 1. RIH and du Shut well in and RIH with t well in for r ng at 1020'. of 1 BPM at 10 si. WOC. lug at 905'.	including estimated date of proposed completion Bled well down. and 2-3/8" tubing a gauge ring. Imped 35' of cemen a for night. Tubing to 2575'. anight. POOH and rigged DOO psi. Squeezed POOH with wire-
COMPL OTHER: 12. Describe proposed or completed operation of starting any proposed work). SEE RU or recompilation. 8-16-2002 - Moved in and rigg Dug out cellar. Shut down for 8-17-19-02 -Nippled down well equipment. Rigged up wireling RIH with CIBP and set CIBP at on top of CIBP. POOH with ba 8-20-2002 - Moved in 2-3/8" Circulated hole with plugging 8-21-2002 - Rigged up wireling with 75 sacks Class C Neat complete 1 ine and rigged down wireling	ETION ons. (Clearly state all per- July of the state all per- July of the state all per- July of the state and per- July of the state and sta	CEMENT JOB OTHER: entirent details, and g Completions: Attack att and pluggin up BOP. Rigg age ring to 265 th setting too down wireline. ag. Picked up tubing. Shut orated 7" casi tablished rate in with 600 p s and tagged p ter. POOH with	ive pertinent dates, n wellbore diagram g equipment. ed up floor an 0'. POOH with 1. RIH and du Shut well in and RIH with t well in for r ng at 1020'. of 1 BPM at 10 si. WOC. lug at 905'. packer. Rigg	including estimated date of proposed completion Bled well down. and 2-3/8" tubing a gauge ring. Imped 35' of cemen a for night. Tubing to 2575'. anight. POOH and rigged DOO psi. Squeezed POOH with wire- ged up wireline.
COMPL OTHER: 12. Describe proposed or completed operation of starting any proposed work). SEE RU or recompilation. 8-16-2002 - Moved in and rigg Dug out cellar. Shut down for 8-17-19-02 -Nippled down well equipment. Rigged up wireling RIH with CIBP and set CIBP at on top of CIBP. POOH with ba 8-20-2002 - Moved in 2-3/8" Circulated hole with plugging 8-21-2002 - Rigged up wireling down wireline. RIH with pack with 75 sacks Class C Neat complete 1 ine and rigged down wireling RIH and perforated 7" casing	ETION ons. (Clearly state all per LE 1103. For Multiple ged up pulling un or night. Thead and nippled ne. RIH with gau t 2628'. POOH with ailer and rigged tubing work string mud. POOH with ne. RIH and perf ker to 735'. Est ement. Shut well ne. RIH with bar e. Released pack at 527'. POOH a	CEMENT JOB OTHER: entirent details, and g Completions: Attack att and pluggin up BOP. Rigg age ring to 265 th setting too down wireline. ag. Picked up tubing. Shut orated 7" casi ablished rate in with 600 p s and tagged p ter. POOH with and rigged down	ive pertinent dates, n wellbore diagram g equipment. ed up floor an O'. POOH with 1. RIH and du Shut well in and RIH with t well in for r ng at 1020'. of 1 BPM at 10 si. WOC. lug at 905'. packer. Rigg wireline. RI	including estimated date of proposed completion Bled well down. ad 2-3/8" tubing a gauge ring. amped 35' of cemen a for night. tubing to 2575'. aight. POOH and rigged DOO psi. Squeezed POOH with wire- ged up wireline.
COMPL OTHER: 12. Describe proposed or completed operation of starting any proposed work). SEE RU or recompilation. 8-16-2002 - Moved in and rigg Dug out cellar. Shut down for 8-17-19-02 -Nippled down well equipment. Rigged up wireling RIH with CIBP and set CIBP at on top of CIBP. POOH with ba 8-20-2002 - Moved in 2-3/8" for Circulated hole with plugging 8-21-2002 - Rigged up wireling down wireline. RIH with pack with 75 sacks Class C Neat co 11 and rigged down wireling RIH and perforated 7" casing tubing to 215'. Squeezed with	ETION ons. (Clearly state all performance) LE 1103. For Multiple ged up pulling under or night. Thead and nippled he. RIH with gaud tubing work string ailer and rigged tubing work string mud. POOH with he. RIH and performation ker to 735'. Est ement. Shut well he. RIH with bar e. Released pack at 527'. POOH at th 135 sacks Class	CEMENT JOB OTHER: entiment details, and g Completions: Attack att and pluggin up BOP. Rigg age ring to 265 th setting too down wireline. ag. Picked up tubing. Shut orated 7" casi tablished rate in with 600 p s and tagged p ter. POOH with and rigged down as C Neat cemen	ive pertinent dates, n wellbore diagram g equipment. ed up floor an O'. POOH with 1. RIH and du Shut well in and RIH with t well in for n ng at 1020'. of 1 BPM at 10 si. WOC. lug at 905'. packer. Rigg wireline. RI t. WOC 4 hour	including estimated date of proposed completion Bled well down. ad 2-3/8" tubing a gauge ring. amped 35' of cemen a for night. tubing to 2575'. aight. POOH and rigged DOO psi. Squeezed POOH with wire- ged up wireline.
COMPL OTHER: 12. Describe proposed or completed operation of starting any proposed work). SEE RU or recompilation. 8-16-2002 - Moved in and rigg Dug out cellar. Shut down for 8-17-19-02 -Nippled down well equipment. Rigged up wireling RIH with CIBP and set CIBP at on top of CIBP. POOH with ba 8-20-2002 - Moved in 2-3/8" Circulated hole with plugging 8-21-2002 - Rigged up wireling down wireline. RIH with pack with 75 sacks Class C Neat complete 1 ine and rigged down wireling RIH and perforated 7" casing	ETION ons. (Clearly state all performance) LE 1103. For Multiple ged up pulling under or night. Thead and nippled he. RIH with gaud tubing work string ailer and rigged tubing work string mud. POOH with he. RIH and performation ker to 735'. Est ement. Shut well he. RIH with bar e. Released pack at 527'. POOH at th 135 sacks Class	CEMENT JOB OTHER: entiment details, and g Completions: Attack att and pluggin up BOP. Rigg age ring to 265 th setting too down wireline. ag. Picked up tubing. Shut orated 7" casi tablished rate in with 600 p s and tagged p ter. POOH with and rigged down as C Neat cemen	ive pertinent dates, n wellbore diagram g equipment. ed up floor an O'. POOH with 1. RIH and du Shut well in and RIH with t well in for r ng at 1020'. of 1 BPM at 10 si. WOC. lug at 905'. packer. Rigg wireline. RI t. WOC 4 hour ge and belief.	including estimated date of proposed completion Bled well down. and 2-3/8" tubing a gauge ring. amped 35' of cemen a for night. cubing to 2575'. aight. POOH and rigged DOO psi. Squeezed POOH with wire- ged up wireline. H with packer and cs. Rigged up
COMPL OTHER: 12. Describe proposed or completed operation of starting any proposed work). SEE RU or recompilation. 8-16-2002 - Moved in and rigg Dug out cellar. Shut down for 8-17-19-02 -Nippled down well equipment. Rigged up wireling RIH with CIBP and set CIBP at on top of CIBP. POOH with ba 8-20-2002 - Moved in 2-3/8" for Circulated hole with plugging 8-21-2002 - Rigged up wireling down wireline. RIH with pack with 75 sacks Class C Neat com 8-22-2002 - Rigged up wireling line and rigged down wireling RIH and perforated 7" casing tubing to 215'. Squeezed with thereby certify that the information above is to	ETION ons. (Clearly state all per- LE 1103. For Multiple ged up pulling un- or night. Thead and nippled thead and nippled	CEMENT JOB OTHER: entiment details, and g Completions: Attack attack attack and pluggin attack and pluggin a	ive pertinent dates, n wellbore diagram g equipment. ed up floor an O'. POOH with 1. RIH and du Shut well in and RIH with t well in for r ng at 1020'. of 1 BPM at 10 si. WOC. lug at 905'. packer. Rigg wireline. RI t. WOC 4 hour continued on	including estimated date of proposed completion Bled well down. and 2-3/8" tubing a gauge ring. amped 35' of cemen a for night. Tubing to 2575'. anight. POOH and rigged DOO psi. Squeezed POOH with wire- ged up wireline. IH with packer and ts. Rigged up NEXT PAGE:
COMPL OTHER: 12. Describe proposed or completed operation of starting any proposed work). SEE RU or recompilation. 8-16-2002 - Moved in and rigg Dug out cellar. Shut down for 8-17-19-02 -Nippled down well equipment. Rigged up wireling RIH with CIBP and set CIBP at on top of CIBP. POOH with back 8-20-2002 - Moved in 2-3/8" to Circulated hole with plugging 8-21-2002 - Rigged up wireling down wireline. RIH with pack with 75 sacks Class C Neat completed 1 ine and rigged down wireling RIH and perforated 7" casing tubing to 215'. Squeezed with 1 hereby certify that the information above is to	ETION ons. (Clearly state all per- LE 1103. For Multiple ged up pulling un- or night. Thead and nippled thead and nippled	CEMENT JOB OTHER: entiment details, and g Completions: Attack att and pluggin up BOP. Rigg age ring to 265 th setting too down wireline. ag. Picked up tubing. Shut orated 7" casi tablished rate in with 600 p s and tagged p ter. POOH with and rigged down as C Neat cemen	ive pertinent dates, n wellbore diagram g equipment. ed up floor an O'. POOH with 1. RIH and du Shut well in and RIH with t well in for r ng at 1020'. of 1 BPM at 10 si. WOC. lug at 905'. packer. Rigg wireline. RI t. WOC 4 hour continued on	including estimated date of proposed completion Bled well down. and 2-3/8" tubing a gauge ring. amped 35' of cemen a for night. cubing to 2575'. aight. POOH and rigged DOO psi. Squeezed POOH with wire- ged up wireline. H with packer and cs. Rigged up
COMPL OTHER: 12. Describe proposed or completed operation of starting any proposed work). SEE RU or recompilation. 8-16-2002 - Moved in and rigg Dug out cellar. Shut down for 8-17-19-02 -Nippled down well equipment. Rigged up wireling RIH with CIBP and set CIBP at on top of CIBP. POOH with ba 8-20-2002 - Moved in 2-3/8" for Circulated hole with plugging 8-21-2002 - Rigged up wireling down wireline. RIH with pack with 75 sacks Class C Neat completed 1 ine and rigged down wireling RIH and perforated 7" casing tubing to 215'. Squeezed with Information above is the SIGNATURE A Completed operation Describe proposed or completed operation and rigged down wireling RIH and perforated 7" casing tubing to 215'. Squeezed with Describe proposed operation Describe proposed op	ETION ons. (Clearly state all per- LE 1103. For Multiple ged up pulling un- or night. Thead and nippled he. RIH with gau t 2628'. POOH wi ailer and rigged tubing work string mud. POOH with he. RIH and perf ker to 735'. Est ement. Shut well he. RIH with bar e. Released pack at 527'. POOH a th 135 sacks Class rue and complete to the	CEMENT JOB OTHER: entiment details, and g Completions: Attack attack attack and pluggin attack and pluggin a	ive pertinent dates, n wellbore diagram g equipment. ed up floor an O'. POOH with 1. RIH and du Shut well in and RIH with t well in for r ng at 1020'. of 1 BPM at 10 si. WOC. lug at 905'. packer. Rigg wireline. RI t. WOC 4 hour ge and belief. CONTINUED ON NICIAN	including estimated date of proposed completion Bled well down. and 2-3/8" tubing a gauge ring. Imped 35' of cemen a for night. Tubing to 2575'. aight. POOH and rigged DOO psi. Squeezed POOH with wire- ged up wireline. IH with packer and ts. Rigged up NEXT PAGE: DATE 8-28-02
COMPL OTHER: 12. Describe proposed or completed operation of starting any proposed work). SEE RU or recompilation. 8-16-2002 - Moved in and rigg Dug out cellar. Shut down for 8-17-19-02 -Nippled down well equipment. Rigged up wireling RIH with CIBP and set CIBP at on top of CIBP. POOH with bas 8-20-2002 - Moved in 2-3/8" for Circulated hole with plugging 8-21-2002 - Rigged up wireling down wireline. RIH with pack with 75 sacks Class C Neat completed down wireling RIH and perforated 7" casing tubing to 215'. Squeezed with hereby certify that the information above is the SIGNATURE DONNA J CLACK	ETION ons. (Clearly state all per- LE 1103. For Multiple ged up pulling un- or night. Thead and nippled he. RIH with gau t 2628'. POOH wi ailer and rigged tubing work string mud. POOH with he. RIH and perf ker to 735'. Est ement. Shut well he. RIH with bar e. Released pack at 527'. POOH a th 135 sacks Class rue and complete to the	CEMENT JOB OTHER: entiment details, and g Completions: Attack attack attack and pluggin attack and pluggin a	ive pertinent dates, n wellbore diagram g equipment. ed up floor an O'. POOH with 1. RIH and du Shut well in and RIH with t well in for r ng at 1020'. of 1 BPM at 10 si. WOC. lug at 905'. packer. Rigg wireline. RI t. WOC 4 hour ge and belief. CONTINUED ON NICIAN	including estimated date of proposed completion Bled well down. and 2-3/8" tubing a gauge ring. amped 35' of cemen a for night. Tubing to 2575'. anight. POOH and rigged DOO psi. Squeezed POOH with wire- ged up wireline. IH with packer and ts. Rigged up NEXT PAGE:
COMPL OTHER: 12. Describe proposed or completed operation of starting any proposed work). SEE RU or recompilation. 8-16-2002 - Moved in and rigg Dug out cellar. Shut down for 8-17-19-02 -Nippled down well equipment. Rigged up wireling RIH with CIBP and set CIBP at on top of CIBP. POOH with ba 8-20-2002 - Moved in 2-3/8" for Circulated hole with plugging 8-21-2002 - Rigged up wireling down wireline. RIH with pack with 75 sacks Class C Neat completed 1 ine and rigged down wireling RIH and perforated 7" casing tubing to 215'. Squeezed with Information above is the SIGNATURE A Completed operation Describe proposed or completed operation and rigged down wireling RIH and perforated 7" casing tubing to 215'. Squeezed with Describe proposed operation Describe proposed op	ETION ons. (Clearly state all per- LE 1103. For Multiple ged up pulling un- or night. Thead and nippled he. RIH with gau t 2628'. POOH wi ailer and rigged tubing work string mud. POOH with he. RIH and perf ker to 735'. Est ement. Shut well he. RIH with bar e. Released pack at 527'. POOH a th 135 sacks Class rue and complete to the	CEMENT JOB OTHER: entiment details, and g Completions: Attack att and pluggin up BOP. Rigg age ring to 265 th setting too down wireline. g. Picked up tubing. Shut corated 7" casi ablished rate in with 600 p es and tagged p ter. POOH with and rigged down as C Neat cemen best of my knowledge	ive pertinent dates, n wellbore diagram of g equipment. ed up floor an O'. POOH with 1. RIH and du Shut well in and RIH with t well in for r ng at 1020'. of 1 BPM at 10 si. WOC. lug at 905'. packer. Rigg wireline. RI t. WOC 4 hour continued on NICIAN	including estimated date of proposed completion Bled well down. and 2-3/8" tubing a gauge ring. amped 35' of cemen a for night. cubing to 2575'. aight. POOH and rigged DOO psi. Squeezed POOH with wire- ged up wireline. H with packer and cs. Rigged up NEXT PAGE: DATE 8-28-02 aone No505-748-147
COMPL OTHER: 12. Describe proposed or completed operation of starting any proposed work). SEE RU or recompilation. 8-16-2002 - Moved in and rigg Dug out cellar. Shut down for 8-17-19-02 -Nippled down well equipment. Rigged up wireling RIH with CIBP and set CIBP at on top of CIBP. POOH with bas 8-20-2002 - Moved in 2-3/8" for Circulated hole with plugging 8-21-2002 - Rigged up wireling down wireline. RIH with pack with 75 sacks Class C Neat completed down wireling RIH and perforated 7" casing tubing to 215'. Squeezed with hereby certify that the information above is the SIGNATURE DONNA J CLACK	ETION ons. (Clearly state all per- LE 1103. For Multiple ged up pulling un- or night. Thead and nippled he. RIH with gau t 2628'. POOH wi ailer and rigged tubing work string mud. POOH with he. RIH and perf ker to 735'. Est ement. Shut well he. RIH with bar e. Released pack at 527'. POOH a th 135 sacks Class rue and complete to the	CEMENT JOB OTHER: entiment details, and g Completions: Attack attack attack and pluggin attack and pluggin a	ive pertinent dates, n wellbore diagram of g equipment. ed up floor an O'. POOH with 1. RIH and du Shut well in and RIH with t well in for r ng at 1020'. of 1 BPM at 10 si. WOC. lug at 905'. packer. Rigg wireline. RI t. WOC 4 hour ge and belief. CONTINUED ON NICIAN Teleph	including estimated date of proposed completion Bled well down. and 2-3/8" tubing a gauge ring. Imped 35' of cemen a for night. Tubing to 2575'. aight. POOH and rigged DOO psi. Squeezed POOH with wire- ged up wireline. IH with packer and ts. Rigged up NEXT PAGE: DATE 8-28-02