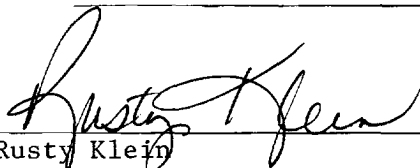


Could not make hole. POOH with overshot. RIH with smaller overshot and worked overshot. Tried to get over fish. POOH with overshot. Called Gerry Guy w/OCD-Artesia and got approval to spot plug. Rigged down reverse unit. RIH with tubing open ended to 1475'. Spotted 50 sack Class C Neat cement. POOH with tubing. Shut well in for night.

5-10-2002 - RIH with tubing and tagged plug at 940'. Circulated hole with plugging mud. POOH with tubing. Rigged up wireline. Perforated 5-1/2" casing at 100'. POOH with wireline and rigged down wireline. Rigged down tubing equipment. Nippled down BOP and 5-1/2" casing head. Installed 5-1/2" X 2" swedge with valve. Circulated 75 sacks Class C Neat cement down 5-1/2" casing and up to surface of 8-5/8" casing. Rigged down pulling unit and plugging equipment. Dug out cellar. Cut off wellhead. Installed regulation abandonment marker. PLUGGED AND ABANDONED - FINAL REPORT. Plugging completed 5-9-2002.


Rusty Klein
Agent for BCM & Associates
May 13, 2002