

TOPS

C1RC

→ Surface Plug

8 1/8" @ 517'
175

— Sub Plug 467-567 Tag

Est TOC 1292'

← 100 Pms 1903' Tag

Perf 1983'

S 1/2 " @ 2054'
2005X5.

- * Contact OCD 24 hrs. prior to any work done.
- * Salt gel mud consisting of 10# brine with 25# of gel per barrel must be placed between each plug.
- * Install dry hole marker as per Rule 202.B.2
- * Plugs are to be set from point indicated up.
- * Plugs must not be less than 100' or 25 Sacks of cement, whichever is greater, unless specifically indicated.
- * Shoe and stub plugs will be 50' above and below shoe or stub and tagged.
- * Surface plug will be from 0' - 60'
- * Where plugs are required, cement must be placed inside and outside of **all** casing string(s) in the correct footage or sacks required, if **no cement exists**.
- * Plugs to be tagged will be indicated.

10.