

EMPIRE SOUTH DEEP UNIT NO. 2

1 of 1
From: 1/28/97 07:00:00 **To:** 1/28/97 18:00:00 11.00 **Hrs** PLANNED on DURING
Functional Responsibility: OTHER **Job Sequence No:** 3 CLEAN OUT/PLUGBACK

Operations Description: Tripping
 TOH X CHANGE BITS X TIH X DO 10,825 TO 10,860 X TOH X 40 STDS X SION.

1 of 1
From: 1/29/97 07:00:00 **To:** 1/29/97 18:00:00 11.00 **Hrs** PLANNED on DURING
Functional Responsibility: OTHER **Job Sequence No:** 3 CLEAN OUT/PLUGBACK

Operations Description: Drill Cement
 DO CIBP X 10,860 X NO PRS UNDER BP X CHASE TO 10,930 (TOP OF VAN GUNS 10,956). PERFS:10,874-80
 X 10,888-90 X 4 SPF.TOH X 80 STDS X SION.

1 of 1
From: 1/30/97 07:00:00 **To:** 1/30/97 18:00:00 11.00 **Hrs** PLANNED on DURING
Functional Responsibility: OTHER **Job Sequence No:**

Operations Description: Tripping
 FIN TOH X BIT X LD DRL COLLARS. TIH X PKR X TBG X HYDRO TST TBG 8000 PSI ABOVE SLIPS.
 RBXIT X PSA 10,776 X TLA 10,813 X CSG LOADED X PKR FLUID.

1 of 1
From: 1/31/97 07:00:00 **To:** 1/31/97 18:00:00 11.00 **Hrs** PLANNED on DURING
Functional Responsibility: OTHER **Job Sequence No:** 5 TESTING/SWABBING

Operations Description: Swabbing
 RD DOUBLE DERRICK X RU SWB UNIT. SWB 8 HRS X REC 46 BLW X IFL 1800 FS X FFL 9000 FS X
 NO GAS X SION.

1 of 1
From: 2/1/97 07:00:00 **To:** 2/1/97 18:00:00 11.00 **Hrs** PLANNED on DURING
Functional Responsibility: OTHER **Job Sequence No:** 5 TESTING/SWABBING

Operations Description: Swabbing
 TPC VAC X CPC 0 PSI. SWB 8 HRS X REC 6 BLW X IFL 9000 FS X FFL 10,700 FS. NO REC LAST
 HR X NO GAS.

1 of 1
From: 2/3/97 07:00:00 **To:** 2/3/97 18:00:00 11.00 **Hrs** PLANNED on DURING
Functional Responsibility: OTHER **Job Sequence No:** 5 TESTING/SWABBING

Operations Description: Swabbing
 TPC VAC X CPC 0 PSI. RUN SWB EVERY HR FOR 10 HRS X NO FL REC X NO GAS. UNABLE TO GET
 PERF.

1 of 1
From: 2/4/97 07:00:00 **To:** 2/4/97 18:00:00 11.00 **Hrs** PLANNED on DURING
Functional Responsibility: OTHER **Job Sequence No:** 6 PERFORATION

Operations Description: Perforating
 RUN CCL-GR STRIP X REPERF THE MORROW 10874-80 X 10888-90 X 4 SPF X NO GAS SHOE. R SWB
 X NO FLUID OR GAS ENTRY X SION.