

YATES PETROLEUM CORPORATION
Vandiver CN #1
Section 18-18S-26E
Eddy County, New Mexico

SUNDRY NOTICE CONTINUED - PLUGGING REPORT CONTINUED:

- 9-26-96 - Attempted to kill well. Pumped 150 bbls brine water. Well would pressure up. Let well flow to pit. NOTE: Notified Ray Smith w/OCD-Artesia.
- 9-27-96 - TIH with tubing and packer to 5055'. Set packer and tested packer, tubing and casing to 1000# for 10 minutes, OK. Rigged up wireline. TIH with 4 shot strip gun and perforated at 5630'. Rigged down wireline. Established injection rate. Mixed and pumped 75 sacks Class C cement thru packer down 5-1/2" casing and out at perforations. Pump in pressure 3 BPM at 350#; final pump in pressure 2 BPM at 850#. SIP 700#. Shut well in for night. NOTE: Mike Stubblefield w/OCD-Artesia witnessed cement.
- 9-28-30-96 - Pressure tested cement plug to 1000# for 10 minutes, OK. Rigged up wireline. TIH and tagged top of cement at 5305'. POOH with tubing and packer. Nippled down BOP. Picked up spear. Pulled casing slips and took casing stretch. Estimate free point at 5200'. Rigged up wireline. TIH with 4-1/2" jet cutter and cut 5-1/2" casing at 5150'. Rigged down wireline. Rigged up casing equipment. POOH with 5-1/2" casing. Rigged down casing equipment. Nippled up wellhead and BOP. Shut well in for night. NOTE: Mike Stubblefield w/OCD-Artesia witnessed.
- 10-1-96 - TIH with tubing to 5150'. Mixed and pumped 50 sacks Class C 2% CaCl2 cement from 5150-5050'. POOH with tubing to 3000'. WOC 4 hours. TIH with tubing and tagged top of cement at 4960'. POOH with tubing to 4337'. Mixed and pumped 30 sacks Class C cement from 4337-4237' (in 7-7/8" hole). POOH with tubing to 2251'. Mixed and pumped 30 sacks Class C 2% CaCl2 cement from 2251-2151' (in 7-7/8" hole). POOH with tubing to 1000'. WOC 4 hours. TIH with tubing and tagged top of cement at 2245'. Mixed and pumped 30 sacks Class C cement from 2245-2134' (in 7-7/8" hole). POOH with tubing to 1100'. Shut well in for night. NOTE: Mike Stubblefield w/OCD-Artesia witnessed.
- 10-2-96 - TIH with tubing and tagged top of cement at 2125'. POOH with tubing to 1262'. Mixed and pumped 30 sacks Class C 2% CaCl2 cement from 1262-1153' (in 8-5/8" casing). POOH with tubing. WOC 4 hours. TIH with tubing and tagged top of cement at 1127'. POOH with tubing to 408'. Mixed and pumped 30 sacks Class C 2% CaCl2 cement from 408-308' (in 8-5/8" casing). POOH with tubing. WOC 4 hours. TIH with tubing and tagged top of cement at 300'. POOH with tubing to 40'. Mixed and pumped 10 sacks Class C cement from 40' to surface. POOH with tubing. Nippled down BOP. Rigged down pulling unit. Cleaned location. Installed regulation abandonment marker. PLUGGED AND ABANDONED - FINAL REPORT. Plugging completed 10-1-96.

Rusty Klen
Operations Tech
10-2-96