o Appropriate District Office	Energy, Minerals and Natu	w Mexico ral Resources Department	Form C-103 Revised 1-1-89
DISTRICT I P.O. Box 1980, Hobbs, NM 88240	OIL CONSERVA	TION DIVISION	WELL API NO.
DISTRICT II P.O. Drawer DD, Artesia, NM 88210	Santa Fe. New Mexico 87504-2088		30-015-20858 5. Indicate Type of Lease
DISTRICT III 1000 Rio Brazos Rd., Azzec, NM 87410			STATE FEE X
(DO NOT USE THIS FORM FOR P DIFFERENT RES (FORM	TICES AND REPORTS ON ROPOSALS TO DRILL OR TO DE ERVOIR. USE "APPLICATION FO C-101) FOR SUCH PROPOSALS		7. Lease Name or Unit Agreement Name
Type of Well: OIL CAS WELL WELL	K) ones		Vandiver CN Com
Name of Operator YATES PETROLEUM CORPO		OCT - 3 1996	8. Well No.
. Address of Operator	<u> </u>	OIL CON. DI	9. Pool name or Wildcat
105 South 4th St., An	ctesia, NM 88210	DIST. 2	Atoka Morrow
Well Location Rot, Unit Letter <u>2. 10</u> : <u>10</u>	550 Feet From The North	Line and66	0 Feet From The West Line
10	100	0(7	NMPM Eddy County
Section 18	Township 185	Range 26E whether DF, RKB, RT, GR, etc.)	
	k Appropriate Box to Indi		SEQUENT REPORT OF:
	NTENTION TO:		~ ~
	PLUG AND ABANDON		
	CHANGE PLANS		
PULL OR ALTER CASING		CASING TEST AND C	
OTHER:			
	wentions (Clearly state all pertinent de	etails, and give pertinent dates, inclu	whing estimated date of starting any proposed
12. Describe Proposed or Completed Op			uding estimated date of starting any proposed
12. Describe Proposed or Completed Op work) SEE RULE 1103.	nd rigged up pulling	y unit. Killed wel	1. Nippled up BOP. Released
12. Describe Proposed or Completed Op work) SEE RULE 1103. 9-19-96 - Moved in a packer. POOH with t	nd rigged up pulling ubing and packer. T	g unit. Killed wel TH with tubing. S mencing plugging op	l. Nippled up BOP. Released hut well in for night. NOTE: erations.
12. Describe Proposed or Completed Og work) SEE RULE 1103. 9-19-96 - Moved in a packer. POOH with t Notified Ray Smith w	nd rigged up pulling ubing and packer. T //OCD-Artesia of comm 1 POOH with tubing	g unit. Killed wel TH with tubing. S mencing plugging op 2. Rigged up wirel	1. Nippled up BOP. Released hut well in for night. NOTE: erations. ine. TIH with 5-1/2" CIBP and
12. Describe Proposed or Completed Of work) SEE RULE 1103. 9-19-96 - Moved in a packer. POOH with t Notified Ray Smith w 9-20-96 - Killed wel set at 8616'. Cappe	nd rigged up pulling ubing and packer. 7 /OCD-Artesia of comm 1. POOH with tubing d CIBP with 35' of c	g unit. Killed wel TIH with tubing. S mencing plugging op g. Rigged up wirel cement. TIH with t	1. Nippled up BOP. Released hut well in for night. NOTE: erations. ine. TIH with 5-1/2" CIBP and ubing. Shut well in for night.
12. Describe Proposed or Completed Of work) SEE RULE 1103. 9-19-96 - Moved in a packer. POOH with t Notified Ray Smith w 9-20-96 - Killed wel set at 8616'. Cappe NOTE: Notified Ray	nd rigged up pulling ubing and packer. T /OCD-Artesia of comm 1. POOH with tubing d CIBP with 35' of c Smith w/OCD-Artesia	g unit. Killed wel TH with tubing. S mencing plugging op g. Rigged up wirel cement. TIH with t on setting CIBP.	1. Nippled up BOP. Released hut well in for night. NOTE: erations. ine. TIH with 5-1/2" CIBP and ubing. Shut well in for night.
12 Describe Proposed or Completed Of work) SEE RULE 1103. 9-19-96 - Moved in a packer. POOH with t Notified Ray Smith w 9-20-96 - Killed wel set at 8616'. Cappe NOTE: Notified Ray 9-21-23-96 - Shut do	nd rigged up pulling ubing and packer. T /OCD-Artesia of comm 1. POOH with tubing d CIBP with 35' of c Smith w/OCD-Artesia wn for weekend.	g unit. Killed wel TH with tubing. S mencing plugging op g. Rigged up wirel cement. TIH with t on setting CIBP.	1. Nippled up BOP. Released hut well in for night. NOTE: erations. ine. TIH with 5-1/2" CIBP and ubing. Shut well in for night. p_{out} TD
12. Describe Proposed or Completed Of work) SEE RULE 1103. 9-19-96 - Moved in a packer. POOH with t Notified Ray Smith w 9-20-96 - Killed wel set at 8616'. Cappe NOTE: Notified Ray 9-21-23-96 - Shut do 9-24-96 - TIH with t surface. POOH with	nd rigged up pulling ubing and packer. T /OCD-Artesia of comm 1. POOH with tubing d CIBP with 35' of c Smith w/OCD-Artesia won for weekend. ubing and tagged cen tubing. Attempted to	g unit. Killed wel FIH with tubing. S mencing plugging op g. Rigged up wirel cement. TIH with t on setting CIBP. ment. Spot 210 bbl to dig cellar out w	1. Nippled up BOP. Released hut well in for night. NOTE: erations. ine. TIH with 5-1/2" CIBP and ubing. Shut well in for night. p_{out} TD
12. Describe Proposed or Completed Of work) SEE RULE 1103. 9-19-96 - Moved in a packer. POOH with t Notified Ray Smith W 9-20-96 - Killed wel set at 8616'. Cappe NOTE: Notified Ray 9-21-23-96 - Shut do 9-24-96 - TIH with t surface. POOH with cement. NOTE: Mike	nd rigged up pulling ubing and packer. T /OCD-Artesia of comm 1. POOH with tubing d CIBP with 35' of c Smith w/OCD-Artesia own for weekend. ubing and tagged cer tubing. Attempted to stubblefield w/OCD- iackhammer. Cleaned	g unit. Killed wel FIH with tubing. Simencing plugging op g. Rigged up wirel cement. TIH with t on setting CIBP. ment. Spot 210 bbl to dig cellar out w -Artesia notified. d cellar out and fo	1. Nippled up BOP. Released hut well in for night. NOTE: erations. ine. TIH with 5-1/2" CIBP and ubing. Shut well in for night. for for s plugging mud from 8570' to ith back hoe but cellar full of ound bull plugs on both sides of
12. Describe Proposed or Completed Of work) SEE RULE 1103. 9-19-96 - Moved in a packer. POOH with t Notified Ray Smith w 9-20-96 - Killed wel set at 8616'. Cappe NOTE: Notified Ray 9-21-23-96 - Shut do 9-24-96 - TIH with t surface. POOH with cement. NOTE: Mike 9-25-96 - Rigged up	nd rigged up pulling ubing and packer. T /OCD-Artesia of comm 1. POOH with tubing d CIBP with 35' of c Smith w/OCD-Artesia won for weekend. ubing and tagged cent tubing. Attempted to stubblefield w/OCD- jackhammer. Cleaned wireline. TIH with	g unit. Killed wel TH with tubing. So mencing plugging op g. Rigged up wirel cement. TH with t on setting CIBP. ment. Spot 210 bbl to dig cellar out w -Artesia notified. d cellar out and fo h perforating gun w	1. Nippled up BOP. Released hut well in for night. NOTE: erations. ine. TIH with 5-1/2" CIBP and ubing. Shut well in for night. for for s plugging mud from 8570' to ith back hoe but cellar full of bund bull plugs on both sides of with lubricator and perforated
12. Describe Proposed or Completed Of work) SEE RULE 1103. 9-19-96 - Moved in a packer. POOH with t Notified Ray Smith w 9-20-96 - Killed wel set at 8616'. Cappe NOTE: Notified Ray 9-21-23-96 - Shut do 9-24-96 - TIH with t surface. POOH with cement. NOTE: Mike 9-25-96 - Rigged up wellhead. Rigged up	nd rigged up pulling ubing and packer. T /OCD-Artesia of comm 1. POOH with tubing d CIBP with 35' of c Smith w/OCD-Artesia wn for weekend. ubing and tagged cer tubing. Attempted to stubblefield w/OCD- jackhammer. Cleaned wireline. TIH with	g unit. Killed wel TH with tubing. Somencing plugging op g. Rigged up wirel cement. TIH with t on setting CIBP. ment. Spot 210 bbl to dig cellar out w -Artesia notified. d cellar out and fo h perforating gun w Well would not bl	1. Nippled up BOP. Released hut well in for night. NOTE: erations. ine. TIH with 5-1/2" CIBP and ubing. Shut well in for night. for for s plugging mud from 8570' to ith back hoe but cellar full of ound bull plugs on both sides of with lubricator and perforated ow down. Rigged up pump. Pumpe
12 Describe Proposed or Completed Of work) SEH RULE 1103. 9-19-96 - Moved in a packer. POOH with t Notified Ray Smith w 9-20-96 - Killed wel set at 8616'. Cappe NOTE: Notified Ray 9-21-23-96 - Shut do 9-24-96 - TIH with t surface. POOH with cement. NOTE: Mike 9-25-96 - Rigged up wellhead. Rigged up 1 hole at 1115'. Pu	nd rigged up pulling ubing and packer. T /OCD-Artesia of comm 1. POOH with tubing d CIBP with 35' of c Smith w/OCD-Artesia own for weekend. tubing and tagged cen tubing. Attempted to stubblefield w/OCD- jackhammer. Cleaned wireline. TIH with ressured up to 875#.	g unit. Killed wel TH with tubing. Simencing plugging op g. Rigged up wirel cement. TH with t on setting CIBP. ment. Spot 210 bbl to dig cellar out w -Artesia notified. d cellar out and fo h perforating gun w Well would not bl 1400#. Flowed well	1. Nippled up BOP. Released hut well in for night. NOTE: erations. ine. TIH with 5-1/2" CIBP and ubing. Shut well in for night. for for s plugging mud from 8570' to ith back hoe but cellar full of ound bull plugs on both sides of oith lubricator and perforated ow down. Rigged up pump. Pumpe . Shut well in for night.
12. Describe Proposed or Completed Of work) SEE RULE 1103. 9-19-96 - Moved in a packer. POOH with t Notified Ray Smith w 9-20-96 - Killed wel set at 8616'. Cappe NOTE: Notified Ray 9-21-23-96 - Shut do 9-24-96 - TIH with t surface. POOH with cement. NOTE: Mike 9-25-96 - Rigged up wellhead. Rigged up	nd rigged up pulling ubing and packer. T /OCD-Artesia of comm 1. POOH with tubing d CIBP with 35' of c Smith w/OCD-Artesia own for weekend. tubing and tagged cen tubing. Attempted to stubblefield w/OCD- jackhammer. Cleaned wireline. TIH with ressured up to 875#.	g unit. Killed wel TH with tubing. Sinencing plugging op g. Rigged up wirel cement. TH with t on setting CIBP. nent. Spot 210 bbl to dig cellar out w -Artesia notified. d cellar out and fo h perforating gun w Well would not bl 1400#. Flowed well	1. Nippled up BOP. Released hut well in for night. NOTE: erations. ine. TIH with 5-1/2" CIBP and ubing. Shut well in for night. for for s plugging mud from 8570' to ith back hoe but cellar full of bund bull plugs on both sides of oith lubricator and perforated ow down. Rigged up pump. Pumpe . Shut well in for night.
12 Describe Proposed or Completed Of work) SEH RULE 1103. 9-19-96 - Moved in a packer. POOH with t Notified Ray Smith w 9-20-96 - Killed wel set at 8616'. Cappe NOTE: Notified Ray 9-21-23-96 - Shut do 9-24-96 - TIH with t surface. POOH with cement. NOTE: Mike 9-25-96 - Rigged up wellhead. Rigged up 1 hole at 1115'. Pu	nd rigged up pulling ubing and packer. T /OCD-Artesia of comm 1. POOH with tubing d CIBP with 35' of c Smith w/OCD-Artesia own for weekend. tubing and tagged cen tubing. Attempted to stubblefield w/OCD- jackhammer. Cleaned wireline. TIH with ressured up to 875#.	g unit. Killed wel TH with tubing. Simencing plugging op g. Rigged up wirel cement. TH with t on setting CIBP. ment. Spot 210 bbl to dig cellar out w -Artesia notified. d cellar out and fo h perforating gun w Well would not bl 1400#. Flowed well	1. Nippled up BOP. Released hut well in for night. NOTE: erations. ine. TIH with 5-1/2" CIBP and ubing. Shut well in for night. International Content of the back hold from 8570' to with back hold but cellar full off bund bull plugs on both sides of with lubricator and perforated ow down. Rigged up pump. Pumpe Shut well in for night. NUED ON NEXT PAGE: Technician DATE Oct. 2, 1996
12 Describe Proposed or Completed Of work) SEH RULE 1103. 9-19-96 - Moved in a packer. POOH with t Notified Ray Smith w 9-20-96 - Killed wel set at 8616'. Cappe NOTE: Notified Ray 9-21-23-96 - Shut do 9-24-96 - TIH with t surface. POOH with cement. NOTE: Mike 9-25-96 - Rigged up wellhead. Rigged up 1 hole at 1115'. Pu	nd rigged up pulling ubing and packer. T /OCD-Artesia of comm 1. POOH with tubing d CIBP with 35' of of Smith w/OCD-Artesia wn for weekend. ubing and tagged cer tubing. Attempted to stubblefield w/OCD- jackhammer. Cleaned wireline. TIH with ressured up to 875#. . Pressured up to ield w/OCD notified	g unit. Killed wel TH with tubing. Sinencing plugging op g. Rigged up wirel cement. TH with t on setting CIBP. nent. Spot 210 bbl to dig cellar out w -Artesia notified. d cellar out and fo h perforating gun w Well would not bl 1400#. Flowed well	1. Nippled up BOP. Released hut well in for night. NOTE: erations. ine. TIH with 5-1/2" CIBP and ubing. Shut well in for night. forf JD is plugging mud from 8570' to ith back hoe but cellar full off bund bull plugs on both sides of oith lubricator and perforated ow down. Rigged up pump. Pumpe . Shut well in for night. NUED ON NEXT PAGE: Technician DATE Oct. 2, 1996
12. Describe Proposed or Completed Of work) SEH RULE 1103. 9-19-96 - Moved in a packer. POOH with t Notified Ray Smith w 9-20-96 - Killed wel set at 8616'. Cappe NOTE: Notified Ray 9-21-23-96 - Shut do 9-24-96 - TIH with t surface. POOH with cement. NOTE: Mike 9-25-96 - Rigged up wellhead. Rigged up 1 hole at 1115'. Pr 150 bbls brine water NOTE: Mike Stubile I horte: Mike Stubile NOTE: Mike Stubile Subarture Note: Mike Stubile	nd rigged up pulling ubing and packer. T /OCD-Artesia of comm 1. POOH with tubing d CIBP with 35' of of Smith w/OCD-Artesia wn for weekend. ubing and tagged cer tubing. Attempted to stubblefield w/OCD- jackhammer. Cleaned wireline. TIH with ressured up to 875#. . Pressured up to ield w/OCD notified	g unit. Killed wel TH with tubing. Sinencing plugging op g. Rigged up wirel cement. TH with t on setting CIBP. nent. Spot 210 bbl to dig cellar out w -Artesia notified. d cellar out and fo h perforating gun w Well would not bl 1400#. Flowed well	1. Nippled up BOP. Released hut well in for night. NOTE: erations. ine. TIH with 5-1/2" CIBP and ubing. Shut well in for night. <i>forf TD</i> is plugging mud from 8570' to ith back hoe but cellar full of bund bull plugs on both sides of oth lubricator and perforated ow down. Rigged up pump. Pumpe . Shut well in for night. NUED ON NEXT PAGE: Technician DATE Oct. 2, 1996 TELEPHONE NO. 505/748-1
12 Describe Proposed or Completed Of work) SEH RULE 1103. 9-19-96 - Moved in a packer. POOH with t Notified Ray Smith w 9-20-96 - Killed wel set at 8616'. Cappe NOTE: Notified Ray 9-21-23-96 - Shut do 9-24-96 - TIH with t surface. POOH with cement. NOTE: Mike 9-25-96 - Rigged up wellhead. Rigged up 1 hole at 1115'. Pr 150 bbls brine water NOTE: Mike Stubile I horte: Mike Stubile I ho	nd rigged up pulling ubing and packer. T /OCD-Artesia of comm 1. POOH with tubing d CIBP with 35' of of Smith w/OCD-Artesia wn for weekend. ubing and tagged cer tubing. Attempted to stubblefield w/OCD- jackhammer. Cleaned wireline. TIH with ressured up to 875#. . Pressured up to ield w/OCD notified	g unit. Killed wel TH with tubing. Sinencing plugging op g. Rigged up wirel cement. TH with t on setting CIBP. nent. Spot 210 bbl to dig cellar out w -Artesia notified. d cellar out and fo h perforating gun w Well would not bl 1400#. Flowed well	1. Nippled up BOP. Released hut well in for night. NOTE: erations. ine. TIH with 5-1/2" CIBP and ubing. Shut well in for night. <i>forf TD</i> is plugging mud from 8570' to ith back hoe but cellar full of bund bull plugs on both sides of oth lubricator and perforated ow down. Rigged up pump. Pumpe . Shut well in for night. NUED ON NEXT PAGE: Technician DATE Oct. 2, 1996 TELEPHONE NO. 505/748-1
12 Describe Proposed or Completed Of work) SEH RULE 1103. 9-19-96 - Moved in a packer. POOH with t Notified Ray Smith w 9-20-96 - Killed wel set at 8616'. Cappe NOTE: Notified Ray 9-21-23-96 - Shut do 9-24-96 - TIH with t surface. POOH with cement. NOTE: Mike 9-25-96 - Rigged up wellhead. Rigged up 1 hole at 1115'. Pr 150 bbls brine water NOTE: Mike Stubile I horte: Mike Stubile I ho	nd rigged up pulling ubing and packer. T /OCD-Artesia of comm 1. POOH with tubing d CIBP with 35' of of Smith w/OCD-Artesia wn for weekend. ubing and tagged cer tubing. Attempted to stubblefield w/OCD- jackhammer. Cleaned wireline. TIH with ressured up to 875#. . Pressured up to ield w/OCD notified	g unit. Killed wel TH with tubing. Sinencing plugging op g. Rigged up wirel cement. TH with t on setting CIBP. nent. Spot 210 bbl to dig cellar out w -Artesia notified. d cellar out and fo h perforating gun w Well would not bl 1400#. Flowed well	1. Nippled up BOP. Released hut well in for night. NOTE: erations. ine. TIH with 5-1/2" CIBP and ubing. Shut well in for night. forf ID is plugging mud from 8570' to ith back hoe but cellar full of ound bull plugs on both sides of oith lubricator and perforated ow down. Rigged up pump. Pumpe . Shut well in for night. NUED ON NEXT PAGE: Technician DATE Oct. 2, 1996