TILE  J.S.G.S.  Sa. Indicate T	
TILE  NEW MEXICO OIL CONSERVATION COMMISSION  Effective 1  Sa. Indicate T	
J.S.G.S. Sa. Indicate T	
AND OFFICE State	Fee X
5, State Oil 6	Gas Leaue No.
SUNDRY NOTICES AND REPORTS ON WELLS  TOO NOT USE THIS FORM FOR PROPOSALS TO SHILL OR TO DELFTE OF FLUG BACK TO A DIFFERENT RESERVOIR.	
OIL CAS X OTHER.	ent Nucle
Brunson & McKnight, Inc.  8. Ferm of Lec	ndiver
P. O. Box 297, Hobbs, New Mexico 88240 9. Well No.	2
	Pool, or Willest Ka Morrow
THE East LINE, SECTION 13 TOWNSHIP 18S BANGE 25E	
15. Elevation (Show whether DF, RT, GR, etc.) 12. County	77777777
GL 3440 KB 3454 Eddy	
Check Appropriate Box To Indicate Nature of Notice, Report or Other Data NOTICE OF INTENTION TO:  SUBSEQUENT REPORT OF	=:
	ERING CASING
OTHER	·
. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of	f
work) SEE RULE 1703.	starting any proposed
1. Set bridge plug on wire line @ 8655' capped with 3 sx cement	•
2. Shot casing off at 6080', pulled 6080' 4 1/2" casing.	
$\cdot$	
3. Set plugs as follows:  50 sx plug across casing stub @ 6080'  35 sx plug @ 5640-5740 Wolfcamp  35 sx plug @ 4290-4390 Abo  35 sx plug @ 2200-2300 Glorieta  35 sx plug @ 1275-1375 8 5/8 Casing shows the state of	oe ·
50 sx plug across casing stub @ 6080' 35 sx plug @ 5640-5740 Wolfcamp 35 sx plug @ 4290-4390 Abo 35 sx plug @ 2200-2300 Glorieta 35 sx plug @ 1275-1375 8 5/8 Casing sho	pe
50 sx plug across casing stub @ 6080' 35 sx plug @ 5640-5740 Wolfcamp 35 sx plug @ 4290-4390 Abo 35 sx plug @ 2200-2300 Glorieta 35 sx plug @ 1275-1375 8 5/8 Casing sho 50 sx plug @ 500-600 in 8 5/8 casing 15 sx plug @ surface	pe ·
50 sx plug across casing stub @ 6080' 35 sx plug @ 5640-5740 Wolfcamp 35 sx plug @ 4290-4390 Abo 35 sx plug @ 2200-2300 Glorieta 35 sx plug @ 1275-1375 8 5/8 Casing sho 50 sx plug @ 500-600 in 8 5/8 casing 15 sx plug @ surface  4. Welded on plate and installed dry hole marker. 4-23-75	pe ·
50 sx plug across casing stub @ 6080' 35 sx plug @ 5640-5740 Wolfcamp 35 sx plug @ 4290-4390 Abo 35 sx plug @ 2200-2300 Glorieta 35 sx plug @ 1275-1375 8 5/8 Casing sho 50 sx plug @ 500-600 in 8 5/8 casing 15 sx plug @ surface  4. Welded on plate and installed dry hole marker. #- 23-75  5. Cleaned location.	5/19/77
50 sx plug across casing stub @ 6080'  35 sx plug @ 5640-5740 Wolfcamp  35 sx plug @ 4290-4390 Abo  35 sx plug @ 2200-2300 Glorieta  35 sx plug @ 1275-1375 8 5/8 Casing sho  50 sx plug @ 500-600 in 8 5/8 casing  15 sx plug @ surface  4. Welded on plate and installed dry hole marker. #- 23-75  5. Cleaned location.  Thereby certify that the information above is true and complete to the best of my knowledge and belief.  Agent	