


Operator Matador Operating Co.
 Well Fulmer Atoka Com #1
 Unit D Section 12 Township 18 Range 26
 API # 30-015-70931

TOPS

San Andres	~ 1000
Glorieta	2330
Tubb	3865
Abo	4526
Wolfcamp	5917
Penn	7200
St. Louis	8061
Atoka	8645
McNew LS	8835
McNew CI	8885

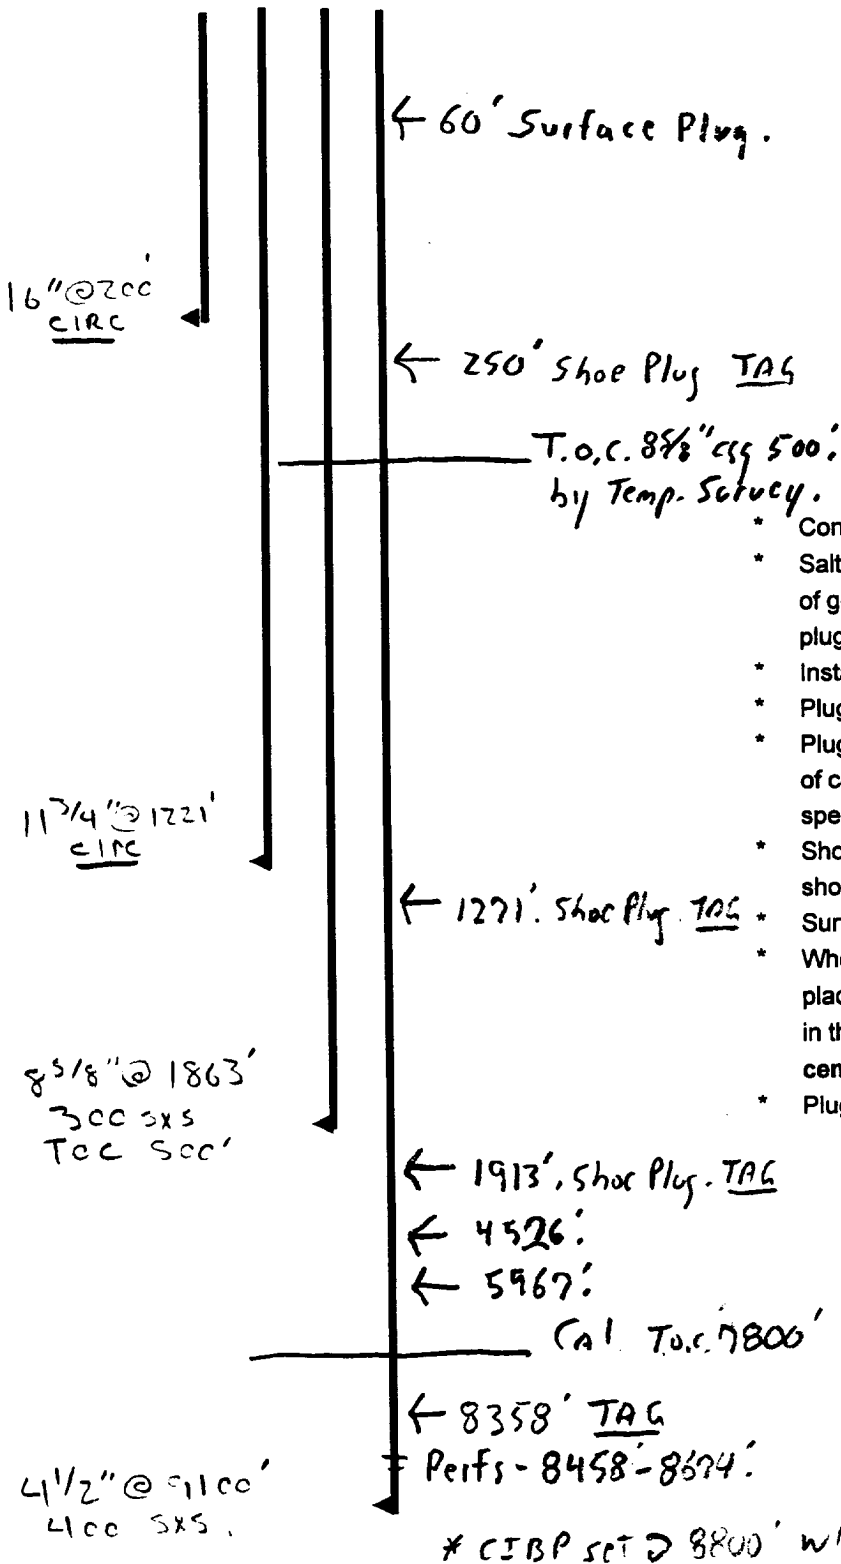

- * Contact OCD 24 hrs. prior to any work done.
- * Salt gel mud consisting of 10# brine with 25# of gel per barrel must be placed between each plug.
- * Install dry hole marker as per Rule 202.B.2
- * Plugs are to be set from point indicated up.
- * Plugs must not be less than 100' or 25 Sacks of cement, whichever is greater, unless specifically indicated.
- * Shoe and stub plugs will be 50' above and below shoe or stub and tagged.
- * Surface plug will be from 0' - 60'
- * Where plugs are required, cement must be placed inside and outside of all casing string(s) in the correct footage or sacks required, if no cement exists.
- * Plugs to be tagged will be indicated.