

Johnson Com #1

MIRU Plugging Equipment.

NO wellhead, POOH w/ Tbg & PK.

RIH spot 50' cmt plug in $5\frac{1}{2}$ csg at 6650' to 6600' SI. Tag plug. This isolates cisco perfs at 6678' to 6775'.

Displace 9 lb mud to 5500'

Cut $5\frac{1}{2}$ csg at 5900' POOH w/ csg. Laying dn.

RIH w/ Tbg. Spot 100' cmt from 5950' to 5850' this puts cmt 50' & 50' out $5\frac{1}{2}$ csg. SI Tag plug.

Displace hole w/ 9 lb mud to 1300'. Spot 100' cmt plug from 1350' to 1250' SI & Tag.

Displace hole w/ 9 lb mud to 450'. Spot 100' cmt from 550' to 450' SI & Tag.

POOH spot 50' surface plug. SI.

Cut off well head as low as possible install Dry hole marker, cut anchors, remove production facilities clean location.