

Submit 3 Copies
to Appropriate
District Office

State of New Mexico
Energy, Minerals and Natural Resources Department

Form C-103
Revised 1-1-89

DISTRICT I
P.O. Box 1980, Hobbs, NM 88240

DISTRICT II
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION
P.O. Box 2088
Santa Fe, New Mexico 87504-2088

WELL API NO.
30-015-21686

5. Indicate Type of Lease
STATE ☐ FEE ☒

6. State Oil & Gas Lease No.

7. Lease Name or Unit Agreement Name
Jerry Nelson, Com.

8. Well No.
1

9. Pool name or Wildcat
Atoka Penn

10. Elevation (Show whether DF, RKB, RT, GR, etc.)
3314 GL

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT"
(FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well:
OIL WELL ☐ GAS WELL ☒ OTHER ☐

2. Name of Operator
Matador Operating Company

3. Address of Operator
415 W. Wall, Ste 1101, Midland, TX 79701

4. Well Location
Unit Letter C : 990 Feet From The North Line and 1650 Feet From The West Line
Section 14 Township 18S Range 26E NMPM Eddy County

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:		SUBSEQUENT REPORT OF:	
PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input type="checkbox"/>	REMEDIAL WORK <input checked="" type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>	PLUG AND ABANDONMENT <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	OTHER: <input type="checkbox"/>	CASING TEST AND CEMENT JOB <input type="checkbox"/>	OTHER: <input type="checkbox"/>

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

- 10-23-93: POOH w/tbg & packer.
10-24-93: TIH w/Guiberson Uni-Pkr VI, 1.81 profile nipple, 1-25/32 S.N. Set pkr on 2-3/8" tbg @ 9067' KB w/15000# compression. Perforate thru tbg @ 9090-96; 9105-9112' KB, 4SPF, 0° phasing. Swab in w/show of gas.
10-29-93: Run BHP buildup.
11-5-93: Acidize w/ 2000 gals 7-1/2% Fe HCL acid w/ 1000 SCF N₂/bbl w/ 100 balls. Flow/swab to recover load.
11-8-93: Put well on line.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE R.F. Burke TITLE Operations Manager DATE 12-6-93
TYPE OR PRINT NAME R.F. Burke TELEPHONE NO. 915-687-5935

(This space for State Use)

APPROVED BY MIKE WILLIAMS TITLE SUPERVISOR, DISTRICT II DATE DEC 15 1993
CONDITIONS OF APPROVAL, IF ANY: