

45F
 Up

DISTRICT I
 P.O. Box 1980, Hobbs, NM 88240
 DISTRICT II
 P.O. Drawer DD, Artesia, NM 88210
 DISTRICT III
 1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION

P.O. Box 2088
 Santa Fe, New Mexico 87508

SEP - 8 1993

WELL API NO. 30-015-21983
5. Indicate Type of Lease STATE <input type="checkbox"/> FEE <input checked="" type="checkbox"/>
6. State Oil & Gas Lease No.
7. Lease Name or Unit Agreement Name Gulf GZ
8. Well No. 1
9. Pool name or Wildcat Undes. Atoka San Andres

SUNDRY NOTICES AND REPORTS ON WELLS
 (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A
 DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT"
 (FORM C-101) FOR SUCH PROPOSALS.)

Type of Well:
 OIL WELL ☐ GAS WELL ☐ OTHER P & A Well

Name of Operator
 YATES PETROLEUM CORPORATION

Address of Operator
 105 South 4th St., Artesia, NM 88210

Well Location
 Unit Letter H : 2310 Feet From The North Line and 330 Feet From The East Line
 Section 28 Township 18S Range 26E NMFM Eddy County
 10. Elevation (Show whether DF, RKB, RT, GR, etc.)
 3362' GR

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data	
NOTICE OF INTENTION TO:	SUBSEQUENT REPORT OF:
PERFORM REMEDIAL WORK <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>
OTHER: <input type="checkbox"/>	PLUG AND ABANDONMENT <input checked="" type="checkbox"/>
	CASING TEST AND CEMENT JOB <input type="checkbox"/>
	OTHER: <input type="checkbox"/>

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

Plugged and abandoned well as follows:

Moved in and rigged up pulling unit. POOH and laid down 60 rods and pump. Nippled down wellhead and nippled up BOP. POOH with 49 joints of 2-3/8" tubing. WIH and set 4-1/2" CIBP at 1541'. Capped with 10 sacks of cement. Top of cement at 1400'. Circulated hole with 10# mud. Pulled tubing to 1195'. Spot 25 sacks of cement from 1195-833'. POOH to 535'. Spot 25 sacks cement from 535-282'. POOH to 95'. Spot 10 sacks cement from 95' to surface. POOH with tubing. Cut off wellhead. Installed regulation abandonment marker. PLUGGED AND ABANDONED - FINAL REPORT.

Plugging completed August 7, 1993.

Part ID-2
 9-24-93
 PVA

I hereby certify that the information above is true and complete to the best of my knowledge and belief.
 SIGNATURE Rusty Klein TITLE Production Clerk DATE Sept. 4, 1993
 TYPE OR PRINT NAME Rusty Klein TELEPHONE NO. 505/748-1471

(This space for State Use)

APPROVED BY [Signature] TITLE Field Asst DATE 4/10/94

CONDITIONS OF APPROVAL, IF ANY: