SUNDRY NOTICES AND REPORTS ON WELTS***** (DO NOT USE THIS FORM FOR PROPOSALS TO DEFLIC OR PLUG BACK TOA DIFFERENT RESERVOR. USE "APPLICATION FOR FERMIT" (FORM C-101) FOR SUCH PROPOSALS) 7. Lean Name or Unit Agreement Name (FORM C-101) FOR SUCH PROPOSALS) 1. Type of Well: 0.000 0.000 1 2. Name of Operator YATES PETROLEUM CORPORATION 8. Well No. 1 3. Address of Operator YATES PETROLEUM CORPORATION 9. Pool name or Wildest 1 4. Well zeased 1750 Feet From The Suth 1 4. Well zeased 1750 Feet From The East Wall zeased 105 South Lise and 1750 Feet From The East 4. Well zeased 105 Notice Report, or Other Data NOTHCE OF INTENTION TO: SUBSEQUENT REPORT OFF. 10. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data NOTHCE OF INTENTION TO: SUBSEQUENT REPORT OF 11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data NOTHCE OF INTENTION TO: SUBSEQUENT REPORT OF 12. Describe Proposed or Compiled Operations (Clearly state all privisers deally, and give private date; including estimated date of starting any proposed work) SEE RULE 1103. Atterning cassing TEST AND CEMENT JOB 0THER: OTHER		Energy, Minerals and Natural Re-	Submit 3 Copies to Appropriate	
DESTECTION Santa Fe, New MexicolsCorrections S. Darwer DD, Anesih, NM 88210 Santa Fe, New MexicolsCorrections DISTICTION SEP - 8 1993 S. State ON States, NM 87400 S. State ON States, NM 87400 SUNDERY NOTICES AND REPORTS ON WELTS* S. State ON & Gue Leave No. (DO NOT USE THIS FORM FOR PROPOSALS) TO DELL OR TO DEEPEN OF PLUG BACK TO A There of Usit Agreement Name (DO NOT USE THIS FORM FOR PROPOSALS) TO DELL OR TO DEEPEN OF PLUG BACK TO A There of Usit Agreement Name (DO NOT USE THIS FORM FOR PROPOSALS) OTHER P 6 A Well Culf HI 1. Type of Well Guil Correspondence R. Well No. YATES PETROLEUM CORPORATION 9. Fool name or Wilkait Atoka San Andres 10. South 4th St., Artesia, NM 88210 Atoka San Andres 13. Advised Openion 9. Fool name or Wilkait Atoka San Andres 10. South 4th St., Artesia, NM 88210 Atoka San Andres 4. Well Leaston 3374* GR Colf RE, MT, GR, etc.) 11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF: 12. HAR MEMEDIAL WORK PLUG AND ABANDON Comment of Notice, Report, or Other Data NOTICE OF INTENTION TO: 13. Advised Appropr	x 2088 20 015-22034	CICT I Box 1980, Hobbs, NM 88240 RICT II Drawer DD, Artesia, NM 88210 OIL CONSERVATION DIVISION P.O. Box 2088 Santa Fe, New Mexico		
1000 Bis Bisnes RA, Astes, MM 57410 C. L. D. SUNDRY NOTICES AND REPORTS ON WEILTS - G. L. D. (DO NOT USE THIS FORM SOL PROPOSALS TO PRILL OR TO DEPEN OR PLUE BACK TO A DIFFERENT RESERVOR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS) 1 Type of Well: Gas of wall 000 Not USE THIS FORM FOR PROPOSALS TO PRIL OR TO DEPEND RPLUE BACK TO A DIFFERENT RESERVOR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS) 1. Lease Name or Unit Agreement Name 10. South 4th St., Artesia, NM 88210 1. Atoka San Andres 10. South 4th St., Artesia, NM 88210 Atoka San Andres 10. South 4th St., Artesia, NM 88210 Atoka Can Atoka San Andres 10. Mult Latter J : 1650 Feer From The South Line and 1750 Feer From The East 10. South 4th St., Artesia, NM 88210 Atoka San Andres 11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF: 11. NOTICE OF INTENTION TO: REMEDIAL WORK Atterning CASING 12. Prove Memory SEE RLE 103. CAMME CEMENT JOB COMMENCE DRILLING ONN. PLUG AND ABANDON 12. Describe Proposed or Compiled Operations (Clearly state all periment dealit, and give periment deats, including estimated date of starting any properiod work SEE RLE 103. PULICA ALTER CASING CHEMENT JOB	xico NT SCH 2088 5. Indicate Type of Lease STATE FEE X			
SUNDER NOTICES AND REPORTS ON WEITS* **** (DO NOT USE THIS FORMER PROPOSALS) 1. Lease Name or Unit Agreement Name DIFFERENT RESERVOR. USE "APPLICATION FOR FERMATT (FORM C-101) FOR SUCH PROPOSALS) 1. Type of Weil: ***** (FORM C-101) FOR SUCH PROPOSALS) 1. Lease Name or Unit Agreement Name YATES FETROLEUM CORPORATION 8. Weil No. 1. South Corporate YATES FETROLEUM CORPORATION Address of Operator YATES FETROLEUM CORPORATION Address of Operator YATES FETROLEUM CORPORATION Address of Operator YATES FETROLEUM CORPORATION YATES FETROLEUM CORPORATION Interview of Weilst YATES FETROLEUM CORPORATION Yeils colspan="2">Colspan="2">Colspan="2">Yeils colspan="2">Yeils colspan="2" Yeils colspan="2" Yeils colspan="2" Y	SE P - 8 1993 6. State Oil & Gas Lease No.	Rd., Aztec, NM 87410	<u>DISTRICT III</u> 1000 Rio Brazos Rd., Azt	
Ownst OWNST OWNST Gulf HI 2. Name of Operator 8. Well No. 1 YATES PEROLEUM CORPORATION 8. Well No. 1 3. Address of Operator 9. Pool name or Wildest 105 South 4th St., Artesia, NM 88210 Atoka San Andres 4. Well Loadion Unit Letter J. : 1650 Fee From TheSouth Line and1750 Feet From TheEast Section 28 Township 185 Range 26E NMFM Eddy 9. Pool name of Wildest 10. Elevation (Show Watcher DP, RKB, RT, GR, etc.) 3374' GR GR 11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF: FERFORM REMEDIAL WORK PLUG AND ABANDON CHENCE Appropriate Box to Indicate Nature of Notice, Report, or Other Data NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF: REMEDIAL WORK Attening CASING COMMENCE ORILLING OPNS. PLUG AND ABANDO Completed Operations (Clearly state all periment details, and give periment date, including estimated date of starting any proposed work) SEE WILE 1003. <td colspan<="" td=""><td>WELTS</td><td>SUNDRY NOTICES AND REPORTS ON WEL THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN DIFFERENT RESERVOR. USE "APPLICATION FOR PER</td><td>(DO NOT USE THIS I</td></td>	<td>WELTS</td> <td>SUNDRY NOTICES AND REPORTS ON WEL THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN DIFFERENT RESERVOR. USE "APPLICATION FOR PER</td> <td>(DO NOT USE THIS I</td>	WELTS	SUNDRY NOTICES AND REPORTS ON WEL THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN DIFFERENT RESERVOR. USE "APPLICATION FOR PER	(DO NOT USE THIS I
YATES PETROLEUM CORPORATION 1 3. Address of Operator 9. Pool name or Wildat 105 South 4th St., Artesia, NM 88210 Atoka San Andres 4. Well Location 1650. Feet From The South Line and 1750. Feet From The East Section 28 Township 185 Range 26E NMFM Eddy 10. Elevation (Show whither DF, RKB, KT, GR, etc.) 3374' GR GR III. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF: SUBSEQUENT REPORT OF: PERFORM REMEDIAL WORK PLUG AND ABANDON GRMENCE DRILLING OPNS. PLUG AND ABANDON CHARGE PLANS COMMENCE DRILLING OPNS. PLUG AND ABANDON CASING TEST AND CEMENT JOB JOTHER: OTHER: OTHER: OTHER: III. 12 Deenbe Proposed or Completed Operations (Clearly state all periment detail, and give periment data: including estimated date of starting any proposed work Start RULE 103. Plugged and abandoned well as follows: Moved in and rigged up pulling unit. POOH and laid down rods and pump. Nippled do wellhead and nippled up BOP. POOH vith tubing, seating nipple and mud anchor. THE CIBP and seat 1545'. Capped with 10 sacks of cement. Top of cement at 140'. C GOI: Spotted 25 sacks cement from 1257-889'. PO			OL	
Atoka San Andres Atoka San Andres A Well Location Unit Letter J : 1650 Feet From The South Line and 1750 Feet From The East Section 28 Township 185 Range 26E NUTM Eddy 10 Elevation (Show whether DF, RKE, RT, GR, etc.) 3374' GR Eddy 11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF: PERFORM REMEDIAL WORK PLUG AND ABANDON GOMMENCE DRILLING OPNS. PLUG AND ABANDON COMMENCE DRILLING OPNS. PLUG AND ABANDON CASING TEST AND CEMENT JOB OTHER: DITHER OTHER OTHER OTHER OTHER OTHER 12. Describe Proposed or Completed Operations (Clearly state all perionent data:, including estimated date of starting any proposed worky State RULE 103. Plugged and abandoned well as follows: Moved in and rigged up pulling unit. POOH and laid down rods and pump. Nippled do CIBP and set at 1545'. Capped with 10 sacks of cement. Top of crement at 1400'. Ch COM vith fund. POOH to 1257'. Spotted 25 sacks cement from 1257-889	8. Well No. <u>1</u>			
Unit Letter				
Section 28 Township 185 Range 26E NMFM Eddy 10. Lievation (Show whather DF, RKB, RT, GR, etc.) 3374' GR GR 11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF: PERFORM REMEDIAL WORK PLUG AND ABANDON COMMENCE DRILLING OPNS. PLUG AND ABANDON COMMENCE DRILLING OPNS. PLUG AND ABANDON CASING TEST AND CEMENT JOB OTHER: ID Specifie Operations (Clearly state all periment details, and give periment dates, including estimated date of starting any proposed work! Noted a bandoned well as follows: Moved in and rigged up pulling unit. POOH and laid down rods and pump. Nippled do weilhead and nippled up BOP. POOH with tubing, seating nipple and mud anchor. TIH	Line and 1750 Feet From The East Line			
II. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF: PERFORM REMEDIAL WORK PLUG AND ABANDON REMEDIAL WORK ALTERING CASING PERFORM REMEDIAL WORK PLUG AND ABANDON REMEDIAL WORK ALTERING CASING PERFORM REMEDIAL WORK PLUG AND ABANDON COMMENCE DRILLING OPNS. PLUG AND ABANDO OTHER: OTHER: OTHER: OTHER: 12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent date, including estimated date of starting any proposed work) SEE RULE 1103. Plugged and abandoned well as follows: Moved in and rigged up pulling unit. POOH with tubing, seating nipple and mud anchor. TIH CIBP and set at 1545'. Capped with 10 sacks of cement. Top of cement at 1400'. Co hole with 10# mud. POOH to 1257'. Spotted 25 sacks cement from 1257-889'. POOH to 00'. Spotted 25 sacks cement from 600-349'. POOH to 95'. Circulated cement to s with 10 sacks. POOH with tubing. Cut off wellhead and installed regulation abandom marker. PLUGGED AND ABANDONED - FINAL REPORT. Plugging completed August 6, 1993. TIME Production Clerk DATE Sept. TYPE OR FRUNT NAME Rusty Klein THE Production Clerk DATE Sept. TYPE OR FRUNT NAME Rusty Klein THE PROME NO. THEPROME NO.	Range 26E NMPM Eddy County whether DF, RKB, RT, GR, etc.) ////////////////////////////////////	28 Township 18S Ra	20	
PERFORM REMEDIAL WORK PLUG AND ABANDON REMEDIAL WORK ALTERING CASING TEMPORARILY ABANDON CHANGE PLANS COMMENCE DRILLING OPNS. PLUG AND ABANDO DULL OR ALTER CASING CASING TEST AND CEMENT JOB CASING TEST AND CEMENT JOB DITHER: 12. Describe Proposed or Completed Operations (Clearly state all periment details, and give periment date; including estimated date of starting any proposed work) SEE RULE 103. Plugged and abandoned well as follows: 12. Describe Proposed and nippled up DOP. POOH with tubing, seating nipple and mud anchor. THE CIBP and set at 1545'. Capped with 10 sacks of cement. Top of cement at 1400'. C hole with 10 [#] mud. POOH to 1257'. Spotted 25 sacks cement from 600-349'. POOH to 95'. Circulated cement to swith 10 sacks. Plugging completed August 6, 1993. Interday centry that be information above is try and complete to the best of my knowledge and belief. SKINNTURE THE Production Clerk DATE Sept. Type or PRINT NAME Rusty Klein THE Production Clerk DATE Sept. THE Production Clerk DATE Sept. (This space for State Use) Mud THE Production Clerk DATE Sept. THE PROME NO. THE PROME NO.	cate Nature of Notice, Report, or Other Data	Check Appropriate Box to Indicate I		
TEMPORARILY ABANDON CHANGE PLANS COMMENCE DRILLING OPNS. PLUG AND ABANDO PULL OR ALTER CASING CASING TEST AND CEMENT JOB CASING TEST AND CEMENT JOB OTHER: OTHER: OTHER: OTHER: 12. Describe Proposed or Completed Operations (Clearly state all periment details, and give periment dates, including estimated date of starting any proposed work) SEE RULE 1103. OTHER: 12. Describe Proposed and abandoned well as follows: Moved in and rigged up pulling unit. POOH and laid down rods and pump. Nippled do wellhead and nippled up BOP. POOH with tubing, seating nipple and mud anchor. TIH CIBP and set at 1545'. Capped with 10 sacks of cement. Top of cement at 1400'. Of hole with 10 [#] mud. POOH to 1257'. Spotted 25 sacks cement from 1257-889'. POOH to 600'. Spotted 25 sacks cement from 600-349'. POOH to 95'. Circulated cement to s with 10 sacks. POOH with tubing. Cut off wellhead and installed regulation abando marker. PLUGGED AND ABANDONED - FINAL REPORT. Plugging completed August 6, 1993. I hereby certify that the information above is trice and complete to the best of my knowledge and belief. SUNATURE THE Production Clerk MORE PERFUNE NO. TELEPHONE NO. (This space for State Use) THE				
OTHER: OTHER: 12. Describe Proposed or Completed Operations (Clearly state all periment details, and give periment dates, including estimated date of starting any proposed work) SEE RULE 1103. Plugged and abandoned well as follows: Moved in and rigged up pulling unit. POOH and laid down rods and pump. Nippled dowellhead and nippled up BOP. POOH with tubing, seating nipple and mud anchor. THE CIBP and set at 1545'. Capped with 10 sacks of cement. Top of cement at 1400'. Othole with 10# mud. POOH to 1257'. Spotted 25 sacks cement from 1257-889'. POOH to 600'. Spotted 25 sacks cement from 600-349'. POOH to 95'. Circulated cement to swith 10 sacks. POOH with tubing. Cut off wellhead and installed regulation abandom marker. PLUGGED AND ABANDONED - FINAL REPORT. Plugging completed August 6, 1993. Ihereby certify the information above is price and complete to the best of my knowledge and belief. SUNATURE TITLE Production Clerk DATE Sept. TYPE OR FRINT NAME Rusty Klein THER: THER:				
12. Describe Proposed or Completed Operations (Clearly state all periment data), and give pertiment dates, including estimated date of starting any proposed work) SEE RULE 1103. Plugged and abandoned well as follows: Moved in and rigged up pulling unit. POOH and laid down rods and pump. Nippled do wellhead and nippled up BOP. POOH with tubing, seating nipple and mud anchor. TIH CIBP and set at 1545'. Capped with 10 sacks of cement. Top of cement at 1400'. Other with 10# mud. POOH to 1257'. Spotted 25 sacks cement from 1257-889'. POOH to 600'. Spotted 25 sacks cement from 600-349'. POOH to 95'. Circulated cement to swith 10 sacks. POOH with tubing. Cut off wellhead and installed regulation abando marker. PLUGGED AND ABANDONED - FINAL REPORT. Plugging completed August 6, 1993. I hereby certify that the information above is top and complete to the best of my knowledge and belief. SKONATURE TIME Production Clerk DATE Sept. TYPE OR FRINT NAME Rusty Klein This space for State Use) THE			PULL OR ALTER CASI	
<pre>work) SEE RULE 1103. Plugged and abandoned well as follows: Moved in and rigged up pulling unit. POOH and laid down rods and pump. Nippled do wellhead and nippled up BOP. POOH with tubing, seating nipple and mud anchor. TIH CIBP and set at 1545'. Capped with 10 sacks of cement. Top of cement at 1400'. O hole with 10# mud. POOH to 1257'. Spotted 25 sacks cement from 1257-889'. POOH t 600'. Spotted 25 sacks cement from 600-349'. POOH to 95'. Circulated cement to s with 10 sacks. POOH with tubing. Cut off wellhead and installed regulation abando marker. PLUGGED AND ABANDONED - FINAL REPORT. Plugging completed August 6, 1993. I hereby certify the the information above is tries and complete to the best of my knowledge and belief. SignATURE TYPE OR PRINT NAME Rusty Klein THE_Production Clerk</pre>	OTHER:		OTHER:	
Moved in and rigged up pulling unit. POOH and laid down rods and pump. Nippled dowellhead and nippled up BOP. POOH with tubing, seating nipple and mud anchor. THE CIBP and set at 1545'. Capped with 10 sacks of cement. Top of cement at 1400'. Control with 10# mud. POOH to 1257'. Spotted 25 sacks cement from 1257-889'. POOH to 600'. Spotted 25 sacks cement from 600-349'. POOH to 95'. Circulated cement to swith 10 sacks. POOH with tubing. Cut off wellhead and installed regulation abando marker. PLUGGED AND ABANDONED - FINAL REPORT. Plugging completed August 6, 1993. I hereby certify that the information above is price and complete to the best of my knowledge and belief. SIGNATURE TIME Production Clerk DATE SIGNATURE Rusty Klein TYPE OR FRINT NAME Rusty Klein THE PROVE for State Use) Model	stails, and give pertinent dates, including estimated date of starting any proposed	RULE 1103.	work) SEE RULE 1	
SIONATURE Kusty Klein TITLE Production Clerk DATE Sept. TYPE OR PRINT NAME Rusty Klein TELEPHONE NO. 5 (This space for State Use)	tubing, seating nipple and mud anchor. TIH w/4-1/2" sacks of cement. Top of cement at 1400'. Circulated ted 25 sacks cement from 1257-889'. POOH to -349'. POOH to 95'. Circulated cement to surface off wellhead and installed regulation abandonment	d and nippled up BOP. POOH with tubi d set at 1545'. Capped with 10 sacks th 10# mud. POOH to 1257'. Spotted Spotted 25 sacks cement from 600-349' sacks. POOH with tubing. Cut off w PLUGGED AND ABANDONED - FINAL REPOR	wellhead and CIBP and set hole with 10 600'. Spott with 10 sack marker. <u>PLU</u>	
TYPE OR PRINT NAME Rusty Klein Telephone NO. 5		$\downarrow \downarrow \downarrow \downarrow \downarrow \downarrow$	I hereby certify that the int	
	ТПLE БАТЕ БАТЕ БАТЕ БАТЕ БАТЕ БАТЕ БАТЕ ТЕLЕРНОНЕ НО. 505/748-14	Klain Klain		
	TITLE CIQ Ryp DATE 1/10/94			
APPROVED BY DATE TITLE DATE DATE	TITLE DATE	AFFROVAL, IF ANY:	APPROVED BY	