Appropriate Energy Minerals and Natural Resources Department strict Office		Revised 1-1-89	
DISTRICT I P.O. Box 1980, Hobbs, NM 88240 DISTRICT II P.O. Drawer DD, Artesia, NM 88210 OIL CONSERVATION DIVISION P.O. Box 2088 Santa Fe, New Mexico 87504-2088		WELL API NO. 30-015-22045	
		5. Indicate Type of Lease STATE X FEE	
DISTRICT III 1000 Rio Brazos Rd., Aziec, NM 87410			6. State Oil & Gas Lease No. L-4954
SUNDRY NOTIO	CES AND REPORTS ON WELL	.S	
(DO NOT USE THIS FORM FOR PRO DIFFERENT RESER (FORM C-	POSALS TO DRILL OR TO DEEPEN C VOIR. USE "APPLICATION FOR PERM 101) FOR SUCH PROPOSALS.)	R PLUG BACK TO A	7. Lease Name or Unit Agreement Name
I. Type of Well: OIL GAS WELL WELL	OTHER		Four Dinkus GV State
Name of Operator YATES PETROLEUM CORPORA	ATTON		8. Well No.
3. Address of Operator			9. Pool name or Wildcat
105 South 4th St., Arte	esia, NM 88210		Wildcat Glorieta Yeso
4. Well Location Unit Letter 0 Section 16	Township 185 Rang	ge <u>25E</u> F, RKB, RT, GR, etc.)	0 Feet From TheEast Line NMPM Eddy
	3551' (Panant or Other Data
	Appropriate Box to Indicate N		SEQUENT REPORT OF:
	ENTION TO:	301	
		REMEDIAL WORK	
	CHANGE PLANS	COMMENCE DRILLIN	
		CASING TEST AND C	
DTHER:		OTHER:	
work) SEE RULE 1103.			luding estimated date of starting any proposed
in and rigged up pull: Nippled up BOP. POOH TIH w/5-1/2" CIBP and CIBP at 2186'. Spotte Class C cement from 2	ing unit. Nippled down with tubing, perforated set at 2186'. Rigged d ed 52 bbls plug mud from 186-2086' (in 5-1/2" cas	pumping uniț d sub and mud down wireline. m 2186' to sur sing). POOH v	plugging operations. Moved POOF with rods and pump. ahchor: Rigged up wireline. TIH with tubing and tagged face. Mixed and pumped 10 sacks with tubing to 1320'. Mixed
to 443'. Mixed and pu POOH with tubing to 5 POOH with tubing. Nij marker, PLUGGED AND	umped 30 sacks Class C (-1070' (in 5- cement from 44 0 sacks Class d location. 5 T. Plugging (C cement from 50' to surface. Installed regulation abandonment completed 6-16-95. NOTE:
to 443'. Mixed and pr POOH with tubing to 59 POOH with tubing. Nij marker. <u>PLUGGED AND</u> Plugging witnessed by	umped 30 sacks Class C O'. Mixed and pumped 10 ppled down BOP. Cleane ABANDONED - FINAL REPOR Mike Stubblefield w/OC	-10/0' (in 5- cement from 44 0 sacks Class d location. 5 <u>T.</u> Plugging 6 D - Artesia.	1.72 Casing). Food with tubing 1.72 Casing). C cement from 50' to surface. Instaffed regulation abandonment completed 6-16-95. NOTE: Post TD-2 7-2l-95 $P \neq P$
to 443'. Mixed and pr POOH with tubing to 5 POOH with tubing. Ni marker. <u>PLUGGED AND</u> Plugging witnessed by I hereby certify that the information above is the	imped 30 sacks Class C D'. Mixed and pumped 10 ppled down BOP. Cleane ABANDONED - FINAL REPOR Mike Stubblefield w/OC	-10/0' (in 5- cement from 44 0 sacks Class d location. 5 <u>T.</u> Plugging 6 D - Artesia.	1.72 Casing). Food with tubing 1.72 Casing). C cement from 50' to surface. Instaffed regulation abandonment completed 6-16-95. NOTE: Post TD-2 7-2l-95 $P \neq P$
to 443'. Mixed and pr POOH with tubing to 59 POOH with tubing. Nij marker. <u>PLUGGED AND</u> Plugging witnessed by	umped 30 sacks Class C D'. Mixed and pumped 10 ppled down BOP. Cleane ABANDONED - FINAL REPOR Mike Stubblefield w/OC e and complete to the best of my knowledge and b Mixe TH	-10/0' (in 5- cement from 44 0 sacks Class d location. 5 <u>T.</u> Plugging 6 D - Artesia.	Clerk DATE June 27, 1995
to 443'. Mixed and pr POOH with tubing to 50 POOH with tubing. Nij marker. <u>PLUGGED AND</u> Plugging witnessed by Ihereby certify that the information above is the SKONATURE <u>UNIC</u>	umped 30 sacks Class C D'. Mixed and pumped 10 ppled down BOP. Cleane ABANDONED - FINAL REPOR Mike Stubblefield w/OC e and complete to the best of my knowledge and b Mixe TH	-10/0' (in 5- cement from 44 0 sacks Class d location. 5 <u>T.</u> Plugging 6 D - Artesia.	Clerk DATE June 27, 1995
to 443'. Mixed and pr POOH with tubing to 50 POOH with tubing. Nimmarker. PLUGGED AND Plugging witnessed by I hereby certify that the information above is the SKONATURE Must Market Rusty Klei	umped 30 sacks Class C D'. Mixed and pumped 10 ppled down BOP. Cleane ABANDONED - FINAL REPOR Mike Stubblefield w/OC e and complete to the best of my knowledge and b Mixe TH	-10/0' (in 5- cement from 44 0 sacks Class d location. T. Plugging (D - Artesia.	1.72 Casing). Food with tubing 1.72 Casing). C cement from 50' to surface. Instaffed regulation abandonment completed 6-16-95. NOTE: Post TD-2 7-2l-95 $P \neq P$

. . . .