

UNITED STATES  
DEPARTMENT OF THE INTERIOR  
BUREAU OF LAND MANAGEMENT

CONTINUING RECEIVING  
OFFICE FOR MASTER  
OF COPIES RECEIVED  
(Other instructions on re-  
verse side)

BLM Rowell District  
Modified Form No.  
NM060-3160-4

15F

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.  
Use "APPLICATION FOR PERMIT—" for such proposals.)

1. OIL WELL ☐ GAS WELL ☒ OTHER ☐ APR - 4 1991

2. NAME OF OPERATOR Hondo Drilling Company 3a. Area Code & Phone No. (915) 682-9401

3. ADDRESS OF OPERATOR P.O. Drawer 2516, Midland, TX 79702-2516

4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.\*  
See also space 17 below.)  
At surface  
1,980' FWL and 660' FSL, Unit N

14. PERMIT NO. 30-015-22784 15. ELEVATIONS (Show whether DF, RT, GR, etc.) 3,424.1' GR

5. LEASE DESIGNATION AND SERIAL NO.

NM 030752

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

7. UNIT AGREEMENT NAME

8. FARM OR LEASE NAME

Trigg Jennings Com.

9. WELL NO.

#1

10. FIELD AND POOL, OR WILDCAT

North Turkey Track, Morrow

11. SEC., T., R., M., OR BLK. AND  
SURVEY OR AREA

Sec. 28, T-18-S, R-29-E

12. COUNTY OR PARISH 13. STATE

Eddy

New Mexico

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF ☐ PULL OR ALTER CASING ☐  
FRACTURE TREAT ☐ MULTIPLE COMPLETION ☐  
SHOOT OR ACIDIZE ☐ ABANDON\* ☐  
REPAIR WELL ☐ CHANGE PLANE ☐  
(Other) ☐

SUBSEQUENT REPORT OF:

WATER SHUT-OFF ☐ REPAIRING WELL ☐  
FRACTURE TREATMENT ☐ ALTERING CASING ☐  
SHOOTING OR ACIDIZING ☒ ABANDONMENT\* ☐  
(Other) ☐

(Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

17. DESCRIBE PROMISED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)\*

2-4-91 Pulled 2 3/8" tubing and Guiberson Packer out of hole. Set cast iron Bridge Plug at 11,140'. Dumped 40' cement on top of Bridge Plug. Plug back depth 11,100'.

2-5-91 Perforate Morrow zone from 10,994' to 11,012', total 18', 2 shots per foot. Pressure test 2 3/8" tubing in hole. Set Guiberson Packer at 10,929'.

2-6-91 Acidize well with 2,000 gal. 7 1/2% acid. - Swab. Test well.

2-7,8,9-91 Swabbing well.

2-13-91 Frac well with 25,000 gal. Alcofoam with 20,900 lb. of propping agent.

18. I hereby certify that the foregoing is true and correct

SIGNED [Signature] TITLE President

DATE March 14, 1991

(This space for Federal or State office use)

APPROVED BY \_\_\_\_\_ TITLE \_\_\_\_\_  
CONDITIONS OF APPROVAL, IF ANY:

\*See Instructions on Reverse Side

