

Submit 3 Copies
to Appropriate
District Office

State of New Mexico
En: Minerals and Natural Resources Department

Form C-103
Revised 1-1-89

DISTRICT I
P.O. Box 1980, Hobbs, NM 88240

DISTRICT II
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION
P.O. Box 2088
Santa Fe, New Mexico 87504-2088

WELL API NO.
30-015-22872

5. Indicate Type of Lease
STATE ☒ FEE ☐

6. State Oil & Gas Lease No.
L-2918

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT"
(FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well:
OIL WELL ☒ GAS WELL ☐ OTHER ☐

2. Name of Operator ☒
Morexco, Inc.

3. Address of Operator
P. O. Box 481, Artesia, NM 88211-0481

4. Well Location
Unit Letter K : 1980 Feet From The South Line and 1980 Feet From The West Line
Section 35 Township 18S Range 27E NMPM Eddy County

10. Elevation (Show whether DF, RKB, RT, GR, etc.)

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:


PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☒
TEMPORARILY ABANDON ☐ CHANGE PLANS ☒
PULL OR ALTER CASING ☐
OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐
COMMENCE DRILLING OPNS. ☐ PLUG AND ABANDONMENT ☒
CASING TEST AND CEMENT JOB ☐
OTHER: ☐

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

Operator rigged up cable tool rig October 13 and laid down pump & rods. Discovered well only had 1550' of tubing in hole. Picked up additional tubing and tagged at 1700', shut down rig. Did further research and found 9 5/8 CIBP was set but not reported @ 1700' with cement on top. An additional set of perforations are in the Penrose Sand at 1500'. After conversation with Tim Gumm with the NMOCD it was agreed that the operator would set a plug @ 1400-1300' and tag after WOC time. Cir hole w/ mud and set and tag a plug @ 416-316'. Then set 10 sx surface plug, cut off wellhead, set dry hole marker, cut off anchors, and clean up location.

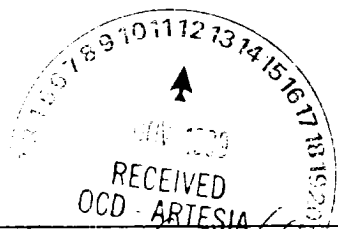

Post ID-2
11-19-99
P & A

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE [Signature] TITLE President DATE 11/10/99
TYPE OR PRINT NAME Donald G. Becker, Jr. TELEPHONE NO. 505-746-6521

(This space for State Use)

APPROVED BY [Signature] TITLE Field Rep. II DATE 11/14/99
CONDITIONS OF APPROVAL, IF ANY:

* Notify NMOCD to witness plugging operations