ANTA FE	ON .	NEW HEXICO	OIL CONSERVATION COMMISSION	Form C-103 Supersedes Old C-102 and C-103
ILE		. ITEM MENICO	A COMPERTY LION COWWISSION	Effective 1-1-65
AND OFFICE			RECEIVE	Sd' Indicate Type of Lease State XX Fee
PERATOR)	MAY 26 1983	5. State Oil & Gas Lease No. LG - 4216
100 NOT USE	SUNDR	RY NOTICES AND REP	ORTS ON WEELS	
WELL X	GAS WELL	OTHER-	ANTESIA, OFFICE	7. Unit Agreement Nume
Name of Operator InterNo	rth, Inc. V		8. Farm or Lease Home	
Address of Operat	or	at Midland TV 707	01	State LG - 4216
Location of Well	l lowers wes	st, Midland TX 797	01 ,	10. Field and Pool, or Wildon
UNIT LETTER	· F	1980	North 1980	Palmillo (Rone Spring)
THE West	LINE, SECTION	ON36 TOWNSHI	p 18S RANGE 28E NMPM	
		(/////	ow whether DF, RT, GR, etc.)	12. County
77777777777	Check		5, DF 3431.5, GL 3414.2 ndicate Nature of Notice, Report or Ot	Eddy ()
•		TENTION TO:		T REPORT OF:
ERFORM REMEDIAL W Emporarily abando Jll or alter casin	<u>, </u>	PLUG AND AU	COMMENCE DRILLING OPHS. CASING TEST AND CEMENT JQB	ALTERING CASING PLUG AND ASARDONMENT
OTHER			OTHER	
. Describe Propose	ed or Completed Op	perations (Clearly state all p	ertinent details, and give pertinent dates, including	estimated date of starting any proposed
5-7-83	MIRU	•		
5-8-83	Set CIBP @	10748' w/35' ceme er @ 6680'.	ent on top. Perf 6700' w/4 SPF.	90°.
5-10-83	Mix & pump	80 sx Cl "H" w/fl	uid loss add. ± 70 sx."H" Neat.	
E 11 02	Run GR/CCL	-	/4 CDE 00 ⁰ Souriers/75 av	
5-11-83	Squeeze wi		$w/4$ SPF, 90° . Squeeze $w/75$ sx	C1 "H" Neat.
5-11-83		th 4000#.	essure test csg. to 1000# for 30	e ^t
5-12 - 83	Drill out Perf Bone	th 4000#. cmt to 6680'. Pre		min. Held OK.
5-12-83 5-13-83	Drill out Perf Bone Set pkr @	th 4000#. cmt to 6680'. Pro Spring 2/2 SPF as	essure test csg. to 1000# for 30 follows: 6499-6512, 6531-40',	min. Held OK.
5-12-83 5-13-83 5-15-83	Drill out Perf Bone Set pkr @	th 4000#. cmt to 6680'. Pro Spring 2/2 SPF as 6486'. Swab. 3000 gals NEFE 159 ab.	essure test csg. to 1000# for 30 follows: 6499-6512, 6531-40',	min. Held OK.
5-12-83 5-13-83 5-15-83 5-16 thr	Drill out Perf Bone Set pkr @ Acidize w/ ru 20-83 Sw	th 4000#. cmt to 6680'. Pro Spring 2/2 SPF as 6486'. Swab. 3000 gals NEFE 159 ab. (OVER)	essure test csg. to 1000# for 30 follows: 6499-6512, 6531-40',	min. Held OK.
5-12-83 5-13-83 5-15-83 5-16 thr	Drill out Perf Bone Set pkr @ Acidize w/ ru 20-83 Sw	th 4000#. cmt to 6680'. Pro Spring 2/2 SPF as 6486'. Swab. 3000 gals NEFE 159 ab. (OVER)	follows: 6499-6512, 6531-40, acid. Swab.	min. Held OK.

5-21-83 Treat w/2000 gals BJ-Hughes Aquatrol 1.

5-22-83 Swab.