Submit 3 Capius to Appropriate District Office

State of New Mexico Energy, Minerals and Natural Resources Department

Form C-163 Revised 1-1-89

OIL CONSERVATION DIVISION DISTRICT I P. O. Box 2688 WHEAPT NO. P. O. Box 1900 Hobbs, NM 88246 Santa Fe, New Mexico 87564-2688 30-015-23278 Shadicate True or Lease P. O. Druwer DD, Artesia, NM 88218 STATE X FEE DISTRICT III State Of & Gas Loase No. 1000 Rio Brasss Rd, Assec, NM 87410 B-11594-3 SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOGALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A 7. Leave Name or Unit Ages DEFFERENT RESERVOOR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.) TRAVES 13 STATE L. Tree of West Off. WELL WILL. Others at of Op Harvey E. Yates Company P.O. Box 1933 , Roswell, NM 88202 1-505-623-6601 TRAVIS UPPER PENN Unit Letter 1,980 Feet From The NORTH Line and 1,980 Feet From The WEST Section Township 28E EDDY Range or DF, RKB, RT, GR, etc.) NMPM County 3604' GR Check Appropriate Box to Indicat Nature of Notice, Report, or Other Data NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF: PERFORM REMEDIAL WORK PLUG AND ABANDON REMEDIAL WORK ALTERING CASING CHANGE PLANS TEMPORARILY ABANDON COMMENCE DRILLING OPNS. PLUG AND ABANDONMENT **PULL OR ALTER CASING** CASING TEST AND CEMENT JOB OTHER: OTHER: 13. Describe Proposed of Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1983 ATTEMPT TO RUN TBG OPENED THROUGH PARTED CASING INTERVAL. IF SUCCESSFULL RUN TBG TO 9770 & SPOT 25 SK PLUG. (9776-9676'). TAG PULL TBG TO 8270' & SPOT 25 SK PLUG. (8278-8170'). PULL TEG TO 7042' & SPOT 25 SK PLUG (7342-7242'). ZS SK CEMENT Plug 6193 : 6093 . (T BS - 6143 .) PULL 5 1/2" CASING. AND LAY DOWN. (CASING PARTED @ 4601') GH w TBG TO 4651' AND SPOT 25 SK PLUG. (4651-4551'), TAG PULL TBG TO 3150' & SPOT 35 SK PLUG. (3150-3050'), TAG PULL TBG TO 755' & SPOT 35 SK PLUG. (755-655'). PULL TBG TO 400' & SPOT 25 SK PLUG. (400-300'). 10 SK SURFACE PLUG. INSTALL DRY HOLE MARKER OPTIONS IF CASING IS NOT PULLED: SQZ 30 SK PLUG @ 4601' (LEAVING 100' IN & OUTSIDE OF CSG). PERF @ 3150" & SQZ 30 SK PLUG, (LEAVING 100" IN & OUTSIDE OF CSG). PERF @ 755' & SQZ 30 SK PLUG, (LEAVING 100' IN & OUTSIDE OF CSG). BRINE GEL BETWEEN PLUGS. PERF @ 480' & SQZ 30 SK PLUG, (LEAVING 190' IN & OUTSIDE OF CSG). CALL OCD II 24 HOURS AHEAD 10 SK SURFACE PAUG. INSTALL DRY HOLE MARKER SIGNATURE PROD. MGR. / ENGINEER. 12/30/99 TYPE OR PRINT NAME/ RAY F. NOKES TELEPHONE NO. 1-505-623-6601 Field Rep * Brine gel between all coment Plugs

* Brine gel between all cement Plugs

* Notifie N M.O.C D to witness Plugging Operations.