

DEPARTMENT OF THE INTERIOR  
BUREAU OF LAND MANAGEMENT

N.M. Oil Cons. Division  
811 S. 1st Street  
Artesia, NM 88210-2834

FORM APPROVED

Budget Bureau No. 1004-0135

Expires: March 31, 1993

Well Name and Serial No.

SUNDRY NOTICES AND REPORTS ON WELLS

LC-028772-B

Do not use this form for proposals to drill or to deepen or reentry to a different reservoir.

Use "APPLICATION FOR PERMIT--" for such proposals

SUBMIT ORIGINAL + 6 COPIES

1. Type of Well ☒ Oil Well ☐ Gas Well ☐ Other

2. Name of Operator

Harvey E. Yates Company

3. Address and Telephone No.

P.O. Box 1933, Roswell, NM 88202

4. Location of Well (Footage, Sec., T., R., M., or Survey Description)

O, 660' FSL & 1650' FEL

Sec 12, T18S, R28E

6. If Indian, Allottee or Tribe Name

7. If Unit or CA, Agreement Designation

8. Well Name and No.

North Travis 12 Deep #1

9. API Well No.

30-015-23306

10. Field and Pool, or Exploratory Area

Travis Upper Penn

11. County or Parish, State

Eddy County, NM

12 CHECK APPROPRIATE BOX (s) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

TYPE OF SUBMISSION

☐ Notice of Intent

☐ Subsequent Report

☒ Final Abandonment Notice

TYPE OF ACTION

☐ Abandonment

☐ Recompletion

☐ Plugging Back

☐ Casing Repair

☐ Altering Casing

☒ Other Plug & Abandon

☐ Change of Plans

☐ New Construction

☐ Non-Routine Fracturing

☐ Water Shut-Off

☐ Conversion to Injection

☐ Dispose Water

(Note: Report results of multiple completion on Well Completion or Recompletion Report and log form)

13. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If wells directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)\*

4/25/01 Casing parted @ 4,265'.  
5/2/01 Go in hole with chemical cutter to 9,795' & cut off 2 3/8" tbg. POOH w/131 jts tbg.  
5/3/01 Spot 25 sxs cement tag @ 9,593'. Circulate 10# mud. Spot 25 sxs cement @ 6,800-6,700'.  
Spot 40 sxs cement @ 4,341'.  
5/4/01 Reset 40 sxs cement @ 4,341', tag @ 4,276'. Reset 40 sxs cement @ 4,276'.  
5/7/01 Spot 35 sxs cement @ 2,948'. Spot 50 sxs cement @ 421'. Spot 20 sxs @ 60' to surface.  
Rig down. Cut off wellhead. Install dry hole marker. P&A complete.

\*\*Note: Verbal approval to change plugging procedure was received from Armando Lopez with the Roswell BLM, plugging procedure was witnessed by Gene Hunt, Carlsbad BLM.

Approved to plugging of the well bore.  
Under bond is retained until  
surface restoration is completed.

14. I hereby certify that the foregoing is true and correct

Signed David R. Glass Title Production Analyst Date 16-May-01

(This space for Federal or State office use)

(ORIG. SGD.) DAVID R. GLASS  
MAY 24 2001

Approved by DAVID R. GLASS Title Production Analyst Date 16-May-01  
Conditions of approval, if any.

DAVID R. GLASS  
PETROLEUM ENGINEER