

Submit 3 Copies
to Appropriate
District Office

State of New Mexico
Energy Minerals and Natural Resources Department

Form C-103
Revised 1-1-89

DISTRICT I
P.O. Box 1980, Hobbs, NM 88240

DISTRICT II
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION
P.O. Box 2088
Santa Fe, New Mexico 87504-2088

WELL API NO. 30-015-23511
5. Indicate Type of Lease STATE <input type="checkbox"/> FEE <input checked="" type="checkbox"/>
6. State Oil & Gas Lease No.
7. Lease Name or Unit Agreement Name Stromberg OM
8. Well No. 1
9. Pool name or Wildcat Penasco Draw San Andres Yeso
10. Elevation (Show whether DF, RKB, RT, GR, etc.) 3424' GR

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT"
(FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well:
OIL WELL ☒ GAS WELL ☐ OTHER PLUG & ABANDON

2. Name of Operator
YATES PETROLEUM CORPORATION

3. Address of Operator
105 South 4th St., Artesia, NM 88210

4. Well Location
Unit Letter N : 330 Feet From The South Line and 2310 Feet From The West Line
Section 31 Township 18S Range 26E NMPM Eddy County

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data
NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐
PULL OR ALTER CASING ☐
OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐
COMMENCE DRILLING OPNS. ☐ PLUG AND ABANDONMENT ☒
CASING TEST AND CEMENT JOB ☐
OTHER: ☐

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

6-9-95 - Notified Tim Bumm w/OCD - Artesia of commencing plugging operations. Moved in and rigged up pulling unit. POOH with rods and pump. Nippled up BOP. TOOH with tubing, seating nipple, perforate sub and mud anchor. Rigged up wireline. TIH and set 4-1/2" CIBP at 2450'. Rigged down wireline. TIH with tubing and tag CIBP at 2450'. Spot 40 barrels of plug mud from 2450' to surface. Mix and pump 10 sacks Class C cement from 2450-2305' (in 4-1/2" casing). POOH with tubing to 1100'. Mix and pump 25 sacks Class C 2% CaCl2 from 1100-750' (in 4-1/2" casing). POOH with tubing to 735'. Mix and pump 2-3/8" tubing and tag top of cement at 735'. POOH with tubing to 435'. Mix and pump 33 sacks Class C cement from 435' to surface. POOH with tubing. Nippled down BOP. Clean location. Install regulation abandonment marker. PLUGGED AND ABANDONED - FINAL REPORT. Plugging completed 6-8-95. NOTE: Plugging witnessed by Mike Stubblefield w/OCD - Artesia.

OIL CON. DIV.
DIST. 2

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Rusty Klein TITLE Production Clerk DATE 6-9-95
TYPE OR PRINT NAME Rusty Klein TELEPHONE NO. 505/748-1471

(This space for State Use)

APPROVED BY Don Livingston TITLE Field Rep DATE 7-14-95

CONDITIONS OF APPROVAL, IF ANY:

Post ID-2
9-7-95
P4H