

OIL CONSERVATION DIVISION

P. O. BOX 2088

SANTA FE, NEW MEXICO 87501

NOV 18 1982

C. C. D.

ARTESIA, OFFICE

Form C-103
Revised 10-1-78

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	☒
FILE	☒
U.S.O.R.	
LAND OFFICE	
OPERATOR	☒

5a. Indicate Type of Lease

State ☒For ☐

5. State Oil & Gas Lease No.

LG - 4036

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT -" (FORM C-101) FOR SUCH PROPOSALS.)

1. OIL WELL ☒ GAS WELL ☐ OTHER ☐	7. Unit Agreement Name
2. Name of Operator Anadarko Production Company ☒	8. Farm or Lease Name Suntex
3. Address of Operator P. O. Drawer 130, Artesia, New Mexico	9. Well No. 1
4. Location of Well UNIT LETTER <u>0</u> <u>660</u> FEET FROM THE <u>South</u> LINE AND <u>1980</u> FEET FROM THE <u>East</u> LINE, SECTION <u>36</u> TOWNSHIP <u>18S</u> RANGE <u>28E</u> N.M.P.M.	10. Field and Pool, or Wildcat Und. Palmillo Bone Springs
15. Elevation (Show whether DF, RT, GR, etc.) 3392.7 GL	12. County Eddy

16.

Check Appropriate Box To Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

SUBSEQUENT REPORT OF:

PERFORM REMEDIAL WORK ☐

TEMPORARILY ABANDON ☐

PULL OR ALTER CASING ☐

PLUG AND ABANDON ☒

CHANGE PLANS ☐

REMEDIAL WORK ☐

COMMENCE DRILLING OPNS. ☐

CASING TEST AND CEMENT JOBS ☐

OTHER ☐

ALTERING CASING ☐

PLUG AND ABANDONMENT ☐

OTHER ☐

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

1. MIRUPU
2. Pump brine gel mixed at 25# of gel/bbl of 10# brine from TD to casing cut off point.
3. Cut, pull, and lay down 5-1/2" csg. (approx. 4380').
- *4. Spot 38 sx of class "H" cmt. plug #1 4320'-4575' = 251' within 75' of perfs and across 5-1/2" csg. stub. TAG PLUG
5. Load hole w/brine gel mixed at 25# of gel/bbl of 10# brine.
- *6. Spot 33 sx of class "H" cmt. plug #2 3192'-3302' = 110' across 8-5/8" csg. shoe. TAG PLUG
7. Spot 33 sx of class "H" cmt. plug #3 330'-440' = 110' across 13-3/8" csg. shoe.
8. Pump 10 sx at surface.
9. Erect P&A marker, cut tie downs, backfill pits, clean location.

*Tag plugs only if hole will not hold fluid.

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED JOHN H. BEARDTITLE EngineerDATE 11/16/82

Original Signed By

Leslie A. Clements

APPROVED BY Supervisor District II

TITLE

DATE


NOV 23 1982

CONDITIONS OF APPROVAL, IF ANY:

* TAG PLUGS NOTIFY COMMISSION 24hrs Prior to setting 1st PLUG

NOV 18 1982

Subject	SunTex #1 P&A	Page No.	O. C. D.
File	(Present Status)	By	ARTESIA OFFICE Date

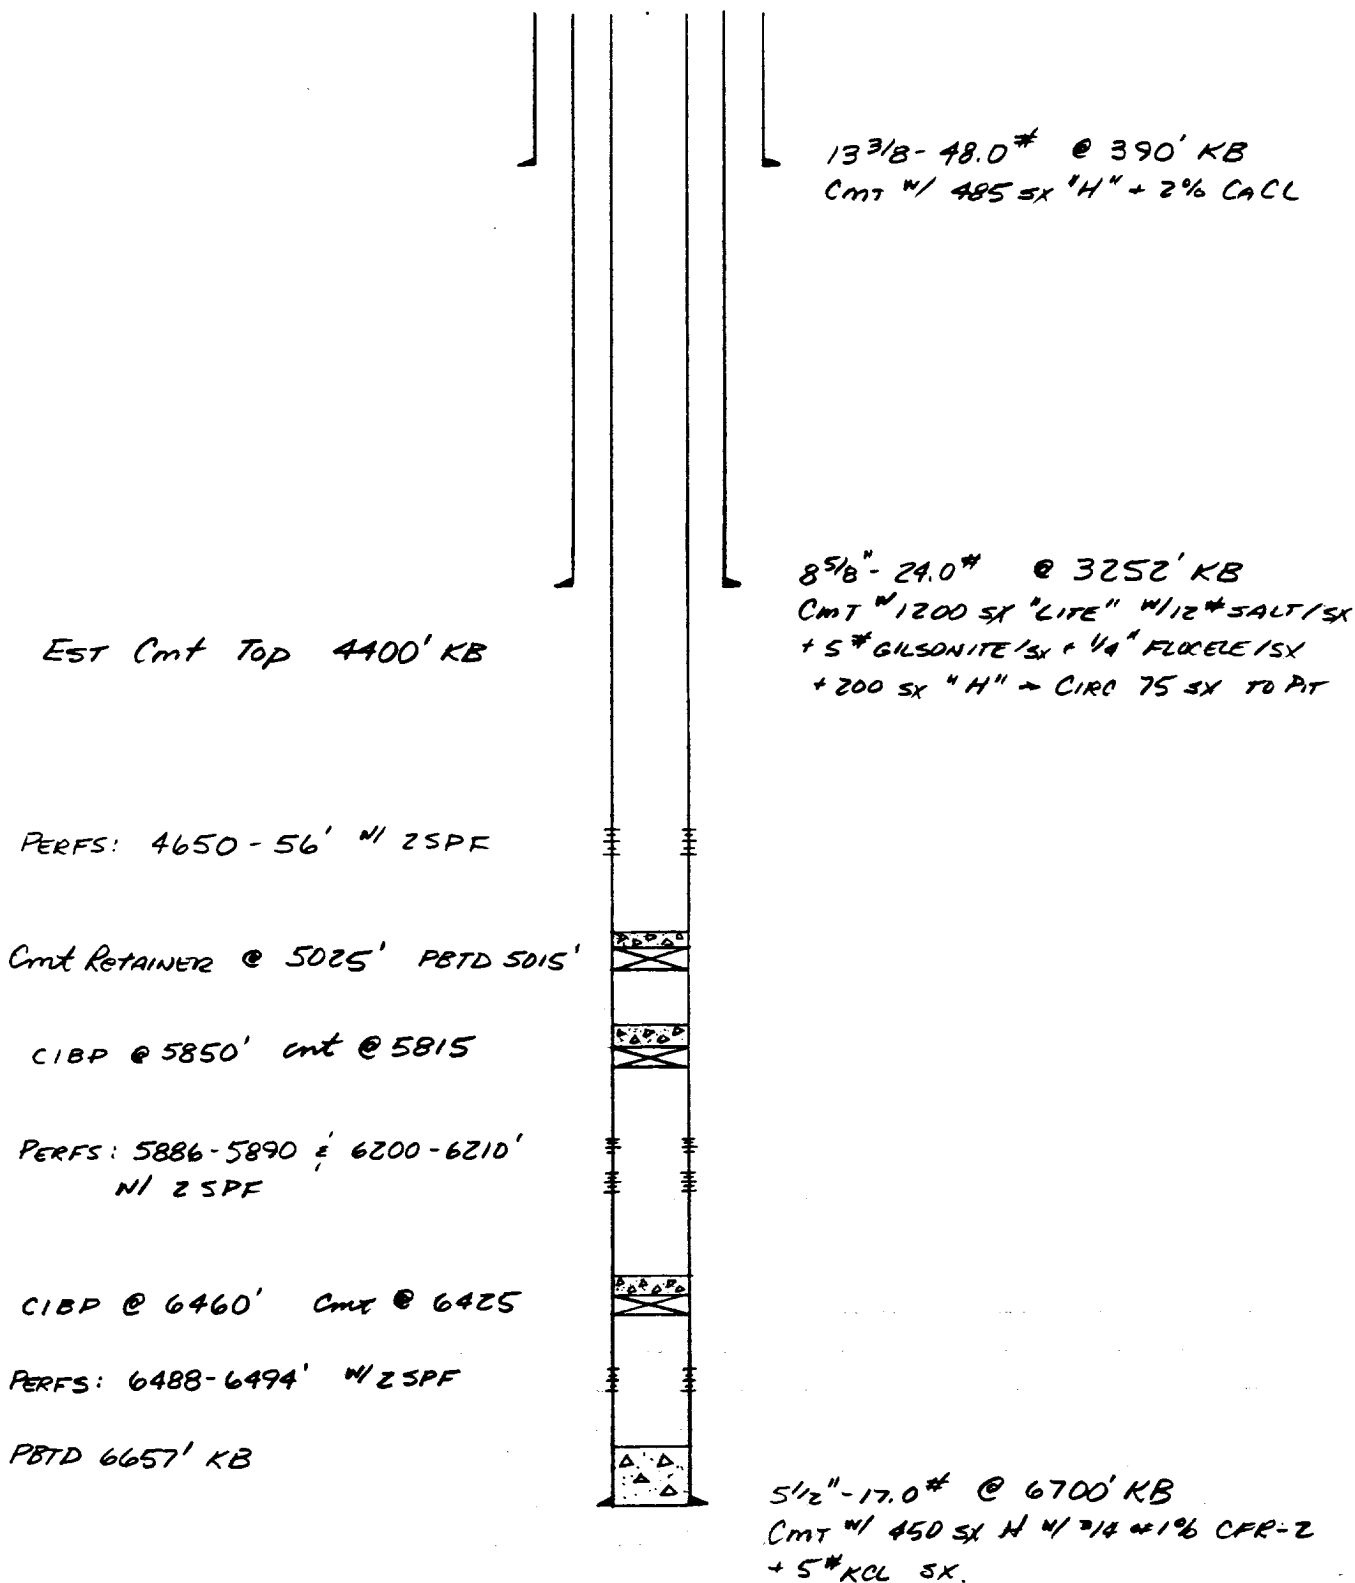

NOV 18 1982

Subject	SUNTEX #1 P&A	Page No.	O. C. D.
File	(Plugged Status)	By	JHB
		Date	ARTESIA, OFFICE

