

State BW Com. #1
Add pay and stimulate
Eddy Cnty, NM
9/27/2001
Page 5

- 36 . Flow and swab well in. Discuss with OKC before going on to next step.
- 37 . MIRU BJ services and tree saver. Pump 6,000 gals 20% HCl acid containing additives as per BJ prog. Drop a total of 100 ball sealers spaced evenly throughout the job. RDMO BJ Services and tree saver.
- 38 . Swab acid job back until well begin to flow or until oil cut is established.
- 39 . If well is flowing the go to step #40. If well needs to be rod-up then call OKC engineering for supplemental procedure.
- 40 . Put well to sales, record and report tubing and line pressures each and every day.