

50-015-24/37

9-18-84

CN/LD

255-9247

DL/MSFL

UNITED STATES  
DEPARTMENT OF THE INTERIOR  
BUREAU OF LAND MANAGEMENT

SUBMIT IN TRIP  
(Other instructions  
verse side)

ATE  
a re

Form approved.  
Budget Bureau No. 1004-0135  
Expires August 31, 1985

5. LEASE DESIGNATION AND SERIAL NO.  
NM 18292

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

7. UNIT AGREEMENT NAME

8. FARM OR LEASE NAME  
Rio Pecos RS Federal

9. WELL NO.  
1

10. FIELD AND POOL, OR WILDCAT  
Undes. Morrow

11. SEC., T., R., M., OR BLK. AND  
SURVEY OR AREA

Unit B, Sec. 21-T18S-R27E

12. COUNTY OR PARISH 13. STATE  
Eddy NM

1. CIL ☐ GAS ☐ OTHER ☒ P&A  
WELL ☐ WELL ☐

2. NAME OF OPERATOR

Yates Petroleum Corporation

3. ADDRESS OF OPERATOR

207 South 4th St., Artesia, NM 88210

1. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.  
See also space 17 below.)  
At surface

760 FNL & 1980 FEL, Sec. 21-T18S-R27E

14. PERMIT NO.

15. ELEVATIONS (Show whether DF, RT, GR, etc.)

3369.3' GR

Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO

TEST WATER SHUT-OFF

FRACTURE TREAT

SHOOT OR ACIDIZE

REPAIR WELL

(Other)

PULL OR ALTER CASING

MULTIPLE COMPLETE

ABANDON\*

CHANGE PLANS

SUBSEQUENT REPORT OF:

WATER SHUT-OFF

FRACTURE TREATMENT

SHOOTING OR ACIDIZING

(Other)

REPAIRING WELL

ALTERING CASING

ABANDONMENT\*

(NOTE: Report results of multiple completion on Well  
Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)\*

Plugged and abandoned well as follows:

Spotted 2 - 10 sack cement plugs from 9450-8500'. Set CIBP at 8180' w/35' of cement on top. Cut casing at 5364'. Set 50 sack plug. Tagged plug at 5205'. Spotted 45 sack plug at 3255'. Tagged plug at 3135'. Spotted 30 sack plug at 402'. Set 15 sack surface plug. Set dry hole marker, clean location.

Plugging completed 9-8-84

18. I hereby certify that the foregoing is true and correct

SIGNED [Signature]

TITLE Production Supervisor

DATE 9-12-84

(This space for Federal or State office use)


APPROVED BY [Signature]

TITLE [Signature]

DATE 6-19-84

CONDITIONS OF APPROVAL, IF ANY:

\*See Instructions on Reverse Side

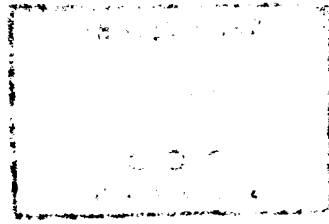

8 5/8 shoe @ 3202 ] 100' plug 50' in/out @  
3252 - 3152 & tag.

13 3/8 shoe @ 342' ] 100' plug  
~~30~~ 392 - 292'

run 1jt & circ.

Rio Pecos RF #1

TD: 9850, PB: 9766

8 5/8 @ 3202 circ

13 3/8 @ 342 circ

4 1/2 TBC @ 5700

Perfs: Mor - 9471-74 ] CIBP @ 9450 w/ 35' cmt.  
9031-39

Stn - 8586-8595 ] CIBP @ 8500' w/ 35' cmt.  
9031-39

Wolfcamp - 7214-69 ] CIBP @ 7180 w/ 35' cmt.

4 1/2 w/off 5700 ] 100' plug 50' in/out 5150-5650 & tag