

RIH w/Lok-set pkr & on/off tool @ 9058'. In 2½ hrs swbbd 40 BFW & small blow gas. POH w/pkr. Dumped 77' cmt on top of BP @ 9638'. TOC @ 9598'. RIH W/CIBP, set @ 9100'. Perf'd Cisco w/2 JSPF @ 9041, 42, 43, 44, 45, 46, 47, 48, 49, 50, 9051' = 22 - .38 holes. RIH w/Lok set pkr w/on/off tool, set pkr @ 8957'. In 10 hrs swbbd 0 BNO & 234 BW. no show of oil or gas. on 3-11-85 relsd & POH. Dumped 40' cmt on top of CIBP @ 9100'. Set CIBP @ 8955'. Dumped 40' cmt on top @ 8915'. Perf'd Bone Sprgs w/2 JSPF @ 6884 - 94' = 22 holes. RIH w/pkr, set @ 6794'. In 2 hrs swbbd Bone Springs perf, rec 0 BNO, 40 BLW. SITP 120#. Acidized Bone Sprgs perfs 6884-94' w/2000 gals 15% NEFE acid. In 7 hrs swbbd perfs & rec 0 BNO & 7 BLW. In 10 hrs swbbd 3 BW, 5 BNO. Acid fraced perfs 6884-94' w/4000 gals gelled 15% HCL acid, followed by 3000 gals gelled 2% KCL wtr. On 3-20-85 swbbd 10 hrs, rec 26 BFW, 7 BO. On 3-22-85 swbbd 9½ hrs, rec 6 BW & 1 BO, small show gas. Removed BOP & installed wellhead 3-25-85. Shut-in. Rigged up on 7-15-85. Installed BOP & RIH w/cmt retr. Set cmt retr. @ 6843'. Cmt squeeze BONE Spgs perfs 6884-6894' w/200 sx C1 H neat cmt. MP 180#. RIH w/bit & drld cmt & cmt retr to 6907'. Press tested csg to 1000#. OK Drld out CIBP @ 8970' & RIH w/bit to TOC @ 9089'. Set CIBP @ 9030'. Press tested cst to 500#. OK Perf'd Upper Cisco w/2 JSPF @ 8945, 46, 47, 54, 55, 56, 63, 64, 67, 68, 69, 73, 74, 77, 78, 79, 83, 84, 85, 92, 93, 94, 96, 98, 9000, 01, 9002 = 54 holes. RIH w/pkr & spot 2 bbls 15% NEFE acid 9017 - 8933', PUH w/pkr to 8885' & rev 2 bbls, set pkr & press up on fm to 1000#. In 2½ hrs swbbd Cisco perfs 8945 - 9002', rec OBO, 66 BW. on 7-22-85 swbbd perfs 8945 - 9002', rec OBO, 35 BFW. POH w/pkr.