

STATE OF NEW MEXICO
ENERGY AND MINERALS DEPARTMENT

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	☒
FILE	☒
U.S.G.S.	
LAND OFFICE	☒
OPERATOR	☒

OIL CONSERVATION DIVISION

2088

Form C-103
Revised 10-1-79

RECEIVED BY NEW MEXICO 87501

OCT 29 1985

O. C. D.

5a. Indicate Type of Lease	
State ☒	Fee ☐
5. State Oil & Gas Lease No.	

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG WELLS TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. Name of Operator Harvey E. Yates Company		7. Unit Agreement Name	
2. Address of Operator P. O. Box 1933, Roswell, New Mexico 88201		8. Farm or Lease Name Power Deep 32 State	
3. Location of Well UNIT LETTER <u>L</u> <u>2030</u> FEET FROM THE <u>South</u> LINE AND <u>660</u> FEET FROM THE <u>West</u> LINE, SECTION <u>32</u> TOWNSHIP <u>17S</u> RANGE <u>31E</u> N.M.P.M.		9. Well No. 1	
15. Elevation (Show whether DF, RT, GR, etc.) 3703' GL		10. Field and Pool, or Wildcat Und. Bone Springs	
12. County Eddy			

Check Appropriate Box To Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:		SUBSEQUENT REPORT OF:	
PERFORM REMEDIAL WORK ☐	PLUG AND ABANDON ☐	REMEDIAL WORK ☐	ALTERING CASING ☐
TEMPORARILY ABANDON ☐	CHANGE PLANS ☐	COMMENCE DRILLING OPS. ☐	PLUG AND ABANDONMENT ☒
PULL OR ALTER CASING ☐	OTHER ☐	CASING TEST AND CEMENT JOBS ☐	OTHER ☐

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

9/24/85 Set CIBP @ 7700' w/35' cmt on top.
9/26/85 Cut off csg @ 7500'. Pump 43 sx plug (Class C w/2% CaCl) in & out of cut off.
9/28/85 Pump 35 sxs plug from 5135' to 5028' (107' plug). Pump 70 sxs plug from 4400' to 4200'. Pump 35 sx plug from 3673' to 3553'.
9/29/85 GIH w/8 5/8" CIBP & set @ 3610' to 3612'. Pump 9 sx plug from 3610' to 3575'.
10/1/85 Cut off 13 3/8" & 8 5/8" spools to NU Well Head.
10/2/85 Perf 3510' to 3518' (2 SPF-17 holes). Spot 200 gals 7 1/2% SRA.
10/3/85 Acidize w/2000 gal 7 1/2% SRA & 34 ball sealers.
10/15/85 MI & RU PU to Plug Well.
10/16/85 Spot 150' plug across perfs 3510' to 3518'.
10/17/85 Set CIBP @ 3454' & spot 35' cmt on top. Spot 100' cmt plug @ 660'. Set 50' Surface plug. Install Dry hole marker. Well P & A 4:00 p.m. 10/16/85.

Set 70-2
11-8-85
P & A

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

Signed Louise Collins TITLE Production Clerk DATE 10/28/85
Approved by Danell Moore TITLE Geologist DATE 12/18/85
CONDITIONS OF APPROVAL, IF ANY: