	ED BT BU	RTMEN (OF T	ANAGEMENT	·		10907-A	TRIBE NAME
JAN 2.		DICES AND	deepen or plug ba IIT-" for such pro	N WELLS ck to a different reservoir. possis.)			
						7. UNIT AGREEMENT NAME	
Santa Fe Exploration Company (505/623-2733)						8. FARM OR LEASE NAME Mountain States Federal	
Santa F		on Company 🗸 🛛	(505/623-27	33)	9. WBLL		es_Federal
P. O. Box 1136, Roswell, NM 88202-1136 4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.*						#1 AND POOL, OR W	ILDCAT
See also spac At surface	re 17 below.)				11. Bac.	ey Track . T., B., M., OR BLK	SR_Q,Gbg,S
990' FE	EL & 330' FS	jL				35, T18S	, R29E
4. PERMIT NO.		15. BLEVATIONS (Show whether DF, BT, GE, etc.)				TY OR PARISE 1	
			3423' GR	· · · · · · · · · · · · · · · · · · ·			<u>NM</u>
			To Indicate No	ature of Notice, Report, a	r Other Dat ibquint befor		
		INTENTION TO : PULL OR ALTER CA		WATER SHUT-OFF		REPAIRING WEL	.L
TEST WATER		MULTIPLE COMPLE		FRACTURE TREATMENT		ALTERING CASI	1
SHOOT OR A		ABANDON*		SHOOTING OR ACIDIZING		ABANDONMENT*	
REPAIR WEL	.r. []	CHANGE PLANS		(Other) <u>Spud & S</u> (Nors: Report res	ults of multipl	e completion on	∐
(Other)	PUSED OR COMPLETI	ED OPERATIONS (Clearly	state all pertinent	Completion or Reco details, and give pertinent da	tes including	estimated date of	f starting any
proposed nent to thi	work. If well is d	lirectionally drilled, give	e subsurface locati	ons and measured and true ve		VI EII MAIECID A	
		Dat Hole Ser	vice drill	18" hole & set 23	' of 14"	cond pipe	•
2/23/84	RU Frank's Ready-mix		vice, di ili				
	Ready-mix						
2/24/84	Ready-mix	to surf. Drilling Rig #					
2/24/84 2/25/84	Ready-mix MI LaRue D SD for Chr RU LaRue D to 301'. ‡# celopha Cmt @ 45'	to surf. Drilling Rig # ristmas. Drilling, SPUD Ran 8 jts 8-5 ane flakes per	1. SD over WELL @ 9 A /8" 24# csg sx & 1% Ko " w/20 sx c	Christmas. M with 12¼" bit. , set & cmtd w/200 lite @ 301'. Did mt, did not bring	Lost circ sx Cl "(not circ	c @ 45'. D C" w/2% Ca . PD @ 8:	rld Cl, 00 PM.
2/24/84 2/25/84 2/26/84	Ready-mix MI LaRue D SD for Chr RU LaRue D to 301'. ‡# celopha Cmt @ 45'	to surf. Drilling Rig # ristmas. Drilling, SPUD Ran 8 jts 8-5 ane flakes per from surf. 2	1. SD over WELL @ 9 A /8" 24# csg sx & 1% Ko " w/20 sx c	Christmas. M with 12¼" bit. , set & cmtd w/200 lite @ 301'. Did mt, did not bring	Lost circ sx Cl "(not circ	c @ 45'. D C" w/2% Ca . PD @ 8:	rld Cl, 00 PM.
2/24/84 2/25/84 2/26/84	Ready-mix MI LaRue D SD for Chr RU LaRue D to 301'. ## celopha Cmt @ 45' 5 yds of r	to surf. Drilling Rig # ristmas. Drilling, SPUD Ran 8 jts 8-5 ane flakes per from surf. 2	1. SD over WELL @ 9 A /8" 24# csg sx & 1% Ko " w/20 sx c	Christmas. M with 12¼" bit. , set & cmtd w/200 lite @ 301'. Did mt, did not bring	Lost circ sx Cl "(not circ	c @ 45'. D C" w/2% Ca . PD @ 8:	rld Cl, 00 PM.
2/24/84 2/25/84 2/26/84	Ready-mix MI LaRue D SD for Chr RU LaRue D to 301'. ## celopha Cmt @ 45' 5 yds of r	to surf. Drilling Rig # ristmas. Drilling, SPUD Ran 8 jts 8-5 ane flakes per from surf. 2	1. SD over WELL @ 9 A /8" 24# csg sx & 1% Ko " w/20 sx c	Christmas. M with 12¼" bit. , set & cmtd w/200 lite @ 301'. Did mt, did not bring	Lost circ sx Cl "(not circ	c @ 45'. D C" w/2% Ca . PD @ 8:	rld Cl, 00 PM.
2/24/84 2/25/84 2/26/84	Ready-mix MI LaRue D SD for Chr RU LaRue D to 301'. ## celopha Cmt @ 45' 5 yds of r	to surf. Drilling Rig # ristmas. Drilling, SPUD Ran 8 jts 8-5 ane flakes per from surf. 2	1. SD over WELL @ 9 A /8" 24# csg sx & 1% Ko " w/20 sx c	Christmas. M with 12¼" bit. , set & cmtd w/200 lite @ 301'. Did mt, did not bring	Lost circ sx Cl "(not circ	c @ 45'. D C" w/2% Ca . PD @ 8:	rld Cl, 00 PM.
2/24/84 2/25/84 2/26/84	Ready-mix MI LaRue D SD for Chr RU LaRue D to 301'. ## celopha Cmt @ 45' 5 yds of r	to surf. Drilling Rig # ristmas. Drilling, SPUD Ran 8 jts 8-5 ane flakes per from surf. 2	1. SD over WELL @ 9 A /8" 24# csg sx & 1% Ko " w/20 sx c	Christmas. M with 12¼" bit. , set & cmtd w/200 lite @ 301'. Did mt, did not bring	Lost circ sx Cl "(not circ	c @ 45'. D C" w/2% Ca . PD @ 8:	rld Cl, 00 PM.
2/24/84 2/25/84 2/26/84	Ready-mix MI LaRue D SD for Chr RU LaRue D to 301'. ## celopha Cmt @ 45' 5 yds of r	to surf. Drilling Rig # ristmas. Drilling, SPUD Ran 8 jts 8-5 ane flakes per from surf. 2	1. SD over WELL @ 9 A /8" 24# csg sx & 1% Ko " w/20 sx c	Christmas. M with 12¼" bit. , set & cmtd w/200 lite @ 301'. Did mt, did not bring	Lost circ sx Cl "(not circ	c @ 45'. D C" w/2% Ca . PD @ 8:	rld Cl, 00 PM.
2/24/84 2/25/84 2/26/84	Ready-mix MI LaRue D SD for Chr RU LaRue D to 301'. ## celopha Cmt @ 45' 5 yds of r	to surf. Drilling Rig # ristmas. Drilling, SPUD Ran 8 jts 8-5 ane flakes per from surf. 2	1. SD over WELL @ 9 A /8" 24# csg sx & 1% Ko " w/20 sx c	Christmas. M with 12¼" bit. , set & cmtd w/200 lite @ 301'. Did mt, did not bring	Lost circ sx Cl "(not circ	c @ 45'. D C" w/2% Ca . PD @ 8:	rld Cl, 00 PM.
2/24/84 2/25/84 2/26/84 2/27/84	Ready-mix MI LaRue D SD for Chr RU LaRue D to 301'. ## celopha Cmt @ 45' 5 yds of r WOC.	to surf. Drilling Rig # ristmas. Drilling, SPUD Ran 8 jts 8-5 ane flakes per from surf. 2	<pre>1. SD over WELL @ 9 A /8" 24# csg sx & 1% Ko " w/20 sx c ought cmt t </pre>	Christmas. M with 12¼" bit. , set & cmtd w/200 lite @ 301'. Did mt, did not bring to surf.	Lost circ sx Cl "(not circ to surf.	c @ 45'. D C" w/2% Ca PD @ 8: Pumped i	rld Cl, 00 PM. n
2/24/84 2/25/84 2/26/84 2/27/84	Ready-mix MI LaRue D SD for Chr RU LaRue D to 301'. ## celopha Cmt @ 45' 5 yds of r WOC.	to surf. Drilling Rig # ristmas. Drilling, SPUD Ran 8 jts 8-5 ane flakes per from surf. 2 ready-mix & bro	<pre>1. SD over WELL @ 9 A /8" 24# csg sx & 1% Ko " w/20 sx c ought cmt t </pre>	Christmas. M with 12¼" bit. , set & cmtd w/200 lite @ 301'. Did mt, did not bring	Lost circ sx Cl "(not circ to surf.	c @ 45'. D C" w/2% Ca . PD @ 8:	rld Cl, 00 PM. n
2/24/84 2/25/84 2/26/84 2/27/84 8. 1 hereby car SIGNED	Ready-mix MI LaRue D SD for Chr RU LaRue D to 301'. ## celopha Cmt @ 45' 5 yds of r WOC.	to surf. Drilling Rig # ristmas. Drilling, SPUD Ran 8 jts 8-5 ane flakes per from surf. 2 ready-mix & bro offer is true and correct	<pre>1. SD over WELL @ 9 A /8" 24# csg sx & 1% Ko " w/20 sx c ought cmt t </pre>	Christmas. M with 12¼" bit. , set & cmtd w/200 lite @ 301'. Did mt, did not bring to surf.	Lost circ sx Cl "(not circ to surf.	c @ 45'. D C" w/2% Ca PD @ 8: Pumped i	rld Cl, 00 PM. n
2/24/84 2/25/84 2/26/84 2/26/84 2/27/84 8. 1 hereby car SIGNED (This space	Ready-mix MI LaRue D SD for Chr RU LaRue D to 301'. ## celopha Cmt @ 45' 5 yds of r WOC.	to surf. Drilling Rig # ristmas. Drilling, SPUD Ran 8 jts 8-5, ane flakes per from surf. 2 ready-mix & bro come is true and correct come is true and correct come is true and correct	<pre>1. SD over WELL @ 9 A /8" 24# csg sx & 1% Ko " w/20 sx c ought cmt t </pre>	Christmas. M with 12¼" bit. , set & cmtd w/200 lite @ 301'. Did mt, did not bring to surf.	Lost circ sx Cl "(not circ to surf.	c @ 45'. D C" w/2% Ca PD @ 8: Pumped i	rld Cl, 00 PM. n
2/27/84 8. I bereby car SIGNED (This space	Ready-mix MI LaRue D SD for Chr RU LaRue D to 301'. ## celopha Cmt @ 45' 5 yds of r WOC.	to surf. Drilling Rig # ristmas. Drilling, SPUD Ran 8 jts 8-5, ane flakes per from surf. 2 ready-mix & bro surf. & bro ready-mix & bro	<pre>1. SD over WELL @ 9 A /8" 24# csg sx & 1% Ko " w/20 sx c ought cmt t t t TITLE _Ste</pre>	Christmas. M with 12¼" bit. , set & cmtd w/200 lite @ 301'. Did mt, did not bring to surf.	Lost circ sx Cl "(not circ to surf.	c @ 45'. D C" w/2% Ca PD @ 8: Pumped i Pumped i	rld Cl, 00 PM. n



.