

Submit 3 Copies
to Appropriate
District Office

State of New Mexico
Energy, Minerals and Natural Resources Department

Form C-103
Revised 1-1-89

DISTRICT I
P.O. Box 1980, Hobbs, NM 88240

DISTRICT II
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION
P.O. Box 2088
Santa Fe, New Mexico 87504-2088

JUN 22 1992

O. C. D.

WELL API NO. 30-015-26896
5. Indicate Type of Lease STATE <input checked="" type="checkbox"/> FEE <input type="checkbox"/>
6. State Oil & Gas Lease No. 703

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT"
(FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well: OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER <input type="checkbox"/>	7. Lease Name or Unit Agreement Name Levers A State
2. Name of Operator Plains Petroleum Operating Company	8. Well No. 3
3. Address of Operator 415 West Wall, Suite 1000 Midland, Texas 79701	9. Pool name or Wildcat Artesia (Q, G, SA)
4. Well Location Unit Letter B : 990 Feet From The North Line and 1650 Feet From The East Line Section 8 Township 18S Range 28E NMPM Eddy County	

10. Elevation (Show whether DF, RKB, RT, GR, etc.)
Gr. 3637

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐
PULL OR ALTER CASING ☐
OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐
COMMENCE DRILLING OPNS. ☐ PLUG AND ABANDONMENT ☐
CASING TEST AND CEMENT JOB ☐
OTHER: ☒

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

6-3-92 Spot 210 gal acid 2219' - 2439'. Perf 2 JSPF 2306' - 2339' (42 holes).
RIH w/RBP, pkr & 2 3/8" tbg. Set RBP @ 2446'. Pull pkr to 2385'. Acidize
Lwr S. A. w/1500 gal 15% NEFE HCL w/40 7/8" ball sealers.

6-4-92 Set RBP @ 2383', pull pkr to 2380', set. Acidize Up S. A. w/1000 gal 15%
NEFE HCL followed by 9 1/2 bbl 2% KCL flush, 24 7/8" ball sealers. Release
pkr & RBP, POOH w/tbg & LD tools. RIH w/2 3/8" 4.7# J-55 BPMA, perf sub,
SN, & 79 jts tbg. SN @ 2402'. Btm tbg @ 2435'.

6-5-92 Ran 2" X 1 1/2" X 10' pump, rods, seat, space pump. Wait on electrical
hookup to begin testing/pumping.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Bonnie Husband TITLE Office Manager/Tech DATE 06-19-92
TYPE OR PRINT NAME Bonnie Husband TELEPHONE NO. 915/683-4434

(This space for State Use)

ORIGINAL SIGNED BY
MIKE WILLIAMS

APPROVED BY SUPERVISOR, DISTRICT II TITLE DATE JUN 29 1992

CONDITIONS OF APPROVAL, IF ANY: