-	#T11				
Submit 3 Copies o Appropriate District Office	State of Nev Energy, Minerals and Natur			Form (Revised	C-103 11-1-89 CLS
DISTRICT I	OIL CONSERVAT	FION DIVISION	WELL API NO.		
P.O. Box 1980, Hobbs, NM 88240	P.O. Box	2088		015-27292	
DISTRICT II P.O. Drawer DD, Artesia, NM 88210	Santa Fe, New Mex	ico 87504-2088	5. Indicate Type	of Lease STATE	FEE
DISTRICT III 000 Rio Brazos Rd., Aztec, NM 87410			6. State Oil & G	as Lesse No. B-7070	
SUNDRY NOTIC	CES AND REPORTS ON	WELLS	1//////////////////////////////////////		
(DO NOT USE THIS FORM FOR PROI DIFFERENT RESERV (FORM C-1	POSALS TO DRILL OR TO DEE VOIR. USE "APPLICATION FOI 101) FOR SUCH PROPOSALS.)		7. Lease Name of	or Unit Agreement Nar	ne
Type of Well:	<u> </u>	<u> </u>			
WELL X WELL	OTHER	MAR 2 7 199	iri	Lake AML Sta	te
Name of Operator YATES PETROLEUM CORPORA	ATION V		8. Well No.	1	
Address of Operator		OIL CON. I	De Wool name or		
105 South 4th St., Arte Well Location	sia, NM 88210	DIST. 2	Und. Loco	o Hills Sand	
	Feet From The South	Line and	10 Feet Fro	m The East	Line
Section 2	Township 18S	Range 30E	NMPM	Eddy	County
	10. Elevation (Show wh	ether DF, RKB, RT, GR, etc.)			
	3603'	GR			
L. Check A	ppropriate Box to Indic		-		
				HEPORI OF	
	ENTION TO:	SUE		REPORT OF:	r
	ENTION TO: PLUG AND ABANDON [ALTERING CASIN	IG 🗌
	r				[]
	PLUG AND ABANDON		G OPNS.	ALTERING CASIN	[]
NOTICE OF INT	PLUG AND ABANDON [CHANGE PLANS [REMEDIAL WORK COMMENCE DRILLING CASING TEST AND CO OTHER: Perforat	GOPNS.	ALTERING CASIN PLUG AND ABAN 20	
NOTICE OF INT ERFORM REMEDIAL WORK	PLUG AND ABANDON [CHANGE PLANS [One (Clearly state all pertinent deta d rigged up pulling d BOP. TOOH with 2 P and 2-7/8" tubing H with tubing. Rig (CNL log) (3125-33 d fell to RBP at 32 tubing. Latched or casing guns. TIH up and set packer a NEFE acid and ball g. Shut well in. own. Loaded tubing with production st	REMEDIAL WORK COMMENCE DRILLING CASING TEST AND CO OTHER: Perforat Us, and give periment dates, inclu- s, unit. TOOH with 2-7/8" production 5. Set RBP at 329 gged up wireline. 45' CBL log). Af 294'. TOOH with w nto casing guns at with packer and 2 at 3067'. Acidize t sealers. Bled w g with 2% KCL wate cring (seating nip	GOPNS.	ALTERING CASIN PLUG AND ABAN Ze of starting any propose ump. Nipple ut down. casing and " casing gur red, guns pu IH with over OH with tubi ons 3138-315 id began swat packer and TO	DONMENT X x ad ad down tested ins and illed cshot, ing, i RBP 58' obing. DOH with
NOTICE OF INT ERFORM REMEDIAL WORK	PLUG AND ABANDON [CHANGE PLANS [ons (Clearly state all pertinent deta d rigged up pulling d BOP. TOOH with 2 P and 2-7/8" tubing H with tubing. Rig (CNL log) (3125-33 d fell to RBP at 32 tubing. Latched or casing guns. TIH up and set packer a NEFE acid and ball g. Shut well in. own. Loaded tubing with production st ad. Released well	REMEDIAL WORK COMMENCE DRILLING CASING TEST AND CO OTHER: Perforat Us, and give pertinent dates, inclu- s, unit. TOOH with 2-7/8" production 5. Set RBP at 329 gged up wireline. 45' CBL log). Af 294'. TOOH with w nto casing guns at with packer and 2 at 3067'. Acidize sealers. Bled w g with 2% KCL wate cring (seating nip to production dep ge and belief.	GOPNS.	ALTERING CASIN PLUG AND ABAN Ze of starting any propose ump. Nipple ut down. casing and " casing gur red, guns pu IH with over OH with tubi ons 3138-315 id began swat packer and TO	DONMENT X x ad ad down tested ins and illed cshot, ing, i RBP 58' obing. DOH with
NOTICE OF INT ERFORM REMEDIAL WORK	PLUG AND ABANDON [CHANGE PLANS [ons (Clearly state all pertinent deta d rigged up pulling d BOP. TOOH with 2 P and 2-7/8" tubing H with tubing. Rig (CNL log) (3125-33 d fell to RBP at 32 tubing. Latched or casing guns. TIH up and set packer a NEFE acid and ball g. Shut well in. own. Loaded tubing with production st ad. Released well	REMEDIAL WORK COMMENCE DRILLING CASING TEST AND CO OTHER: Perforat Us, and give periment dates, inclu- s, unit. TOOH with 2-7/8" production 5. Set RBP at 329 ged up wireline. 45' CBL log). Af 294'. TOOH with w ato casing guns at with packer and 2 at 3067'. Acidize sealers. Bled w g with 2% KCL wate ring (seating nip to production dep	GOPNS.	ALTERING CASIN PLUG AND ABAN Ze of starting any propose ump. Nipple ut down. casing and " casing gur red, guns pu IH with over 1H with over 10H with tubi ag. Retested ons 3138-315 ad began swat packer and TC 3165'). Ren	A CONMENT X
NOTICE OF INT FRFORM REMEDIAL WORK	PLUG AND ABANDON [CHANGE PLANS [one (Clearly state all pertinent deta d rigged up pulling d BOP. TOOH with 2 P and 2-7/8" tubing. H with tubing. Rig (CNL log) (3125-31 d fell to RBP at 32 tubing. Latched or casing guns. TIH up and set packer a NEFE acid and ball g. Shut well in. own. Loaded tubing with production st ad. Released well	REMEDIAL WORK COMMENCE DRILLING CASING TEST AND CO OTHER: Perforat Us, and give pertinent dates, inclu- s, unit. TOOH with 2-7/8" production 5. Set RBP at 329 gged up wireline. 45' CBL log). Af 294'. TOOH with w nto casing guns at with packer and 2 at 3067'. Acidize sealers. Bled w g with 2% KCL wate cring (seating nip to production dep ge and belief.	GOPNS.	ALTERING CASIN PLUG AND ABAN 22 of starting any propose ump. Nipple ut down. casing and " casing gur red, guns pu TH with over 00H with tubing. Retested ons 3138-315 ad began swat packer and TC 3165'). Ren	ADONMENT [] (X) (d) (d) (d) (d) (d) (d) (d) (d
NOTICE OF INT ERFORM REMEDIAL WORK	PLUG AND ABANDON [CHANGE PLANS [one (Clearly state all pertinent deta d rigged up pulling d BOP. TOOH with 2 P and 2-7/8" tubing H with tubing. Rig (CNL log) (3125-33 d fell to RBP at 32 tubing. Latched or casing guns. TIH up and set packer a NEFE acid and ball g. Shut well in. own. Loaded tubing with production st ad. Released well and complete to the best of my knowled WLCONNED BY TIM W. GUM	REMEDIAL WORK COMMENCE DRILLING CASING TEST AND CO OTHER: Perforat Us, and give pertinent dates, inclu- s, unit. TOOH with 2-7/8" production 5. Set RBP at 329 gged up wireline. 45' CBL log). Af 294'. TOOH with w nto casing guns at with packer and 2 at 3067'. Acidize sealers. Bled w g with 2% KCL wate cring (seating nip to production dep ge and belief.	GOPNS.	ALTERING CASIN PLUG AND ABAN 22 of starting any propose ump. Nipple ut down. casing and " casing gur red, guns pu TH with over 00H with tubing. Retested ons 3138-315 ad began swat packer and TC 3165'). Ren	ADONMENT []

÷