	~		M OIL CONS COMMISSION CIS
	$\gtrsim \tilde{\lambda}$	А	rtesia, NM 88210
Form 3160-5		TED STATES IT OF THE INTERIOR	FORM APPROVED Budget Bureau No. 1004-0135
	BUREAU OF I	Expires: March 31, 1993 5. Lease Designation and Serial No.	
			LC-029395-B
SUNDRY NOTICES AND REPORTS ON WELLS			6. If Indian, Allottee or Tribe Name
		ill or to deepen or reentry to a different reserv R PERMIT—'' for such proposals	oir.
	7. If Unit or CA, Agreement Designation		
I. Type of Welt Oil Welt Gas Welt Other 2. Name of Operator			8. Well Name and No.
			Tracy 29 Federal #1
Coastal Management Corporation			9. API Well No.
3. Address and Telephone No.			30-015-28142
P.O. Box 2726 Midland, Texas 79702 (915) 688-0700			10. Field and Pool, or Exploratory Area
4. Location of Well (Footage, Sec., T., R., M., or Survey Description)			Cedar Lake, East Morrow
950'FSL & 1980'FEL			11. County or Parish, State
Sec.29,	T-17S R-31E		Eddy, New Mexico
2. CHECK A	APPROPRIATE BOX(s) TO INDICATE NATURE OF NOTICE, RE	
	SUBMISSION	TYPE OF ACT	
Notice of	Intent		
	iniem	Abandonment JAM 25 1355	Change of Plans
XX Subsequer	nt Panori	Plugging Back	New Construction
	п кероп	Casing Repair	Water Shut-Off
Final Aba	andonment Notice	Altering Casing	Conversion to Injection
		XX Other Spud, Surf & Inter.	
			(Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)
 D[*] cribe Proposed or Com 	pleted Operations (Clearly state al ions and measured and true vertic	Il pertinent details, and give pertinent dates, including estimated date of cal depths for all markers and zones pertinent to this work.)*	starting any proposed work. If well is directionally drilled,
give subsurface local		and copies for an markers and cones permitting to this work.)	
		OO PM	
10-11-94	4 Spud well @ 11:		13 3/8", H-40, 48# csg to 640'
10-11-94	4 Spud well @ 11: 4 TD'ed 17 1/2" k	nole @ 11:00 AM(640'). Ran 14 Jts]	-
10-11-94	4 Spud well @ 11: 4 TD'ed 17 1/2" h Cemented w/270	hole @ 11:00 AM(640'). Ran 14 Jts] sxs 'C' w/4% Gel, 2% CaCl & 1/4 #	flakes. Tailed w/350 sks 'C'
10-11-94	4 Spud well @ 11: 4 TD'ed 17 1/2" h Cemented w/270 w/ 2% CaCl. Plu	nole @ 11:00 AM(640'). Ran 14 Jts]	flakes. Tailed w/350 sks 'C'
10-11-94 10-12-94	4 Spud well @ 11: 4 TD'ed 17 1/2" h Cemented w/270 w/ 2% CaCl. Plu Tested Csg to 5	hole @ 11:00 AM(640'). Ran 14 Jts 1 sxs 'C' w/4% Gel, 2% CaCl & 1/4 # ug Down @ 4:00 PM 10-12-94. Circl 2 500 PSI/30 Mins. Held OK.	flakes. Tailed w/350 sks 'C' 250 sks to surface. WOC 18 hrs
10-11-94 10-12-94	4 Spud well @ 11: 4 TD'ed 17 1/2" h Cemented w/270 w/ 2% CaCl. Plu Tested Csg to 5 4 TD'ed 11"hole @	hole @ 11:00 AM(640'). Ran 14 Jts 1 sxs 'C' w/4% Gel, 2% CaCl & 1/4 # ug Down @ 4:00 PM 10-12-94. Circl 2 500 PSI/30 Mins. Held OK. @ 11:00 AM(4524'). Ran Sonic Log. H	flakes. Tailed w/350 sks 'C' 250 sks to surface. WOC 18 hrs Ran 111 Jts 8 5/8", J-55, 32#
10-11-94 10-12-94	<pre>4 Spud well @ 11: 4 TD'ed 17 1/2" h Cemented w/270 w/ 2% CaCl. Plu Tested Csg to 5 4 TD'ed 11"hole @ Csg to 4524'. 0</pre>	hole @ 11:00 AM(640'). Ran 14 Jts] sxs 'C' w/4% Gel, 2% CaCl & 1/4 # ug Down @ 4:00 PM 10-12-94. Circl 2 500 PSI/30 Mins. Held OK. @ 11:00 AM(4524'). Ran Sonic Log. H Cemented w/ 1775 sks 65/35 C/Poz w/	flakes. Tailed w/350 sks 'C' 250 sks to surface. WOC 18 hrs Ran 111 Jts 8 5/8", J-55, 32# /6% gel, 5% Salt, & 1/4#
10-11-94 10-12-94	<pre>4 Spud well @ 11: 4 TD'ed 17 1/2" # Cemented w/270 w/ 2% CaCl. Plu Tested Csg to 5 4 TD'ed 11"hole @ Csg to 4524'. 0 flakes. Tailed</pre>	hole @ 11:00 AM(640'). Ran 14 Jts J sxs 'C' w/4% Gel, 2% CaCl & 1/4 # ug Down @ 4:00 PM 10-12-94. Circl 2 500 PSI/30 Mins. Held OK. @ 11:00 AM(4524'). Ran Sonic Log. H Cemented w/ 1775 sks 65/35 C/Poz w/ w/200 sks 'C' Neat. Plug Down @ 2:	flakes. Tailed w/350 sks 'C' 250 sks to surface. WOC 18 hrs Ran 111 Jts 8 5/8", J-55, 32# /6% gel, 5% Salt, & 1/4#
10-11-94 10-12-94	<pre>4 Spud well @ 11: 4 TD'ed 17 1/2" # Cemented w/270 w/ 2% CaCl. Plu Tested Csg to 5 4 TD'ed 11"hole @ Csg to 4524'. 0 flakes. Tailed</pre>	hole @ 11:00 AM(640'). Ran 14 Jts] sxs 'C' w/4% Gel, 2% CaCl & 1/4 # ug Down @ 4:00 PM 10-12-94. Circl 2 500 PSI/30 Mins. Held OK. @ 11:00 AM(4524'). Ran Sonic Log. H Cemented w/ 1775 sks 65/35 C/Poz w/	flakes. Tailed w/350 sks 'C' 250 sks to surface. WOC 18 hrs Ran 111 Jts 8 5/8", J-55, 32# /6% gel, 5% Salt, & 1/4#
10-11-94 10-12-94 10-20-94	<pre>4 Spud well @ 11: 4 TD'ed 17 1/2" H Cemented w/270 w/ 2% CaCl. Plu Tested Csg to 5 4 TD'ed 11"hole @ Csg to 4524'. 0 flakes. Tailed Circl 325 sks t</pre>	hole @ 11:00 AM(640'). Ran 14 Jts J sxs 'C' w/4% Gel, 2% CaCl & 1/4 # ug Down @ 4:00 PM 10-12-94. Circl 2 500 PSI/30 Mins. Held OK. @ 11:00 AM(4524'). Ran Sonic Log. H Cemented w/ 1775 sks 65/35 C/Poz w/ w/200 sks 'C' Neat. Plug Down @ 2: to surface. WOC 18 hrs.	flakes. Tailed w/350 sks 'C' 250 sks to surface. WOC 18 hrs Ran 111 Jts 8 5/8", J-55, 32# /6% gel, 5% Salt, & 1/4# :30 AM 10-21-94.
10-11-94 10-12-94 10-20-94	 4 Spud well @ 11: 4 TD'ed 17 1/2" h Cemented w/270 w/ 2% CaCl. Plu Tested Csg to 5 4 TD'ed 11"hole @ Csg to 4524'. @ flakes. Tailed Circl 325 sks t 4 Tested all Pres 	hole @ 11:00 AM(640'). Ran 14 Jts J sxs 'C' w/4% Gel, 2% CaCl & 1/4 # ug Down @ 4:00 PM 10-12-94. Circl 2 500 PSI/30 Mins. Held OK. @ 11:00 AM(4524'). Ran Sonic Log. H Cemented w/ 1775 sks 65/35 C/Poz w/ w/200 sks 'C' Neat. Plug Down @ 2: to surface. WOC 18 hrs. ssure Equipment to 3000 psi.(Hydrif	flakes. Tailed w/350 sks 'C' 250 sks to surface. WOC 18 hrs Ran 111 Jts 8 5/8", J-55, 32# /6% gel, 5% Salt, & 1/4# :30 AM 10-21-94. 1 to 1500). All equipment
10-11-94 10-12-94 10-20-94	 4 Spud well @ 11: 4 TD'ed 17 1/2" H Cemented w/270 w/ 2% CaCl. Plu Tested Csg to 5 4 TD'ed 11"hole @ Csg to 4524'. 0 flakes. Tailed Circl 325 sks t 4 Tested all Press Held except for 	hole @ 11:00 AM(640'). Ran 14 Jts J sxs 'C' w/4% Gel, 2% CaCl & 1/4 # ug Down @ 4:00 PM 10-12-94. Circl 2 500 PSI/30 Mins. Held OK. @ 11:00 AM(4524'). Ran Sonic Log. F Cemented w/ 1775 sks 65/35 C/Poz w/ w/200 sks 'C' Neat. Plug Down @ 2: to surface. WOC 18 hrs. ssure Equipment to 3000 psi.(Hydrif r two safety values. Sent to Hobbs	flakes. Tailed w/350 sks 'C' 250 sks to surface. WOC 18 hrs Ran 111 Jts 8 5/8", J-55, 32# /6% gel, 5% Salt, & 1/4# :30 AM 10-21-94. 1 to 1500). All equipment <u>for repair &</u> tested in Hobbs
10-11-94 10-12-94 10-20-94	 4 Spud well @ 11: 4 TD'ed 17 1/2" h Cemented w/270 w/ 2% CaCl. Plu Tested Csg to 5 4 TD'ed 11"hole @ Csg to 4524'. @ flakes. Tailed Circl 325 sks t 4 Tested all Pres 	hole @ 11:00 AM(640'). Ran 14 Jts J sxs 'C' w/4% Gel, 2% CaCl & 1/4 # ug Down @ 4:00 PM 10-12-94. Circl 2 500 PSI/30 Mins. Held OK. @ 11:00 AM(4524'). Ran Sonic Log. F Cemented w/ 1775 sks 65/35 C/Poz w/ w/200 sks 'C' Neat. Plug Down @ 2: to surface. WOC 18 hrs. ssure Equipment to 3000 psi.(Hydrif r two safety values. Sent to Hobbs	flakes. Tailed w/350 sks 'C' 250 sks to surface. WOC 18 hrs Ran 111 Jts 8 5/8", J-55, 32# /6% gel, 5% Salt, & 1/4# :30 AM 10-21-94. 1 to 1500). All equipment
10-11-94 10-12-94 10-20-94	 4 Spud well @ 11: 4 TD'ed 17 1/2" H Cemented w/270 w/ 2% CaCl. Plu Tested Csg to 5 4 TD'ed 11"hole @ Csg to 4524'. 0 flakes. Tailed Circl 325 sks t 4 Tested all Press Held except for 	hole @ 11:00 AM(640'). Ran 14 Jts J sxs 'C' w/4% Gel, 2% CaCl & 1/4 # ug Down @ 4:00 PM 10-12-94. Circl 2 500 PSI/30 Mins. Held OK. @ 11:00 AM(4524'). Ran Sonic Log. F Cemented w/ 1775 sks 65/35 C/Poz w/ w/200 sks 'C' Neat. Plug Down @ 2: to surface. WOC 18 hrs. ssure Equipment to 3000 psi.(Hydrif r two safety values. Sent to Hobbs	flakes. Tailed w/350 sks 'C' 250 sks to surface. WOC 18 hrs Ran 111 Jts 8 5/8", J-55, 32# /6% gel, 5% Salt, & 1/4# :30 AM 10-21-94. 1 to 1500). All equipment <u>for repair &</u> tested in Hobbs
10-11-94 10-12-94 10-20-94	 4 Spud well @ 11: 4 TD'ed 17 1/2" H Cemented w/270 w/ 2% CaCl. Plu Tested Csg to 5 4 TD'ed 11"hole @ Csg to 4524'. 0 flakes. Tailed Circl 325 sks t 4 Tested all Press Held except for 	hole @ 11:00 AM(640'). Ran 14 Jts J sxs 'C' w/4% Gel, 2% CaCl & 1/4 # ug Down @ 4:00 PM 10-12-94. Circl 2 500 PSI/30 Mins. Held OK. @ 11:00 AM(4524'). Ran Sonic Log. F Cemented w/ 1775 sks 65/35 C/Poz w/ w/200 sks 'C' Neat. Plug Down @ 2: to surface. WOC 18 hrs. ssure Equipment to 3000 psi.(Hydrif r two safety values. Sent to Hobbs	flakes. Tailed w/350 sks 'C' 250 sks to surface. WOC 18 hrs Ran 111 Jts 8 5/8", J-55, 32# /6% gel, 5% Salt, & 1/4# :30 AM 10-21-94. 1 to 1500). All equipment <u>for repair &</u> tested in Hobbs
10-11-94 10-12-94 10-20-94	 4 Spud well @ 11: 4 TD'ed 17 1/2" H Cemented w/270 w/ 2% CaCl. Plu Tested Csg to 5 4 TD'ed 11"hole @ Csg to 4524'. 0 flakes. Tailed Circl 325 sks t 4 Tested all Press Held except for 	hole @ 11:00 AM(640'). Ran 14 Jts J sxs 'C' w/4% Gel, 2% CaCl & 1/4 # ug Down @ 4:00 PM 10-12-94. Circl 2 500 PSI/30 Mins. Held OK. @ 11:00 AM(4524'). Ran Sonic Log. F Cemented w/ 1775 sks 65/35 C/Poz w/ w/200 sks 'C' Neat. Plug Down @ 2: to surface. WOC 18 hrs. ssure Equipment to 3000 psi.(Hydrif r two safety values. Sent to Hobbs	flakes. Tailed w/350 sks 'C' 250 sks to surface. WOC 18 hrs Ran 111 Jts 8 5/8", J-55, 32# /6% gel, 5% Salt, & 1/4# :30 AM 10-21-94. 1 to 1500). All equipment for repair & tested in Hobbs FOR PECORD
10-11-94 10-12-94 10-20-94 10-21-94	 4 Spud well @ 11: 4 TD'ed 17 1/2" H Cemented w/270 w/ 2% CaCl. Plu Tested Csg to 5 4 TD'ed 11"hole @ Csg to 4524'. 0 flakes. Tailed Circl 325 sks t 4 Tested all Press Held except for 	hole @ 11:00 AM(640'). Ran 14 Jts J sxs 'C' w/4% Gel, 2% CaCl & 1/4 # ug Down @ 4:00 PM 10-12-94. Circl 2 500 PSI/30 Mins. Held OK. @ 11:00 AM(4524'). Ran Sonic Log. F Cemented w/ 1775 sks 65/35 C/Poz w/ w/200 sks 'C' Neat. Plug Down @ 2: to surface. WOC 18 hrs. ssure Equipment to 3000 psi.(Hydrif r two safety values. Sent to Hobbs	flakes. Tailed w/350 sks 'C' 250 sks to surface. WOC 18 hrs Ran 111 Jts 8 5/8", J-55, 32# /6% gel, 5% Salt, & 1/4# :30 AM 10-21-94. 1 to 1500). All equipment for repair & tested in Hobbs FOR PECORD
10-11-94 10-12-94 10-20-94 10-21-94	4 Spud well @ 11: 4 TD'ed 17 1/2" H Cemented w/270 w/ 2% CaCl. Plu Tested Csg to 5 4 TD'ed 11"hole @ Csg to 4524'. 0 flakes. Tailed Circl 325 sks t 4 Tested all Pres Held except for to 3000 psi. He	hole @ 11:00 AM(640'). Ran 14 Jts J sxs 'C' w/4% Gel, 2% CaCl & 1/4 # ug Down @ 4:00 PM 10-12-94. Circl 2 500 PSI/30 Mins. Held OK. @ 11:00 AM(4524'). Ran Sonic Log. F Cemented w/ 1775 sks 65/35 C/Poz w, w/200 sks 'C' Neat. Plug Down @ 2: to surface. WOC 18 hrs. ssure Equipment to 3000 psi.(Hydrif r two safety values. Sent to Hobbs eld OK. ACCEPTED	flakes. Tailed w/350 sks 'C' 250 sks to surface. WOC 18 hrs Ran 111 Jts 8 5/8", J-55, 32# /6% gel, 5% Salt, & $1/4$ # :30 AM 10-21-94. 1 to 1500). All equipment for repair & tested in Hobbs FOR PECORD
10-11-94 10-12-94 10-20-94 10-21-94	4 Spud well @ 11: 4 TD'ed 17 1/2" H Cemented w/270 w/ 2% CaCl. Plu Tested Csg to 5 4 TD'ed 11"hole @ Csg to 4524'. 0 flakes. Tailed Circl 325 sks t 4 Tested all Pres Held except for to 3000 psi. He for Larry Sny	hole @ 11:00 AM(640'). Ran 14 Jts J sxs 'C' w/4% Gel, 2% CaCl & 1/4 # ug Down @ 4:00 PM 10-12-94. Circl 2 500 PSI/30 Mins. Held OK. @ 11:00 AM(4524'). Ran Sonic Log. H Cemented w/ 1775 sks 65/35 C/Poz w/ w/200 sks 'C' Neat. Plug Down @ 2: to surface. WOC 18 hrs. ssure Equipment to 3000 psi.(Hydrif r two safety values. Sent to Hobbs eld OK. ACCEPTED	flakes. Tailed w/350 sks 'C' 250 sks to surface. WOC 18 hrs Ran 111 Jts 8 5/8", J-55, 32# /6% gel, 5% Salt, & 1/4# :30 AM 10-21-94. 1 to 1500). All equipment for repair & tested in Hobbs FOR PECORD
10-11-94 10-12-94 10-20-94 10-21-94 10-21-94 14. I hereby certify parties for Signed	4 Spud well @ 11: 4 TD'ed 17 1/2" H Cemented w/270 w/ 2% CaCl. Plu Tested Csg to 5 4 TD'ed 11"hole @ Csg to 4524'. 0 flakes. Tailed Circl 325 sks t 4 Tested all Pres Held except for to 3000 psi. He for Larry Sny	hole @ 11:00 AM(640'). Ran 14 Jts J sxs 'C' w/4% Gel, 2% CaCl & 1/4 # ug Down @ 4:00 PM 10-12-94. Circl 2 500 PSI/30 Mins. Held OK. @ 11:00 AM(4524'). Ran Sonic Log. H Cemented w/ 1775 sks 65/35 C/Poz w/ w/200 sks 'C' Neat. Plug Down @ 2: to surface. WOC 18 hrs. ssure Equipment to 3000 psi.(Hydrif r two safety values. Sent to Hobbs eld OK. ACCOPTED WderLand Supervisor (ARLSCAD,	flakes. Tailed w/350 sks 'C' 250 sks to surface. WOC 18 hrs Ran 111 Jts 8 5/8", J-55, 32# /6% gel, 5% Salt, & $1/4$ # :30 AM 10-21-94. 1 to 1500). All equipment for repair & tested in Hobbs FOR PECORD
10-11-94 10-12-94 10-20-94 10-21-94 10-21-94	<pre>4 Spud well @ 11: 4 TD'ed 17 1/2" H Cemented w/270 w/ 2% CaCl. Plu Tested Csg to 5 4 TD'ed 11"hole @ Csg to 4524'. 0 flakes. Tailed Circl 325 sks t 4 Tested all Pres Held except for to 3000 psi. He foregoing is true and correct for Larry Sny ate office use)</pre>	hole @ 11:00 AM(640'). Ran 14 Jts J sxs 'C' w/4% Gel, 2% CaCl & 1/4 # ug Down @ 4:00 PM 10-12-94. Circl 2 500 PSI/30 Mins. Held OK. @ 11:00 AM(4524'). Ran Sonic Log. F Cemented w/ 1775 sks 65/35 C/Poz w, w/200 sks 'C' Neat. Plug Down @ 2: to surface. WOC 18 hrs. ssure Equipment to 3000 psi.(Hydrif r two safety values. Sent to Hobbs eld OK. ACCEPTED	flakes. Tailed w/350 sks 'C' 250 sks to surface. WOC 18 hrs Ran 111 Jts 8 5/8", J-55, 32# /6% gel, 5% Salt, & $1/4$ # :30 AM 10-21-94. 1 to 1500). All equipment for repair & tested in Hobbs FOR PECORD
10-11-94 10-12-94 10-20-94 10-21-94 10-21-94 14. I hereby certify, that the for Signed	<pre>4 Spud well @ 11: 4 TD'ed 17 1/2" H Cemented w/270 w/ 2% CaCl. Plu Tested Csg to 5 4 TD'ed 11"hole @ Csg to 4524'. 0 flakes. Tailed Circl 325 sks t 4 Tested all Pres Held except for to 3000 psi. He foregoing is true and correct for Larry Sny ate office use)</pre>	hole @ 11:00 AM(640'). Ran 14 Jts J sxs 'C' w/4% Gel, 2% CaCl & 1/4 # ug Down @ 4:00 PM 10-12-94. Circl 2 500 PSI/30 Mins. Held OK. @ 11:00 AM(4524'). Ran Sonic Log. H Cemented w/ 1775 sks 65/35 C/Poz w/ w/200 sks 'C' Neat. Plug Down @ 2: to surface. WOC 18 hrs. ssure Equipment to 3000 psi.(Hydrif r two safety values. Sent to Hobbs eld OK. ACCOPTED WderLand Supervisor (ARLSCAD,	flakes. Tailed w/350 sks 'C' 250 sks to surface. WOC 18 hrs Ran 111 Jts 8 5/8", J-55, 32# /6% gel, 5% Salt, & $1/4$ # :30 AM 10-21-94. 1 to 1500). All equipment for repair & tested in Hobbs) FOR RECORD 1 7 205 Date Dec.15, 1994

.