Forni 3160-5 (November 1983) (Formerly 9-331)

UNITE. JTATES DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT

Oil Cons.

SUBMIT IN TRIBLICATION. GRANGE Bureau No. 1004-0135

(Other Instriction of the Control of the Contro

	cl	5	1
5			

			1 - 17 - 17 - 17 - 17 - 17 - 17 - 17 -		
SUNDRY NOT	6. IF INDIAN, ALLOTTEE OR TRIBE NAME				
(Do not use this form for prop					
Use "APPLIC	CATION FOR PERMIT - " for such prop	osals.)			
1.			7. UNIT AGREE MENT NAME		
OIL GAS WELL	OTHER		Lea D		
WELL WELL CO.					
2. NAME OF OPERATOR	/		8. WELL NO.		
The Wiser Oil Company			10		
3. ADDRESS OF OPERATOR			9. API NO.		
	9. API NO. 30-015-29704				
P.O. Box 2568 Hobbs, New					
4. LOCATION OF WELL (Report location)	10. FIELD AND POOL, OR WILDCAT				
See also space 17 below.)	Grayburg Jackson 7-Rivers-QN-GB-SA				
At surface 1303' FNL & 1306' FEL	11. SEC., T., R., M., OR BLK. AND				
Unit A			SURVEY OR AREA		
Citte 71			Sec. 26-T17S-R31E		
			244. 24 11.2 12.12		
14. PERMIT NO.	15. ELEVATIONS (Show whether DF	RT, GR, etc.)	12. COUNTY OR PARISH 13. STATE		
	3761'		Eddy County NM		
16. Check	Appropriate Box to indicate Nati	ura of Nation Domest on Othe			
io. Check	Appropriate box to indicate Nati	ine of Notice, Report, or Othe	er Dala		
NOTICE OF INT	ENTION TO:	et in	SSEQUENT REPORT OF:		
Notice of his	Division 10.	J SCD	SEQUENT REPORT OF.		
TEGT WATER OUT OFF	NULL OF ALTER CASPIC	WAREN OUT OF			
TEST WATER SHUT OFF	PULL OR ALTER CASING	WATER SHUT-OFF	REPAIRING WELL		
FRACTURE TREAT	A COLUMN TO THE COLUMN TO THE	ED A CUEL THE TUDE A TRANSPORT			
FRACTORE TREAT	MULTIPLE COMPLETE	FRACTURE TREATMENT	ALTERING CASING		
SHOOT OR ACIDIZE	ABANDON*	SHOOTING OR ACIDIZING	AD ANDONIA (PATE +		
<u> </u>	ABANDON	SHOOTING OR ACIDIZING	ABANDONMENT *		
REPAIR WELL	CHANGE PLANS	(Other) De perforate	& Acidiza		
KEI AIR WEEL	CHANGE FLANS	(Other) Re-perforate			
(Other)			lts of multiple completion on Well		
· · · · · · · · · · · · · · · · · · ·	CED OPED ATIONS, (CI. 1		completion Report and Log form.)		
17. DESCRIBE PROPOSED OR COMPLET	LD OPERATIONS: (Clearly state all per drilled give subsurface locations and m	minent details, and give pertinent dat	ies, including estimated date of starting any all markers and zones pertinent to this work.)		
proposed work. If well is directionally	difficulty give substitute locations and in	leasured and true vertical deputs for a	an markers and zones pertinent to this work.)		
11/05/97 MIRU Lucky Well Service.					
11/06/97 POH w/rods & pump. NU BOP. POH w/2-7/8" tbg. HES perforated Vacuum 6'3731',32',33',43',44',45',51',55',56',57', & 58' w/4 SPF (44 holes). RIH w/Baker RBP on 2-7/8" tbg. Set RBP @ 3679'. POH w/tbg. &					
retrieving head. RIH w/Baker pkr. on 3-1/2" tbg. Set pkr. @ 3636'.					
11/07/97 HES acidized Vacuum 3731'-3758' w/2100 gals. 15% NE-FE acid w/850# rock salt. ATP 3163#@ 5.8 bpm. MTP 3611#@ 6.1 bpm. Communicated to Grayburg perfs. w/2nd block on perfs. ISIP 2236#. 5 min. 1371#.					
10 min. 1116#. 15 min. 966#. Unset pkr. Pump 70 bbls. down csg. Set pkr. @ 3400'. Test csg. & tbg. to 1500#. Reset pkr. @ 3636'.					
11/10/97 POH & LD 3-1/2" tbg.					
11/11/97 RIH w/4-1/4" Lynes inflatable pkr., 7 jts. 2-7/8" tbg., 4-1/4" Lynes inflatable pkr., & 2-7/8" tbg. Set bottom pkr. @ 3648'. Top pkr. @ 3412'. Load csg. & pressure to 1500#.					
11/12/97 HES fac'd. Vacuum perfs. 3731'-3758' w/2000 gals. gelled water + 17,000 gals. 25# Delta frac w/28,800# 16/30 sand. ATP 4927# @ 22.7 bpm. MTP 5289# @ 29.2 bpm. ISIP 2150#. 5 min. 1700#. 10 min. 1550#. 15					
min. 1550#.					
11/13/97 Release pkrs. LD 20 jts. tbg. Circulate 60 bbls.	down csg.				
11/14/97 POH. LD tbg. & pkrs. RIH w/retriveing tool & 2-7/8" tbg. Clean out sand to 3737'. RBP @ 3799'. Pull tbg. to 3360'.					
11/17/97 Retrieve RBP. POH w/RBP & pkr. RIH w/2-7/8" tbg. Tag sand @ 3990'. Circulate sand to 4080'. Circulate clean & pull 4 jts.					
11/18/97 Circulate sand to 4156'. ND BOP. Set TAC w/10,000# tension. Tbg. @ 4100'. SN @ 4080'. TAC @ 3434'. RIH w/rods & 2-1/2" x 1-3/4" x 20' pump. RDMO.					
12/10/97 MIRU Lucky Well Service. POH w/rods. Rods unscrewed on bottom 1". RIH & fish pump. POH. NU BOP's. Tally out of hole w/rbg. RIH w/pkr. & RBP. Set RBP @ 3818'. Set pkr. @ 3640'.					
12/11/97 Unset pkr. Retrieve RBP & POH. RIH w/2-7/8					
18. I hereby certify that the foregoing is true	and correct.				
SIGNED Many go Tunner	TITLE Production Te	ch II	DATE December 27, 2001		
Mary Jo Turner	-				
(CEPTED FOR RECORD					
CONDITIONS OF APPROVAL IF ANY	TTTLE		DATE		
CONDITIONS OF APPROVAL, IF ANY:					
MAR 1 1 2002					
MILLIE	*See Instruction	n On Reverse Side	•		
	occ manucho	Hoverde dide			
Title 18 U.S.C. Section 1901 Amakes it a crim	e for any person knowingly and willfully	to make to any department or agence	cy of the United States any false, fictitious or		
fraudulent statements propertientations as to	any matter within its jurisdiction.	, ,	y, strawnown or		

E0 1/0 TTB/// (4 1740 - 197 E0 : 1897 S

555 EVD - 1 VI 10: 33

BOENED