
Submit 3 Copies to Appropriate

State of New Mexico Energy, Minerals and Natural Resources Department

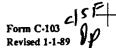

District Office **DISTRICT I** OIL CONSERVATION DIVISION WELL API NO. P.O. Box 1980, Hobbs, NM 88240 P.O. Box 2088 Santa Fe, New Mexico 87504-2088 P.O. Drawer DD, Artesia, NM 88210 5. Indicate Type of Lease STATE X FEE 6. State Oil & Gas Lease No. 1000 Rio Brazos Rd., Aztec, NM 87410 E-1051 SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A 7. Lease Name or Unit Agreement Name DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.) 1. Type of Well: RECEIVED Gulf State METT OT P&A OTHER 2. Name of Operator 8. Well No. JUN 28 '89 JOHN A. YATES, JR., OPERATOR 3. Address of Operator 9. Pool name or Wildcat 105 South 4th St., Artesia, NM Artesia-Queen-Grayburg-SA O. C. D. 4. Well Location ARTESIA, OFFICE Line and 2310 Unit Letter B: 330 Feet From The North Feet From The East Line 19S 28E Township Range **NMPM** County 10. Elevation (Show whether DF, RKB, RT, GR, etc.) Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data 11. NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF: PERFORM REMEDIAL WORK PLUG AND ABANDON REMEDIAL WORK ALTERING CASING **TEMPORARILY ABANDON CHANGE PLANS** COMMENCE DRILLING OPNS. PLUG AND ABANDONMENT **PULL OR ALTER CASING** CASING TEST AND CEMENT JOB OTHER: OTHER:_ 12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103. 6-22-89. MIRU. Checked for gas pressure and water flows-none present. ND wellhead, NU BOP. RIH and set CIBP 1845'. Circulated 10# mud laden fluid. Set 5 sx Class C cement on CIBP at 1845'. POOH w/tubing. Perforated 4 squeeze hole at 1510'. RIH w/packer on 2-3/8" tubing. Set packer 1400'. Pumped 45 bbls 10# brine. No circ established up 8-5/8". Well on vacuum. Released packer and POOH. Discussed with State. RIH w/packer and set 1370'. Pumped 25 sx plug at 1510'. Displaced 1400'. WOC. Unset packer. POOH. Perforated 4 squeeze holes at 500'. RIH w/packer to 320'. Broke circ up 8-5/8". POOH w/packer. Bradenhe'ad squeeze perfs w/150 sx Class C cement. Break circ up 8-5/8" to 5-1/2". ND BOP and wellhead. Pumped 10 sx surface plug. Installed dry hole marker. Plugging completed 6-24-89. Post ID- 2 6-30-89 I hereby certify that the information above is true and complete to the best of my knowledge and belief. mme Production Supervisor DATE _6-27-89 SKNATURE = Juanita Goodlett TELEPHONE NO. 505/748-1471 TYPE OR PRINT NAME (This space for State Use)