

Billy R. Wilson
Robinson Bros Drlg Co.
State A #1 M-36-19-28
API # 30-015-02331

Plan to plug well as follows:

1. Move in rig, reverse equipment and tools.
2. Run in hole with tools and mill casing stub in attempt to enter and plug.
3. If successful, circulate hole clean.
4. Perforate Bone Springs at 4035'. Perforate Delaware at 3085'.
5. Run in hole with tubing to 4035' and load hole with mud.
6. Spot a 100 Sx plug at 4035'. Tag.
7. Spot a 300 Sx plug at 2620'. Tag.
8. Spot a 50 Sx plug at 1428'.
9. *Perforate @ 300' + circ. cnt to surface leaving*
Spot a 50 Sx plug at 401'. *pipe full of cnt.*
10. Spot a 10 Sx surface plug.

Calc TOC an 8 5/8 @ 1705'