

4-16-96

11. Run in hole with wireline + tag ment e 3764'. Have a 351 ft plug inside of pipe with 39 sp out side. Pull out of hole with tool.
12. Run in hole with thy to 3140' + pump 100 sp of cement. Pull out of hole with thy + lay down 30 joints. WOC.
13. Run in hole with wireline to tag cement + did not tag. Went down to csq stub.
14. Run hole with thy + reentered csq. to 2615' + pump 165 sp of cement. WOC.
- 4-16-96 Run in hole with thy + tag cement e 2168'
15. Spot 50 sp of cement + WOC.
16. Run in hole + tag e 2037'. Plug had fallen 81'.
17. Spot 50 sp e 1452' + WOC. This cover a csq bowl e 1428'.
- 4-17-96
18. Run in hole with thy + tag cement e 1286'.
19. Load hole with mud + pull out of hole with thy.
20. Perforate 8 5/8 csq e 275' + circulate cement to surface.
21. Cut anchors, clean + level location + set P + A marker.