

2-23-96 Run in hole with charge + perforate csq @ 2750'.
Run in hole with tbg + pkr to establish rate
but could not pump in @ 2000 PSI.
Unseat pkr + spot a 30 sp cmt plug across
perforation.
Pull up hole to 2250' + spot 25 sp.
Pull up hole to 1650' + spot 25 sp
Pull up hole to 1000' + spot 25 sp
Pull out of hole + shut down for weekend.

2-26-96 Run in hole with charge + perforate csq @ 425
and perforate csq.
Set pkr @ 200' + squeeze 100 sp of cement.
Set 10 sp surface plug and P+A marker.
Clean & level location.