

UNITED STATES  
DEPARTMENT OF THE INTERIOR  
BUREAU OF LAND MANAGEMENT

SUBMIT IN TRI-CATE\*  
(Other instructions on re-verse side)

Form approved.  
Budget Bureau No. 1004-0135  
Expires August 31, 1985

5. LEASE DESIGNATION AND SERIAL NO.

LC-062052

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.  
Use "APPLICATION FOR PERMIT—" for such proposals.)

1. OIL WELL ☒ GAS WELL ☐ OTHER ☐

2. NAME OF OPERATOR

William A. & Edward R. Hudson

3. ADDRESS OF OPERATOR

P.O. Box 9, Maljamar, New Mexico 88264

4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.  
See also space 17 below.)  
At surface

NW 1/4, SW 1/4  
Sec. 11, T18S, R31E

RECEIVED

MAY 22 '89

14. PERMIT NO.

15. ELEVATIONS (Show whether DF, RT, GR, etc.)

3733' GL

7. UNIT AGREEMENT NAME

8. FARM OR LEASE NAME

Shugart "B"

9. WELL NO.

4

10. FIELD AND POOL, OR WILDCAT

Shugart Queen

11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA

Sec. 11-18S-31E

12. COUNTY OR PARISH 13. STATE

Eddy

N.M.

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF

FRACTURE TREAT

SHOOT OR ACIDIZE

REPAIR WELL

(Other)

PULL OR ALTER CASING

MULTIPLE COMPLETE

ABANDON\*

CHANGE PLANS

X

SUBSEQUENT REPORT OF:

WATER SHUT-OFF

FRACTURE TREATMENT

SHOOTING OR ACIDIZING

(Other)

REPAIRING WELL

ALTERING CASING

ABANDONMENT\*

(NOTE: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.) \*

This well pumps about 1 bbl. of oil + 7 bbls. of water per day and is uneconomical to operate. We propose to plug and abandon the well as follows:

1. Set bridge plug at about 3257' with 35' of cement on top of plug.
2. Fill hole with salt gel mud to 2060'
3. Spot 100' of cement from 2060' to 1960'
4. Fill hole with salt gel mud to 800'
5. Perforate 5-1/2" casing at 900' with 4 shots.
6. Set a cement retainer in 5-1/2" casing at 850'.
7. Circulate cement to the surface, place 150' cement on top of retainer, fill hole to surface with fresh water.
8. Place 50' cement at surface.
9. Clean location and re-seed in accordance with BLM regulations.

Notify BLM at 887-6544 prior to commencing P & A operations.

18. I hereby certify that the foregoing is true and correct

SIGNED

TITLE

Prod. Supt.

DATE

5/3/89

(This space for Federal or State office use)

APPROVED BY

For:  
TITLE

CHIEF, BUREAU OF LAND MANAGEMENT

DATE


5/19/89

CONDITIONS OF APPROVAL, IF ANY

\*See Instructions on Reverse Side

WILLIAM A. & EDWARD R. HUDSON  
Shugart B # 4

SKETCH

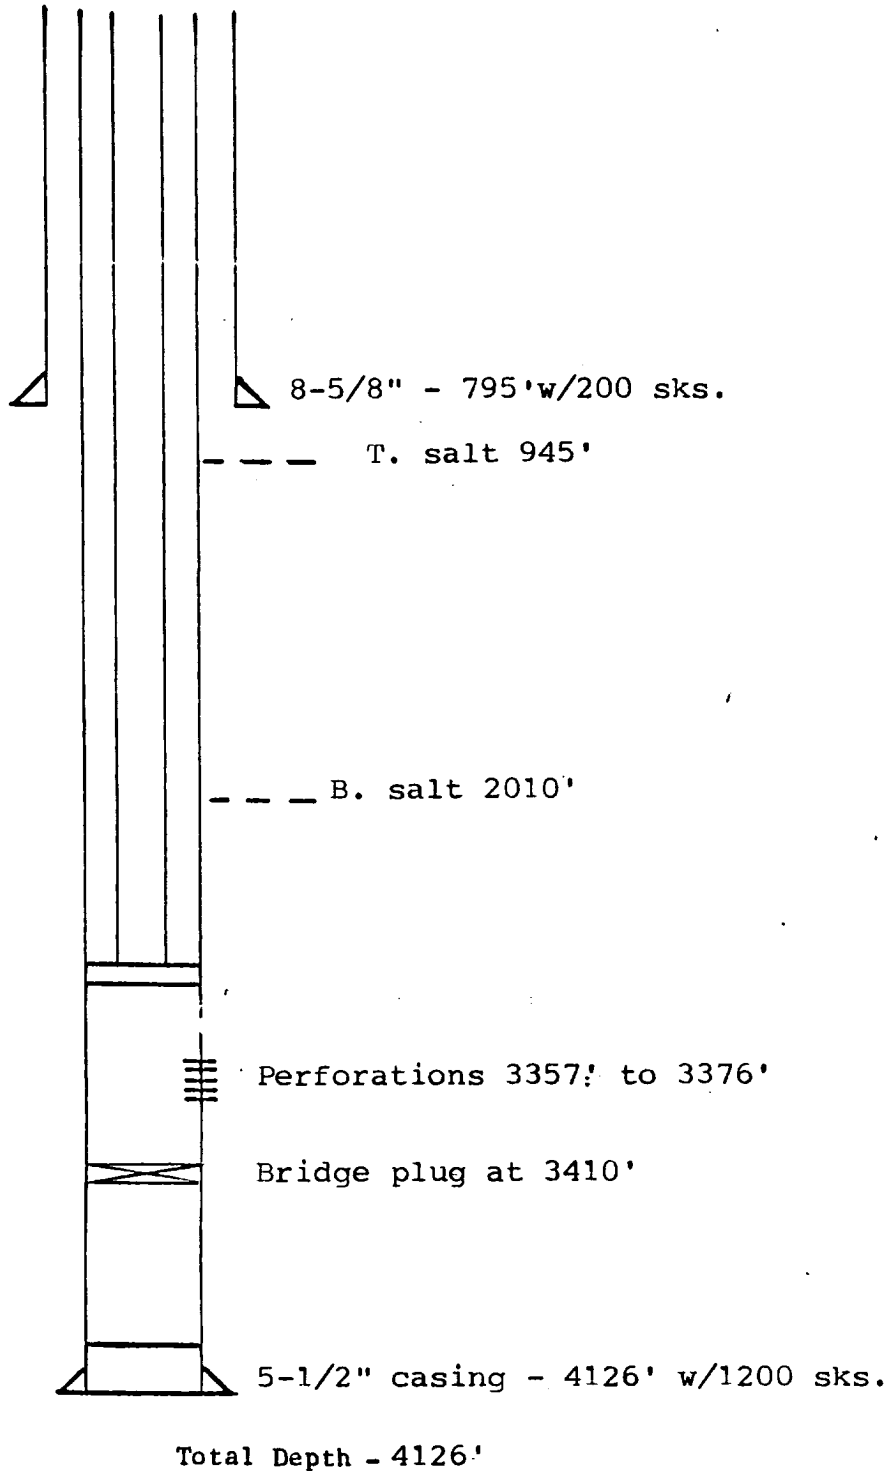

WILLIAM A. & EDWARD R. HUDSON  
SHUGART B LEASE  
WELL # 4

Completed: July 11, 1957

Total depth: 4126'

Casing: 8-58" O.D. 24# at 795' with 200 sks.  
5-1/2" O.D. 15.5# at 4126' with 1200  
sks.

Bridge plug at 3410'

5-1/2" casing perforated at 3357' to 3376'

Top of salt - 945'

Base of salt - 2010'