

NM OIL CONS. COMMISS  
Drawer DD  
UNITED STATES DEPARTMENT OF THE INTERIOR  
GEOLOGICAL SURVEY  
SUBMIT IN TRIPLICATE\*  
(Other locations on reverse side)

Form approved.  
Budget Bureau No. 42-R1424.

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.  
Use "APPLICATION FOR PERMIT—" for such proposals.)

1. OIL WELL ☒ GAS WELL ☐ OTHER ☐

2. NAME OF OPERATOR

Southland Royalty Company

3. ADDRESS OF OPERATOR

21 Desta Drive, Midland, Texas 79701

4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.  
See also space 17 below.)  
At surface

330' FSL & 330' FEL, Sec. 30, T-18-S, R-31-E

14. PERMIT NO.

15. ELEVATIONS (Show whether DF, RT, GR, etc.)

Unknown

5. LEASE DESIGNATION AND SERIAL NO.

LC-029387 (b)

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

7. UNIT AGREEMENT NAME

8. FARM OR LEASE NAME

Shugart "C"

9. WELL NO.

1

10. FIELD AND POOL, OR WILDCAT

Shugart (Y,SR,Q,G)

11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA

Sec. 30, T-18-S, R-31-E

12. COUNTY OR PARISH 13. STATE

Eddy

N.M.

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF

FRACTURE TREAT

SHOOT OR ACIDIZE

REPAIR WELL

(Other)

PULL OR ALTER CASING

MULTIPLE COMPLETE

ABANDON\*

CHANGE PLANS

WATER SHUT-OFF

FRACTURE TREATMENT

SHOOTING OR ACIDIZING

(Other)

SUBSEQUENT REPORT OF:

REPAIRING WELL

ALTERING CASING

ABANDONMENT\*

(NOTE: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)

1. Call the NMOCD & Dept. of Interior in Artesia. MIRUPU. Install BOP. Dig pit.
2. RIH & set CIBP @ 3150' + on tbg. Spot 35' cmt. on top. ~~Spot mud to 3230'.~~ P.W.C.
3. ~~PU & spot cmt plug from 3230' (btm Queen pf) to 3100' +. Tag TOC plug. Spot mud to 2090'. POH.~~
4. Perf 2 sqz holes @ 2090' +. Place 100' cmt plug inside & outside 5 1/2" csg from 2090-1990'. Spot mud. POH.
5. Perf 2 sqz holes @ 760' +. Place 200' cmt plug inside & outside 5 1/2" csg from 760-560'. (Top salt approx 630'). Spot mud. ~~Tag this plug.~~
6. Spot surf cmt plug. POH. LD tbg.
7. Cut off wellhead. Weld on plate & install surface marker.
8. Clean location.

RECEIVED  
MAR 3 1983

OIL & GAS  
MINERALS MGMT. SERVICE  
ROSWell, NEW MEXICO

18. I hereby certify that the foregoing is true and correct

SIGNED

TITLE District Operations Engineer DATE 2/25/83

(This space for Federal or State use)

APPROVED BY (Orig. Sgd.) PETER W. CHESTER

CONDITIONS OF APPROVAL, IF ANY:

MAR 4 1983

FOR

JAMES A. GILLHAM  
DISTRICT SUPERVISOR

\*See Instructions on Reverse Side